WAVE HILL

ELEV 658

AVFAX CODE 8405 **FULL NOTAM SERVICE NOT AVBL**

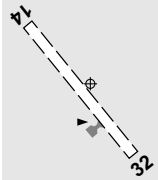

NT UTC +9:30 YWAV
172337S 1310709E VAR 3 DEG E UNCR
AD OPR Western Grazing Company, Wave Hill Station, via Katherine, NT, 0852.
PH 08 8975 0787.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 123.7 5000FT

CTAF 126.7

CHARTS RELATED TO THE AERODROME

WAC 3222.

WEDDERBURN

ELEV 850

FULL NOTAM SERVICE NOT AVBL

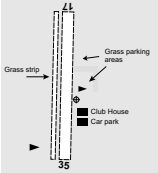

NSW UTC +10 YWBN
341048S 1504832E VAR 13 DEG E UNCR
AD OPR NSW Sport Aircraft Club Inc, PO Box 450, Campbelltown, NSW, 2560.
Email: nswsaccom@gmail.com. PH 0425 380 964.

REMARKS

OPS limited to a MTOW of 4,000KG or less, unless approved.

HANDLING SERVICES AND FACILITIES

Skyfuel AVGAS HJ self serve bowser activated by MC, V and Skyfuel carnets. PH 0418 862 100 or 0417 780 280. Oil AVBL for purchase with prior arrangement, CTC AD OPR.

AERODROME OBSTACLES

Trees surround the entire perimeter of the aerodrome.

PHYSICAL CHARACTERISTICS

17/35 32a Unrated. RWY LEN 980M. WID 15
RWY 35 significant down slope THR to mid RWY.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA SYDNEY CENTRE 124.55 On Ground

LOCAL TRAFFIC REGULATIONS

1. No circuit training prior to 0800 Local.
2. Circuit training by non-resident ACFT not permitted.
3. No aerobatics prior to 0800 Local.

CTAF - AFRU 122.55

NOISE ABATEMENT PROCEDURES

1. Avoid flying over Appin Township.
2. Circuit traffic should avoid flying over the populous areas to the north of the AD.

ADDITIONAL INFORMATION

1. Windshear possible on both RWY in strong wind conditions especially from the west.
2. Model ACFT flying may take place HJ. OPR MNT 122.55 MHz.
3. Animal and bird hazard exists at all times, most prevalent at dawn and dusk.
4. Caution: Drainage ditches between RWY and TWY.
5. Caution: R555C (Holsworthy) 1NM east of the ARP.
6. Grass strip ADJ to and west of the RWY, check primary wind sock for status.

CHARTS RELATED TO THE AERODROME

WAC 3456.

Information may be continued on the next page: PTO