


NadiNet weekly risk brief — Jamuna, Kazipur to Chauhali reach

Issued after the Sentinel-1 pass of **2025-10-17**. Horizon: next 28 days. Risk = calibrated probability that a 200 m bank segment loses at least 40 m of land.

Advisory decision support. The absence of an alert does not mean a bank is safe. Public warnings are issued under an official's authority.

#	Segment	Bank	Lat, Lon	Risk	Latest pass	Why (model reason)
1	W-54700	West bank	24.3855, 89.7391	38%	+100 m	Bank retreated 100 m after high water
2	W-56100	West bank	24.3751, 89.7313	38%	–	Bank sits on an outer bend / in a recess after high water
3	W-56900	West bank	24.3687, 89.7277	38%	–	River is falling after high water; Bank sits on an outer bend / in a recess
4	W-56500	West bank	24.3719, 89.7293	29%	–	Bank sits on an outer bend / in a recess after high water
5	W-56300	West bank	24.3735, 89.7303	29%	–	Bank sits on an outer bend / in a recess after high water
6	W-56700	West bank	24.3703, 89.7285	29%	–	River is falling after high water; Bank sits on an outer bend / in a recess
7	W-83100	West bank	24.1401, 89.6734	25%	+10 m	River is falling after high water; Bank sits on an outer bend / in a recess
8	E-14500	East bank	24.7377, 89.7357	25%	-1510 m	River is falling after high water; Bank sits on an outer bend / in a recess
9	W-82500	West bank	24.1452, 89.6754	25%	+0 m	River is falling after high water; Bank sits on an outer bend / in a recess
10	E-14100	East bank	24.7413, 89.7356	25%	-1900 m	River is falling after high water; Bank height about -4.3 m above the river (DEM)
11	E-14300	East bank	24.7395, 89.7356	25%	-1750 m	River is falling after high water; Bank height about -6.0 m above the river (DEM)
12	E-55700	East bank	24.4021, 89.8059	18%	+10 m	River is falling after high water; Bank sits on an outer bend / in a recess
13	W-49100	West bank	24.4295, 89.7221	18%	-20 m	River is falling after high water; Bank sits on an outer bend / in a recess
14	W-54900	West bank	24.3840, 89.7380	18%	+100 m	Bank retreated 95 m in the last 12 weeks; latest pass shows a further 100 m (unconfirmed); Bank height about -0.6 m above the river (DEM)
15	E-20300	East bank	24.6929, 89.7583	18%	+0 m	Bank sits on an outer bend / in a recess; River is falling after high water
16	E-64900	East bank	24.3195, 89.8131	18%	-30 m	River is falling after high water; Little recent retreat, but the recent pattern still raises risk
17	E-55500	East bank	24.4038, 89.8063	18%	-10 m	River is falling after high water; Bank sits on an outer bend / in a recess
18	W-48900	West bank	24.4312, 89.7213	18%	+0 m	Bank sits on an outer bend / in a recess; Bank height about -7.3 m above the river (DEM)
19	W-82900	West bank	24.1418, 89.6740	18%	+10 m	River is falling after high water; Bank sits on an outer bend / in a recess
20	E-56300	East bank	24.3967, 89.8053	18%	+0 m	River is falling after high water; Bank sits on an outer bend / in a recess

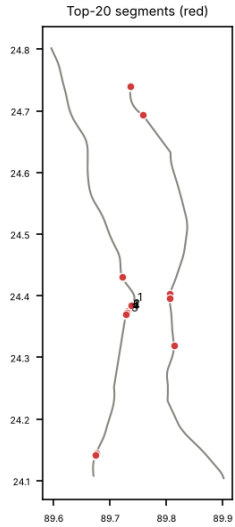

Measured on 2023–2025 hindcasts: on average 42% of the top 20 segments lost at least the threshold within 28 days, versus 4% for 'it eroded recently' (persistence); difference +38.2% (95% CI +30.6% to +46.7%).

Tiers: **Watch** = in this top-20 list. **Warning** = high risk plus retreat on the latest pass; it reaches households only after an official approves it on the dashboard. Raw risk maps stay with officials and partners; public views are aggregated to union level.

Data: Copernicus Sentinel-1 GRD (ESA), descending track 150, ~05:56 local time; banks traced on 10 m water masks. Reasons describe what the model used, not proven causes. Segments not seen on the latest pass carry no forecast.