


PLAN, case frame, seen from above: inner wall at the fillet tangent Z 15.32 (375.01 x 260.71), flat floor dashed, frame window dash-dot; boards at their committed outlines with their mounting holes; legs blue; rods +; arrestors outside the end walls; the back wall at the top.

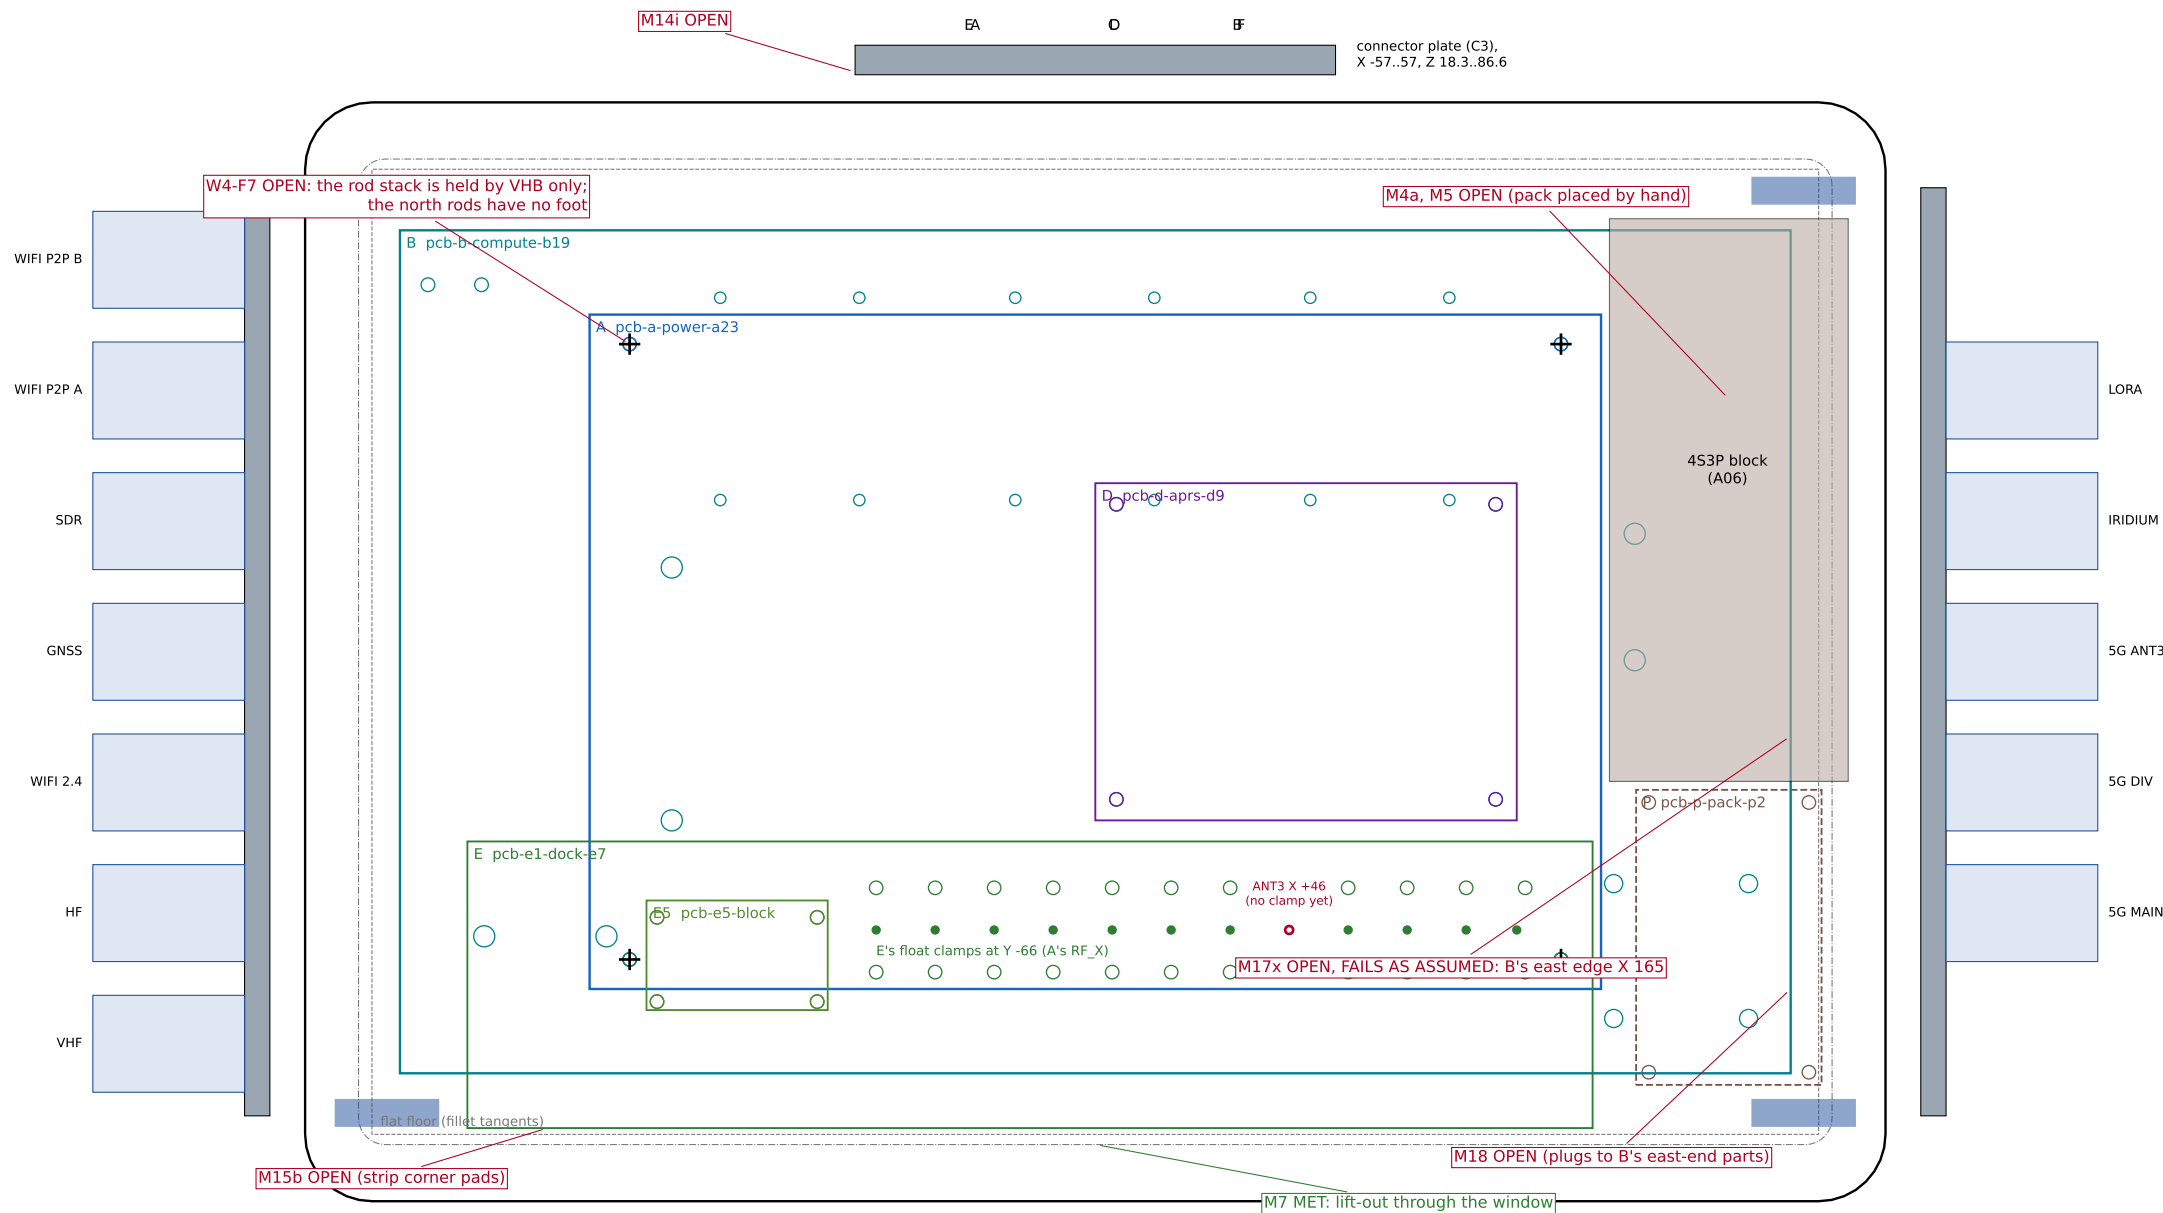

```

MOUNTING (read from the committed boards)
E: 28 holes >= 2.0: 3.2
E5: 4 holes >= 2.0: 3.2
A: 8 holes >= 2.0: 3.2
D: 4 holes >= 2.0: 3.2
B: 30 holes >= 2.0: 2.0, 2.7, 3.2, 4.3, 5.0
C: 12 holes >= 2.0: 15.0, 16.2, 17.0, 19.2, 2.2, 28.6
P: 4 holes >= 2.0: 3.2

```

- face plate: ten 6-32 x 1/2 in into Peli's inserts (C1)
- frame: Peli's four self-tapping screws; the legs in compression
- rod stack (E, A, B on four M3 rods at +110.5, -73); the dock strip's VHB 5952 pads only; the north rods have no foot (W4-F7, OPEN; proposal RF-1 not ruled; T8 bond test)
- D on A: four M3 x 6 standoff; C under the plate: eight PEM S0-M3-10 standoffs; E5 on E: M3 standoffs
- pack group: NOT DESIGNED (S-27, CON-006); placed by hand in this drawing (M4a, M5 OPEN)
- RockBLOCK 9704: four M4 on its bracket (H17..H20); fastener type and drop owed (ASSEMBLY.md)

- lift-out: plate off, frame and legs stay; the stack clears the window by 8.25 per side at the worst (M7 MET)
- back wall: six items on the connector plate (C3); four picks OPEN
- end walls: twelve arrestors on two entry plates (C2, C4), jumpers to E's clamps on planned routes (every jumper row OPEN)
- service ports on B (J FLASH1..3, USB-C) and headers reachable only with the plate off

Margin rows this sheet's features enter (frame_seat.out): key, verdict, min, nominal, worst, worst with unstated x2

M4a	OPEN	1.00	+3.71	+1.85	+0.85	pack block's east corner to Peli's R 15.88 floor fillet (west face X 122, A06)
M4b	MET	1.00	+9.68	+7.38	+6.38	pack block's east face to the east wall
M5	OPEN	1.00	+3.65	+1.77	+0.27	pack group (205.5 long, A06) to the east legs' inner faces at Y 106.4, per side
M7	MET	1.00	+9.83	+8.25	+7.05	stack lift-out through the frame window, per side in X (Y has 16.91)
M15a	MET	1.00	+7.30	+5.92	+4.54	dock strip's underside (on 1.1 pads) to the front floor fillet (edge Y -113, gen_pcb_e.py:15)
M15b	OPEN	0.00	+1.49	+0.11	-1.27	dock strip's corner pads on the flat floor (edge to the tangent)
M16	MET	1.00	+41.49	+40.11	+38.73	rods (+110.5, +73) to the long-wall fillet tangents (61.14 to the end walls)
M17x	OPEN, FAILS AS ASSUMED	1.00	+3.89	-0.38	-4.35	east bundle's inboard column under the plugs to B16's edge (X 165.0), axis at the plug's inner end
M18	OPEN	1.00	+7.63	+3.36	-0.61	jumper plug's inner end to B16's tall parts in X (tightest: RockBLOCK, which it overlaps in Y and Z)
M14i	OPEN	1.00	+1.93	+1.15	+0.47	connector plate edge to the hinge fairings' bases in X
M21f	MET	1.00	+6.40	+4.52	+3.02	leg to B16's corner (165, 100) in Y

TOLERANCES AND STATUS
Dimensions in mm. Kit parts (this sheet): machined positions and outlines +0.10; the 3.0 face plate +0.13 and the 6.0 entry plates +0.20 (EN 485-4 class, standard not held, INFERRED); the setting leg's pad height +0.10; rebate depth and line +0.10; spot-face floors +0.10.
Peli: the 1450PF sheet 1453-314-000 rev A states +0.76 on one-decimal and +0.25 on two-decimal mm (VERIFIED); drawing 1451-931 states no tolerance ("typical industry-standard tolerances apply"), so every case allowance is the session's (INFERRED, UNSTATED).
Design basis only (v2/docs/CASE-MARGINS.md section 1, Verdicts): a MET row still meets its minimum with every unstated allowance taken twice, a sensitivity reading and not a bound on those allowances; an OPEN row rests on something no held source gives. Nominal CAD establishes no fit, seal or alignment; checks T1 to T11 (CASE-MARGINS.md section 5) do. Prototype: nothing on this sheet has been made, bought or fitted.