Highland / drawing reconciliation 05

P1 enclosure and southeast R5 return provisionally reconciled. North dimensional differences remain open.

A2.02 now governs a separate P1 polygon and all fourteen modeled P1 openings. OPEN-01 is restored; the recessed garage gate and adjacent service door follow their plan wall lines. OPEN-14 is restored with the southeast R5 corner, adjoining openings, slab, south roof plate and coping rebuilt together.

Native Cycles daylight image. Illustrative coordination study; complete components and context remain assumed. Not for construction, as-built certification or quantities.

Inventory	Disposition
Original 16 candidates	15 provisionally located; 1 false R5 repeat rejected
Modeled openings	192, including the newly audited P1 service door
North R2-R5 comparison	42.443 pixels maximum center difference; unchanged
Uploaded source set	3 original PDFs / 19 sheets, preserved with exact hashes

Printed drawing date: 04-02-07. Handwritten ASI/RFI references do not include complete response records. The revision 03 film remains a separate earlier delivery.

P1 / an independent enclosure

The previous lower story reused R1. The blue trace below follows A2.02; red shows the displaced R1 outline. The residential south steps, continuous parking perimeter and recessed east garage/service line are now distinct. All twelve inherited P1 opening records were rechecked; OPEN-01 and a service door were added.

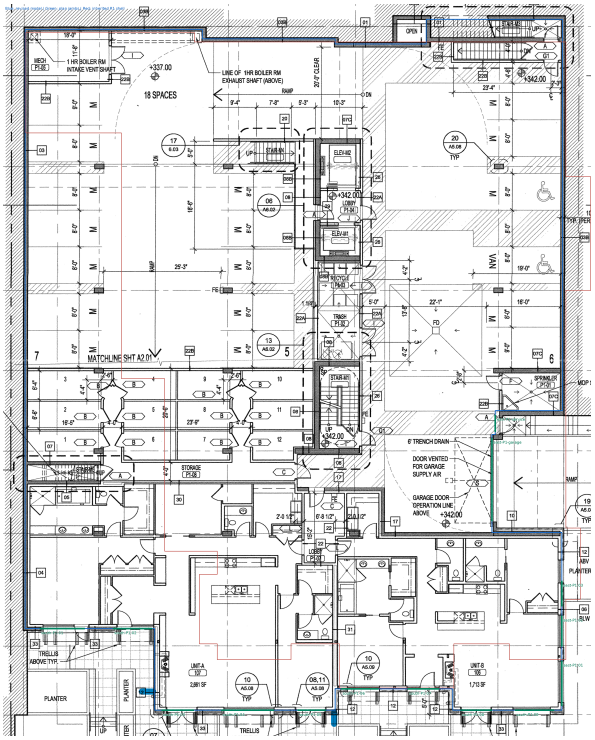

Left: full plan trace. Right: saved native P1 only. Green source marks are measured jambs. Orange native components remain assumed.

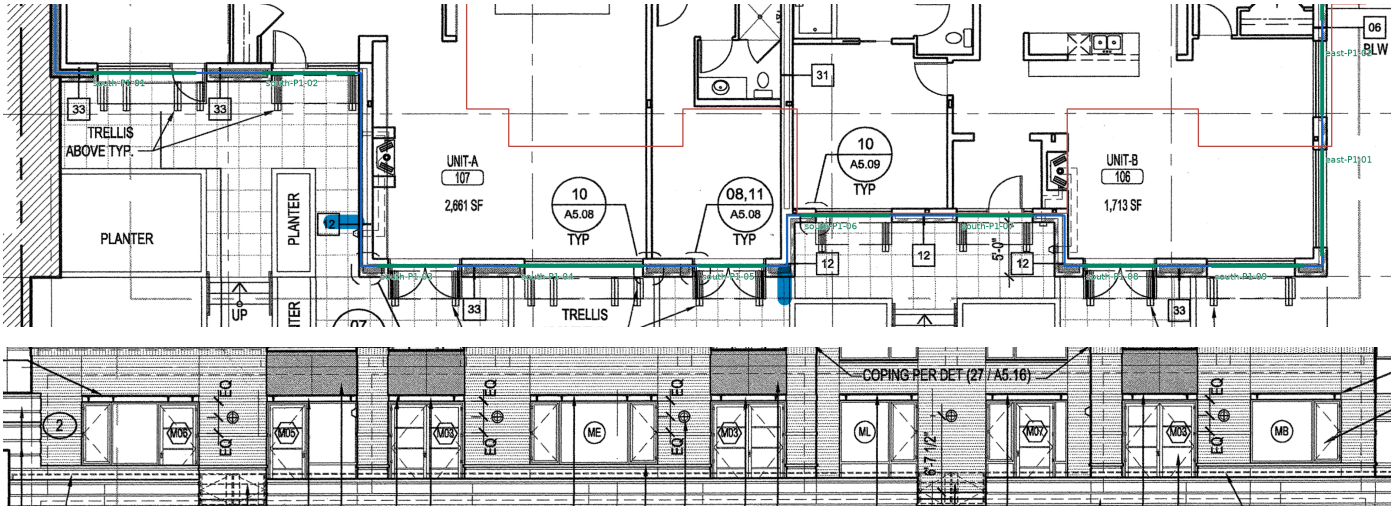

The south opening order is checked against A3.01. The east MA/MC/MI group, overhead gate and service door have separate plan picks and elevation evidence in source-review/. No opening is squeezed to the inherited return.

Limits: the open ventilation shaft, external planters/trellises and parking ramp are excluded from the enclosed slab model. P1 remains a flat, simplified shell; below-grade heights, structural slab design, sill/head dimensions and complete sections are assumed.

Southeast R5 / coupled return correction

The inner corner moves 31.556 inches west under the independently calibrated A2.07 plan. OPEN-14 keeps its full measured jamb span. Adjacent east MA/MF openings and the final south MO/MU pair are re-registered to fit the revised wall, with no jamb clipping.

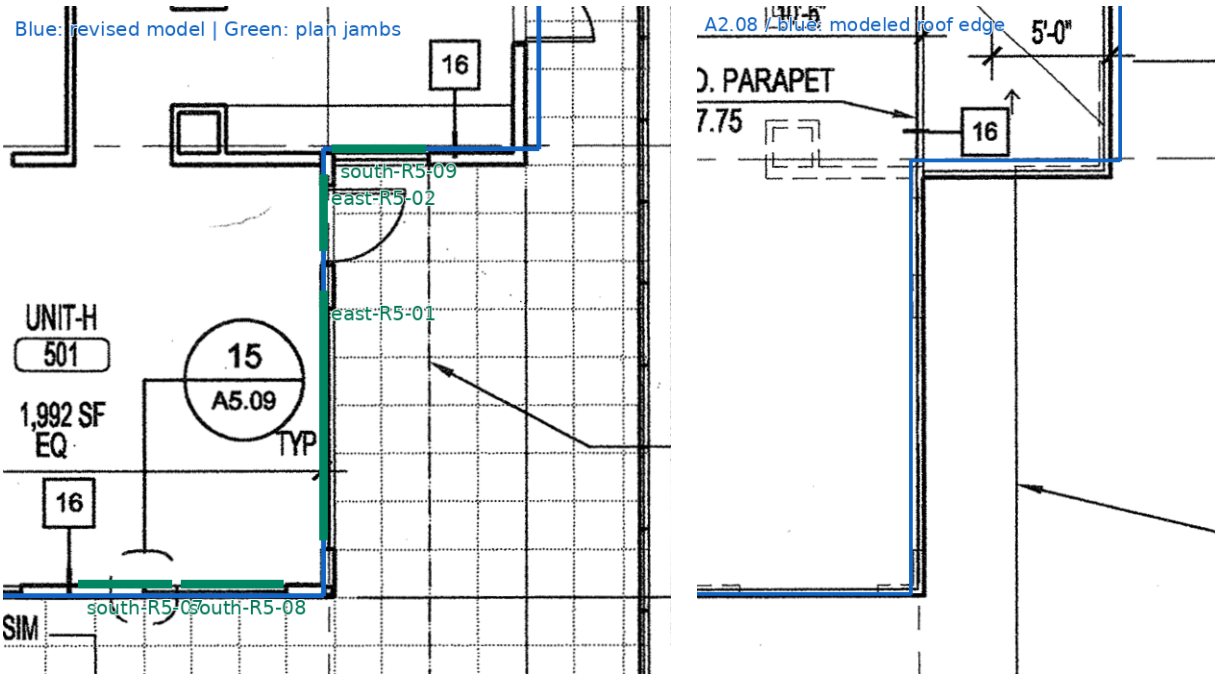

A2.07 plan (left) and independently registered A2.08 roof (right). Blue is the revised model centerline; green marks plan jambs. The R5 slab, south roof plate and four adjoining coping pieces follow the revised enclosure. The modeled coping top remains 406.25 ft; its section remains assumed.

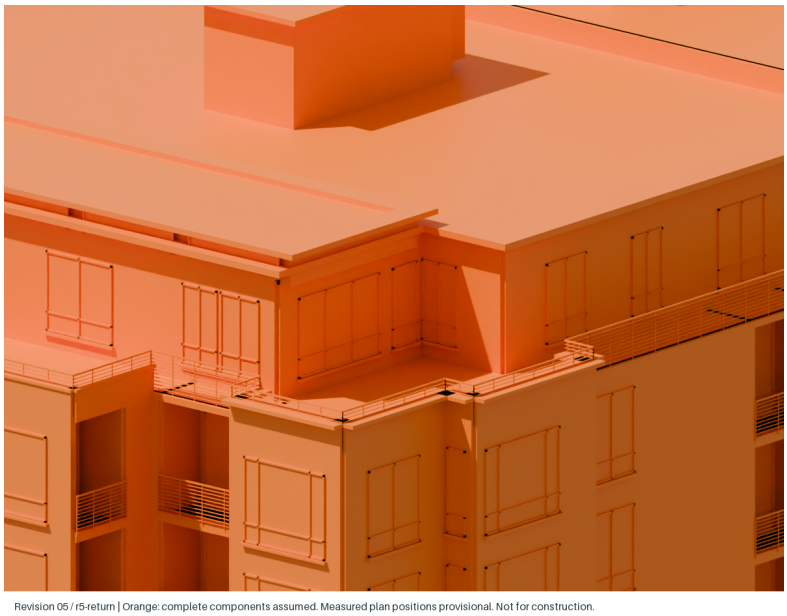

Revision 05 / r5-return | Orange: complete components assumed. Measured plan positions provisional. Not for construction.

Remaining local differences are explicit: the inherited long east line differs from the A2.07 pick by 7.743 in; the south baseline by -5.569 in. The independent roof step pick differs from the model by -0.844 in X and 2.400 in Y. These are diagnostic residuals, not tolerances or passes.

The final south MO/MU internal split remains provisional. Other R5 steps, especially the southwest terrace/enclosure boundary, need a separate full-footprint audit. A4/A5 coping and guard profiles remain unavailable.

North / unchanged, explicit disagreement

R2-R5 retain six north openings per floor. All 97 protected north meshes are identical to revision 04. The blue plan-model projection still differs from A3.02 by up to 42.443 pixels on the inherited 1815-pixel overview raster.

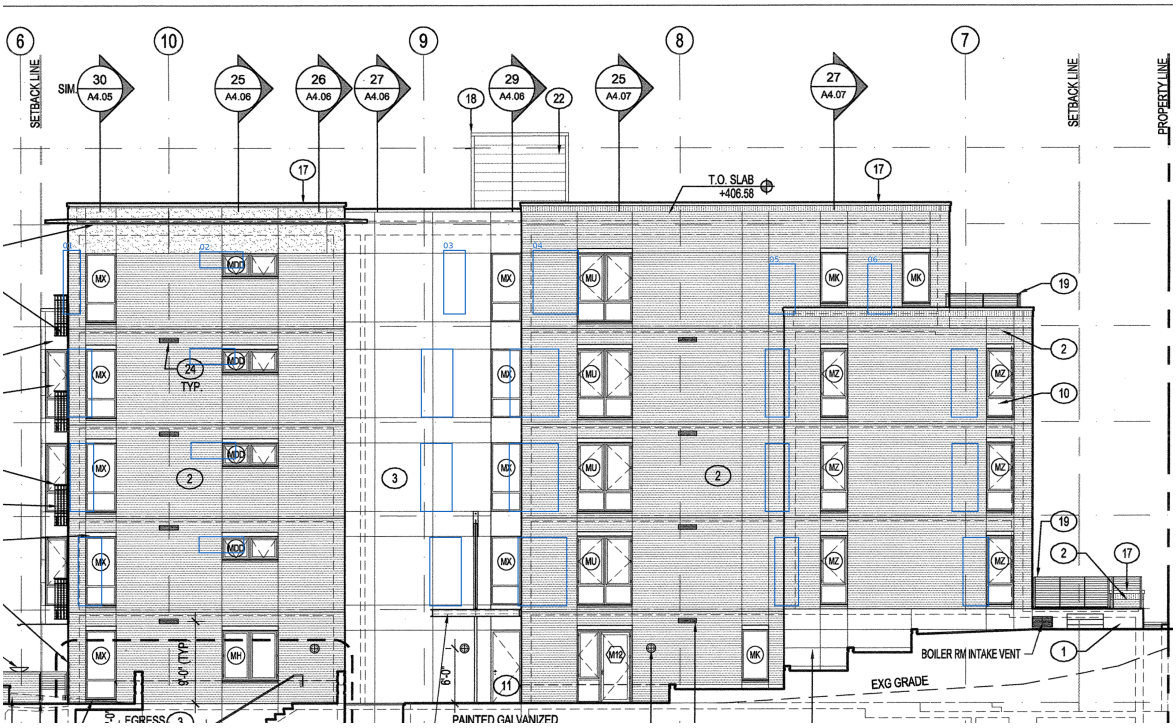

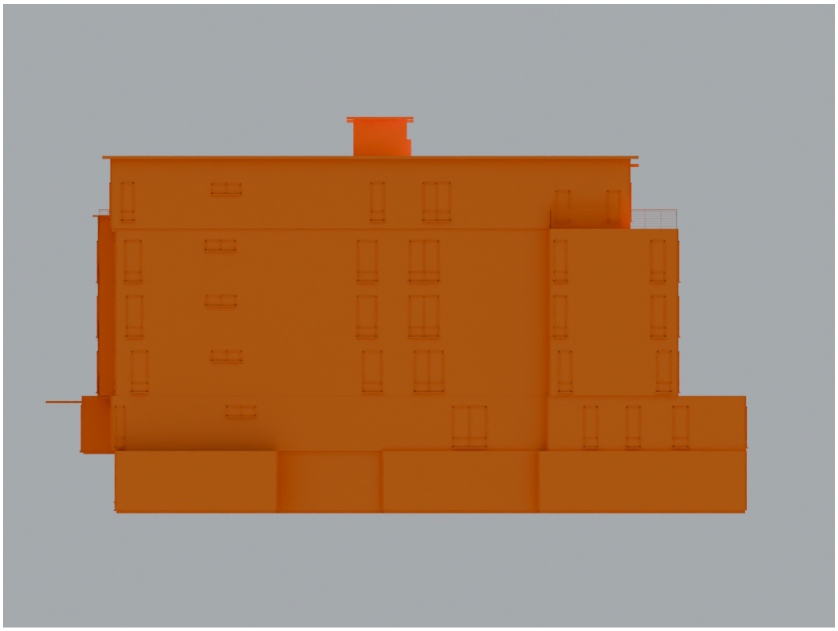

Revision 05 / north | Orange: complete components assumed. Measured plan positions provisional. Not for construction.

The stair/MU pair remains the prominent conflict. Plan/elevation registration, raster picks and simplified wall depth all affect this diagnostic. Plan jambs continue to govern provisional locations. The north stair/MU alignment and R1 north door/entry audit are deferred at the owner's request.

elevation-comparison.json retains the source center, projected center and signed delta for each of the 24 R2-R5 openings. This is a spec projection, not an independent rendered-edge accuracy certificate. Native frame extents are checked separately against the spec.

Disposition of the original 16 candidates

Provisional placement confirms source presence and a modeled plan location. It does not close dimensional alignment, schedule, profile, sill/head, RFI or installed-condition questions.

ID	Floor / face	Disposition	Model opening
OPEN-01	P1 / south	Provisional placement	south-P1-02
OPEN-02	R1 / south	Provisional placement	south-R1-02
OPEN-03	R2 / south	Provisional placement	south-R2-02
OPEN-04	R2 / north	Provisional placement	north-R2-01
OPEN-05	R2 / north	Provisional placement	north-R2-06
OPEN-06	R3 / south	Provisional placement	south-R3-02
OPEN-07	R3 / north	Provisional placement	north-R3-01
OPEN-08	R3 / north	Provisional placement	north-R3-06
OPEN-09	R4 / south	Provisional placement	south-R4-02
OPEN-10	R4 / north	Provisional placement	north-R4-01
OPEN-11	R4 / north	Provisional placement	north-R4-06
OPEN-12	R5 / south	Provisional placement	south-R5-01
OPEN-13	R5 / south	Provisional placement	south-R5-02
OPEN-14	R5 / south	Provisional placement	south-R5-09
OPEN-15	R5 / north	Provisional placement	north-R5-06
OPEN-16	R5 / north	False R5 repeat	Not added

OPEN-01 links to south-P1-02 on the separate P1 enclosure. OPEN-14 links to south-R5-09 on the revised southeast return. OPEN-16 remains rejected: the lower-floor MZ does not repeat on R5; two MK windows occur farther east.

The P1 service door is additional to this original candidate list. The model has 192 opening records. Use the cumulative change ledger and the separate shell-reconciliation record when tracing identities and geometry changes.

Verification and remaining work

Check	Result
Saved native mesh inventory	997 architectural meshes; 772 protected meshes identical to revision 03
P1 opening audit	14 records; plan jambs retained without clipping
Corrected wall void overlaps	0
Slabs / coping	P1 and R5 perimeters, slab areas and levels read back; changed coping tops checked
Protected controls	R1/typical footprints, all six floor datums, dimensioned grids, roof plates/split, towers and terrace geometry
North continuation	97 mesh hashes identical to revision 04
Native scenes / saved dusk camera	Daylight + Dusk; all 432 frames checked
Packed images / portable GLB	No external image dependencies; every architectural mesh exported
Render-workflow regression tests	11 passed, no skips, using bpy 5.0.1

Opening frame extents and wall-normal locations are read back from the saved native file. Floating-point agreement with the spec verifies reproducibility, not accuracy of the drawing measurements. Source and native review evidence is recorded by exact file hash.

Continue with source reconciliation

North stair/MU alignment and R1 north entries are deferred. Next, audit the remaining R5 footprint, especially the southwest terrace/enclosure boundary, southeast tie-in residuals and the MO/MU split. Then review terrace/coping/guard arrangement with unsupported profiles kept provisional. P1 ramp and below-grade details can follow if the parking level is developed further.

The supplied A2.08 confirms top-elevation callouts but lacks the referenced A4/A5 cornice, coping and exterior guard profiles. A6 stair guards do not establish terrace guards. Window schedules, complete ASI/RFI responses and field verification remain necessary before confirming dimensions or installed conditions.

Source files: site-and-floor-plans.pdf (A1.01, A2.01-A2.08); exterior-elevations-and-sections.pdf (A3.01, A3.02, A3.11-A3.13); stairs-and-rcp.pdf (A6.01-A6.04, A7.51). Exact hashes and page mapping are in source-inventory.json.