


### 19:1 Metal Gearmotor 37Dx68L mm with 64 CPR Encoder



This gearmotor is a powerful 12V brushed DC motor with a **18.75:1** metal gearbox and an integrated quadrature encoder that provides a resolution of 64 counts per revolution of the motor shaft, which corresponds to **1200 counts per revolution** of the gearbox's output shaft. These units have a 0.61"-long, 6 mm-diameter D-shaped output shaft. This gearmotor is also available **without an encoder**.

Key specs at 12 V: 500 RPM and 300 mA free-run, 84 oz-in (6 kg-cm) and 5 A stall.



Description Specs (13) Pictures (12) Resources (3) FAQs (2) On the blog (2)

## **Dimensions**

Size:	37D x 68L mm <sup>1</sup>
Weight:	215 g
Shaft diameter:	6 mm

# **General specifications**

Gear ratio:	19:1	
Free-run speed @ 12V:	500 rpm	
Free-run current @ 12V:	300 mA	
Stall current @ 12V:	5000 mA	
Stall torque @ 12V:	84 oz·in	
Free-run speed @ 6V:	256 rpm <mark>²</mark>	
Free-run current @ 6V:	250 mA <sup>2</sup>	
Stall current @ 6V:	2500 mA <sup>2</sup>	
Stall torque @ 6V:	42 oz∙in <mark>²</mark>	
Lead length:	11 in	

#### Notes:

- 1 Length measurement does not include gearbox shaft or the raised area immediately around it
- 2 This motor will run at 6 V but is intended for operation at 12 V.

#### 19:1 Metal Gearmotor 37Dx68L mm with 64 CPR Encoder



This gearmotor is a powerful 12V brushed DC motor with a **18.75:1** metal gearbox and an integrated quadrature encoder that provides a resolution of 64 counts per revolution of the motor shaft, which corresponds to **1200 counts per revolution** of the gearbox's output shaft. These units have a 0.61"-long, 6 mm-diameter D-shaped output shaft. This gearmotor is also available **without an encoder**.

Key specs at 12 V: 500 RPM and 300 mA free-run, 84 oz-in (6 kg-cm) and 5 A stall.



 Description
 Specs (13)
 Pictures (12)
 Resources (3)
 FAQs (2)
 On the blog (2)

#### Overview

This powerful brushed DC gearmotor is available in six different gear ratios and features an integrated quadrature encoder with 64 counts per revolution (CPR) of the motor shaft. The **motor and encoder portion** is available by itself (no gearbox), and versions without the encoder are also available.

	No-Load	Stall	Stall	Poloiti	Poloiu
Gear Ratio	Speed @ 12 V	Torque @ 12 V	Current @ 12 V	With Encoder	Without Encoder
1:1	11,000 RPM	5 oz-in	5 A	motor without gearbox	
19:1	500 RPM	84 oz-in	5 A	37Dx68L mm	37Dx52L mm
30:1	350 RPM	110 oz-in	5 A	37Dx68L mm	37Dx52L mm
50:1	200 RPM	170 oz-in	5 A	37Dx70L mm	37Dx54L mm
70:1	150 RPM	200 oz-in	5 A	37Dx70L mm	37Dx54L mm
100:1	100 RPM	220 oz-in	5 A	37Dx73L mm	37Dx57L mm
131:1	80 RPM	250 oz-in	5 A	37Dx73L mm	37Dx57L mm

**Note:** Stalling or overloading gearmotors can greatly decrease their lifetimes and even result in immediate damage. Stalls can also result in rapid (potentially on the order of seconds) thermal damage to the motor windings and brushes; a general recommendation for brushed DC motor operation is 25% or less of the stall current.

These motors are intended for use at 12 V, though in general, these kinds of motors can run at voltages above and below the nominal voltage (they can begin rotating at voltages as low as 1 V). Lower voltages might not be practical, and higher voltages could start negatively affecting the life of the motor.






These gearmotors are functionally identical to the previous versions we carried <u>without end caps</u> (they use the same motor, encoder, and gearboxes). The black plastic end cap is easily removable if you need to access the encoder or want to slightly reduce the overall gearmotor size, but there is a little bit of base plastic that will remain, as shown in the pictures below:



#### Details for item #2822

Exact gear ratio:  $\frac{25 \times 30 \times 30}{10 \times 10 \times 12} =$ **18.75: 1** 

#### **Dimensions**

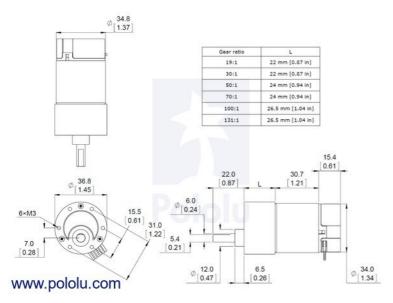

Dimensions of the 37D mm metal gearmotor with 64 CPR encoder. Units are mm over [inches].

This diagram is also available as a **downloadable PDF** (286k pdf).

**Warning**: Do not screw too far into the mounting holes as the screws can hit the gears. We recommend screwing no further than 3mm (1/8") into the screw hole.

### **Using the Encoder**

A two-channel Hall effect encoder is used to sense the rotation of a magnetic disk on a rear protrusion of the motor shaft. The quadrature encoder provides a resolution of 64 counts per revolution of the motor shaft when counting both edges of both channels. To compute the counts per revolution of the gearbox output, multiply the gear ratio by 64. The motor/encoder has six color-coded, 11" (28 cm) leads terminated by a 1×6 female header with a 0.1" pitch, as shown in the




37D mm metal gearmotor with 64 CPR encoder (with end cap

<u>0.1" male headers</u> and our male <u>jumper</u> and <u>precrimped wires</u>. If this header is not convenient for

your application, you can pull the crimped wires out of the header or cut the header off. The following table describes the wire functions:

Color	Function
Red	motor power (connects to one motor terminal)
Black	motor power (connects to the other motor terminal)
Green	encoder GND
Blue	encoder Vcc (3.5 – 20 V)
Yellow	encoder A output
White	encoder B output

The Hall sensor requires an input voltage, Vcc, between 3.5 and 20 V and draws a maximum of 10 mA. The A and B outputs are square waves from 0 V to Vcc approximately  $90^{\circ}$  out of phase. The frequency of the transitions tells you the speed of the motor, and the order of the transitions tells you the direction. The following oscilloscope capture shows the A and B (yellow and white) encoder outputs using a motor voltage of 12 V and a Hall sensor Vcc of 5 V:

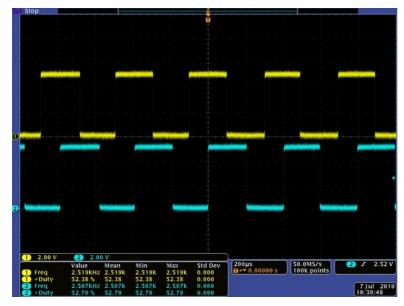

Encoder A and B outputs for 37D mm metal gearmotor with 64 CPR encoder (motor running at 12 V).

By counting both the rising and falling edges of both the A and B outputs, it is possible to get 64 counts per revolution of the motor shaft. Using just a single edge of one channel results in 16 counts per revolution of the motor shaft, so the frequency of the A output in the above oscilloscope capture is 16 times the motor rotation frequency.

## **Gearmotor accessories**

The face plate has six mounting holes evenly spaced around the outer edge threaded for M3 screws. These mounting holes form a regular hexagon and the centers of neighboring holes are 15.5 mm apart. We carry two brackets for these gearmotors: a **stamped aluminum L-bracket** (sold in pairs) and a sturdier, tombstone-style **machined aluminum bracket** (sold individually):



Gearmotor with bracket and hub.



Pololu machined aluminum bracket for 37D mm metal gearmotors mounting a motor to a clear piece of acrylic.

The 6 mm diameter gearbox output shaft works with the <u>Pololu universal aluminum mounting hub for 6mm shafts</u>, which can be used to mount our larger <u>Pololu wheels</u> (80mm- and 90mm-diameter) or custom wheels and mechanisms to the gearmotor's output shaft as shown in the left picture below. Alternatively, you could use our <u>6mm scooter wheel adapter</u> to mount many common scooter, skateboard, and inline skate wheels to the gearmotor's output shaft as shown in the right picture below:



37D mm metal gearmotor with 64 CPR encoder connected to a Pololu 90×10mm wheel with a Pololu universal mounting hub.



A 37D mm gearmotor connected to a scooter wheel by the 6 mm scooter wheel adapter.

For a general-purpose hex adapter, consider our <u>12mm hex wheel adapter</u> (also available in an <u>extended version</u>), which lets you use these motors with many common hobby RC wheels, including <u>Dagu Wild Thumper Wheels</u>:



12mm Hex Wheel Adapter for 6mm Shaft connecting a Wild Thumper Wheel to a 37D mm Metal Gearmotor.

We have a number of <u>motor controllers</u> and <u>motor drivers</u> that work with these 37D mm metal gearmotors. In particular, we recommend our VNH5019-based motor drivers, for which we have basic <u>single</u> and <u>dual carriers</u>. If you are looking for higher-level control interfaces, such as USB, RC, analog voltages, or TTL serial, consider our <u>SMC 18v7</u> or (<u>SMC 18v15</u>, if you want something that will run a little cooler), <u>Jrk 12v12</u>, or <u>TReX motor controller</u>.



Pololu dual VNH5019 motor driver shield for Arduino.



Pololu TReX Dual Motor Controller.



Simple Motor Controller 18v7, fully assembled.

We have an assortment of Hall effect-based <u>current sensors</u> to choose from for those who need to monitor motor current:





ACS711EX current sensor carrier -15.5A to +15.5A.

ACS714 current sensor carrier -5A to +5A.

### Selecting the Right Gearmotor

We offer a wide selection of metal gearmotors that offer different combinations of speed and torque. Our <u>metal gearmotor comparison table</u> can help you find the motor that best meets your project's requirements.



Some of the Pololu metal gearmotors.

### People often buy this product together with:



Pololu Stamped
Aluminum LBracket Pair for
37D mm Metal
Gearmotors



Pololu Universal
Aluminum
Mounting Hub for
6mm Shaft, #4-40
Holes (2-Pack)



30:1 Metal Gearmotor 37Dx68L mm with 64 CPR Encoder