



GE Medical Systems

Technical Publications

Direction 2327072
Revision 0

Signa LX Release 9.0 M4 Patch 10 Software Load

Copyright© 2002 by General Electric Co.

Operating Documentation

TABLE OF CONTENTS

1- OVERVIEW	3
2- LOADING SIGNA 9.0 PATCHES FROM CD-ROM.....	3

1- OVERVIEW

The Signa LX 9.0 M4 Patch 10 CD contains fix for the High Order Shim option.

- High Order Shim option installation is not on M4 software CD

Note

Signa software must be at Release 9.0 M4 to install this patch CD.

2- LOADING SIGNA 9.0 PATCHES FROM CD-ROM

1. With the system running and software at the scanning level, go to the Service Desktop and select the **[C Shell]** button in the lower left toolbar.
2. Inside the C Shell window, log in as the root user by typing the following:


su <Enter>

Password: **operator <Enter>** ("operator" is the system default root password. Use whatever password is appropriate for the system you are working on if it has been changed.)

3. Place the "Signa 9.0 M4 Patch03" CD in the system CD drive. Wait 20 seconds for the system to see the CD, or until the amber light on the front of the CD drive stops blinking.
4. Inside the C Shell, type the following:

mediad <Enter> (This command mounts the CDROM.)


swmgr <Enter> (This command starts the software manager which is used to load the patch.)

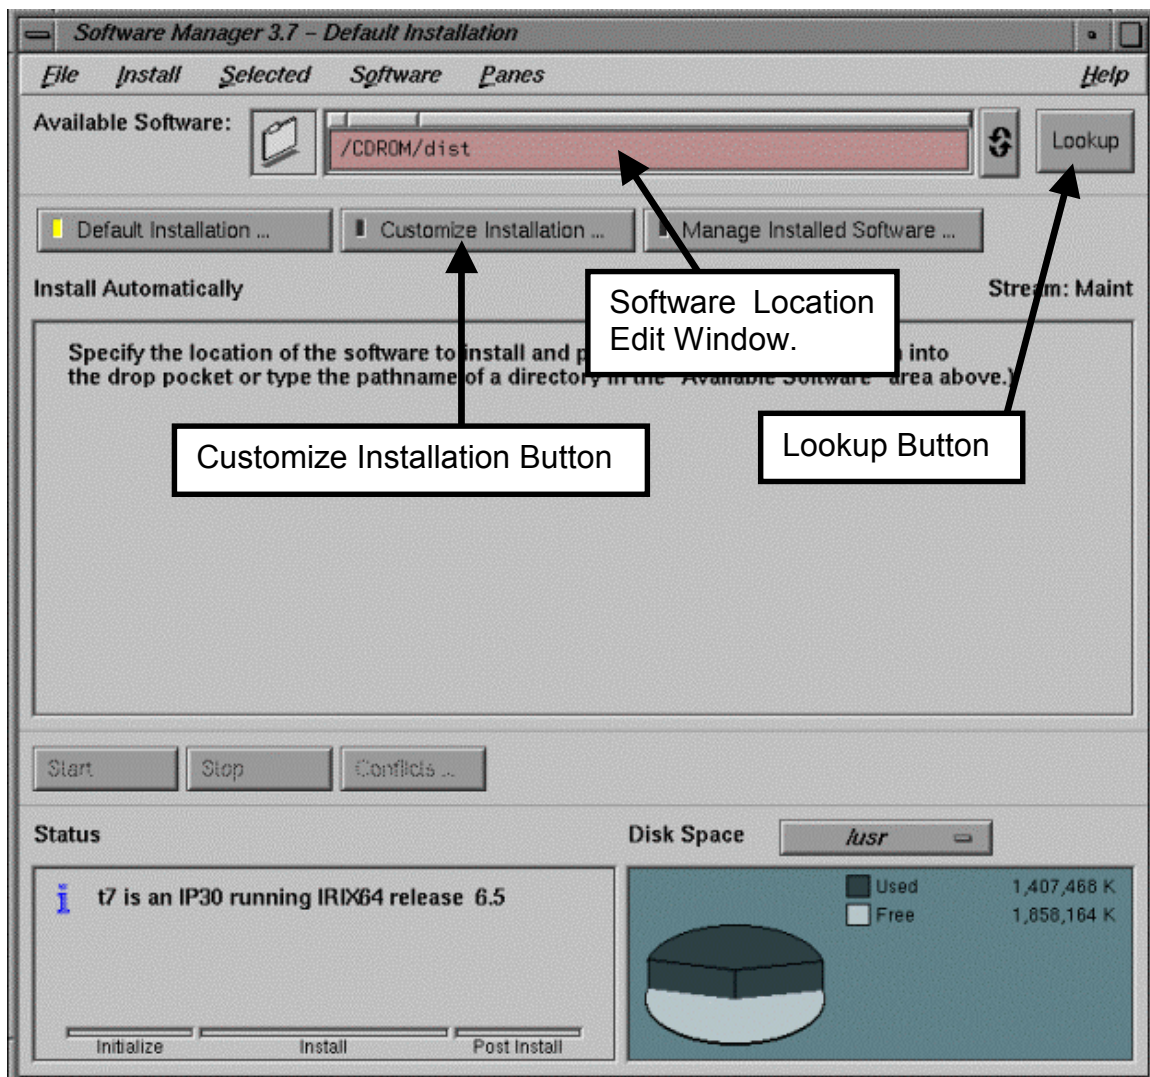

SOFTWARE MANAGER INITIALIZATION
ILLUSTRATION 2-1

5. Once the Software Manager starts, begin typing the following in the **[Software Location Edit Window]**. See Illustration 2-1.

/CDROM (The system will automatically enter **"/dist"** after you type **/CDROM**.)
6. Click the **[Lookup]** button found to the right of the **[Software Location Edit Window]**. See Illustration 2-1.
7. Click the **[Customize Installation]** button at the top of the screen. See Illustration 2-1.

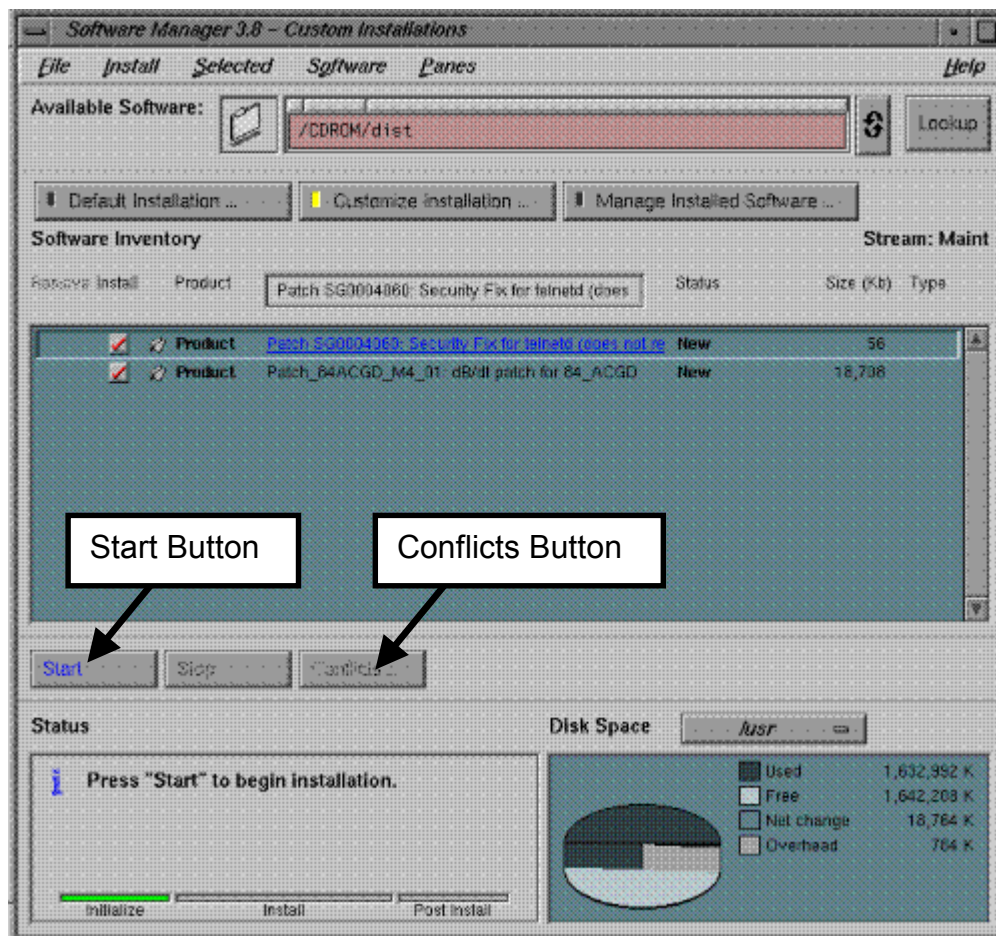


LOADING THE LX 9.0 M4 PATCH
ILLUSTRATION 2-2

8. All available patches should be visible at this time in the selection window. Any patches that apply to your system and are not loaded will be selected (check marked). Make sure "Patch 10 for 9.0 M4 Release" is checked; make sure no others are checked. See Illustration 2-2. One of two things will happen next:
 - a. The **[Start]** button will activate (The letters in "Start" will change colors or shades). If the **[Start]** button activates, push it and the patch load will begin. A progress bar will open and count up from 0 to 100%. The load takes less than 1 minute. When the progress bar goes away, a confirmation window will be displayed. Select **[Exit]** to quit the Software manager.
 - b. After the patch is selected, if there is a problem, the **[Conflicts]** button will activate, (the letters in "Conflicts" change colors or shades). If this happens, this indicates that your system does not need this patch and the indicated patch will not be loaded. Push the **[Conflicts]** to view the error if desired. (See Note 1 and Note 2.)

Note 1: If Patch 10 9.0 M4 "LX_9.0 M4 High Order Shim" was previously installed, it will be flagged as a conflict now. You should allow the Software Manager to uninstall Patch 10 9.0 M4.

Note 2: If Patch 10 9.0 M4 "LX_9.0 M4 High Order Shim" was previously installed, it will be flagged as a conflict now. If Patch 10 9.0 M4 was previously installed, you should not install it again.

9. After installation, select **Exit, Installations completed** checkbox, then select **[OK]**. See Illustration 2-3.

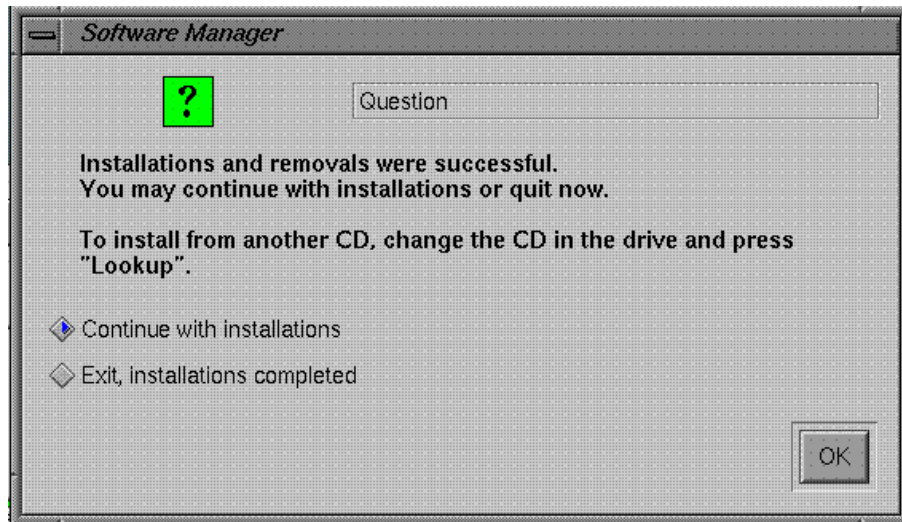

INSTALLATION DECISION WINDOW
ILLUSTRATION 2-3

10. In the C Shell type the following to eject the CD-ROM from the drive:

umount /CDROM <Enter> (Un-mounts the CD from the system.)
eject /CDROM <Enter> (Opens the CD drawer.)

11. If the patches were required and loaded, verify they are installed by typing in the C Shell:

getver <Enter> You should see an entry for the LX M4 patch as follows:

Build number for MrpApps is 90.29F_M4_0139.z
Build number for PostSdC is 90.29F_M4_0139.z
Build number for cclass is 90.29F_M4_0139.z
Build number for driverSupport is 90.29F_M4_0139.z
Build number for insite is 2.3-mips
Build number for install is 90.29F_M4_0139.z
Build number for os_cd is 6_11.1.a
Build number for os_u_cd is 6u11.6.a
Build number for patch_90_M4_10 is 90.29F_M4_0139.z.PC <- Patch for HO shim
Build number for pc is 90.29F_M4_0139.z
Build number for z is Upgrade
MR Software release: 9.0.0139z

12. Reboot Signa for the patch to take effect.