

TABLE OF CONTENTS

TABLE OF CONTENTS1

1- OVERVIEW2

2- CHECK RF AMPLIFIER FANS AND CABINET FILTERS2

 2- CHECK RF AMPLIFIER FANS AND CABINET FILTERS (Continued)4

REVISION HISTORY7

1- OVERVIEW

This section describes the air filter replacement process for both the RF/PDU and SRF cabinets. The cabinet uses forced air cabinet cooling. The cabinet air passes through viscous impingement air filters that must be replaced as necessary to ensure proper cabinet cooling. **Replace filters during the initial installation of the site before turning the system over to the customer.** When replacing air filters, be sure to use GE part number **46-251301P151**.


Note

The illustrations in this document show the 1.0T RF/PDU and SRF cabinets but the filter and cover placement on these cabinets is the same for the corresponding 1.5T cabinets.

2- CHECK RF AMPLIFIER FANS AND CABINET FILTERS


1. See Illustration 2-1 for the 1.0T RF/PDU Cabinet and Illustration 2-2 for the 1.0T SRF Cabinet.
2. Turn the recessed screw at the top center of the front cover 1/4 turn counterclockwise to release the cover latch.
3. Tilt the top of the front cover forward, and lift up and out to remove the cover for access to the filter(s).
4. Remove each filter by lifting up slightly and pulling bottom edge outward.
5. Inspect the filter for dust build-up, and replace as required.
6. Re-install the filters so that the top of the filter goes first into the top bracket and then drop the bottom part of the filter down into lower bracket. Keep the intake side (side with cleaning instructions) facing the door.

2- CHECK RF AMPLIFIER FANS AND CABINET FILTERS (Continued)

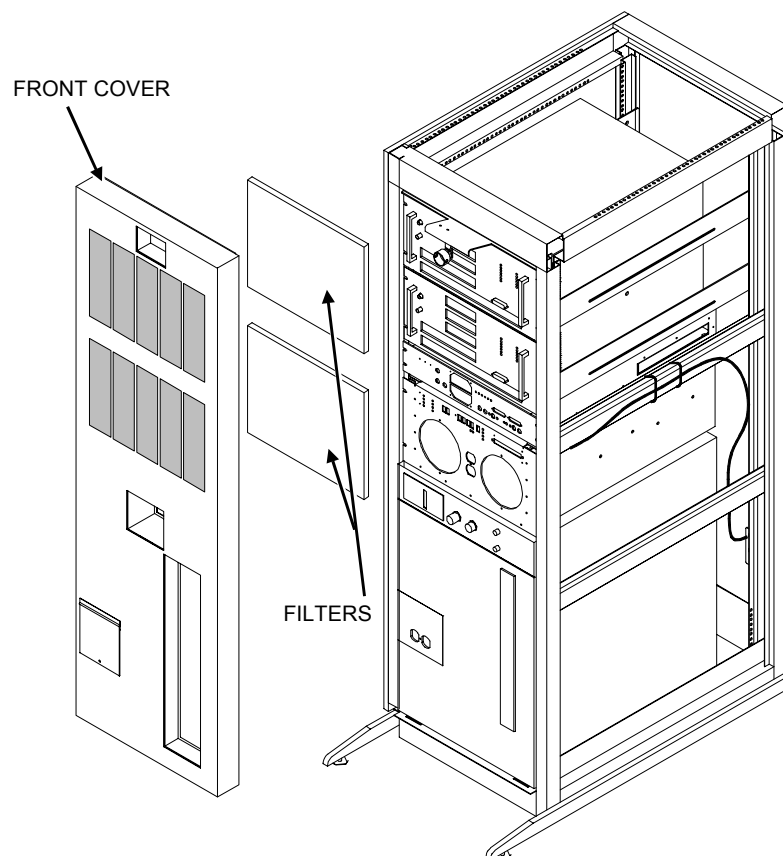

RF/PDU CABINET COVER AND FILTER LOCATIONS
ILLUSTRATION 2-1

2- CHECK RF AMPLIFIER FANS AND CABINET FILTERS (Continued)

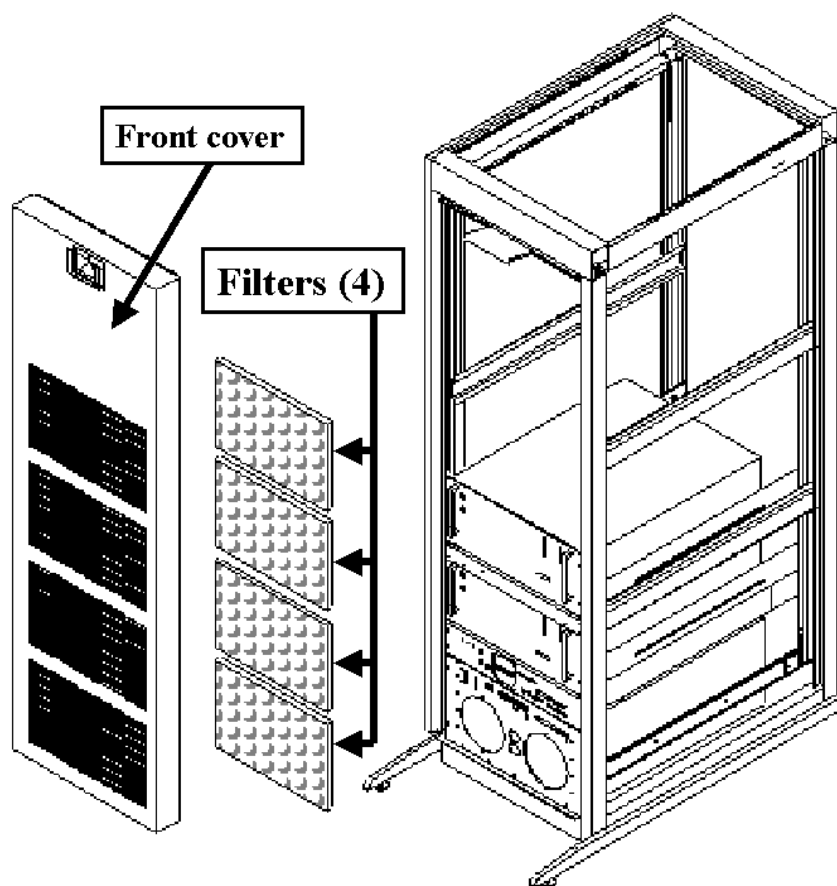


SRF CABINET COVER AND FILTER LOCATIONS
ILLUSTRATION 2-2

2- CHECK RF AMPLIFIER FANS AND CABINET FILTERS (Continued)

7. Check the operation of the fans inside each RF amplifier.


- a) **For 1.0T:** Probe Fans (2195572), on the rear of both RF Amplifiers, with a small ty-wrap to make sure they are operating. See Illustration 2-3.

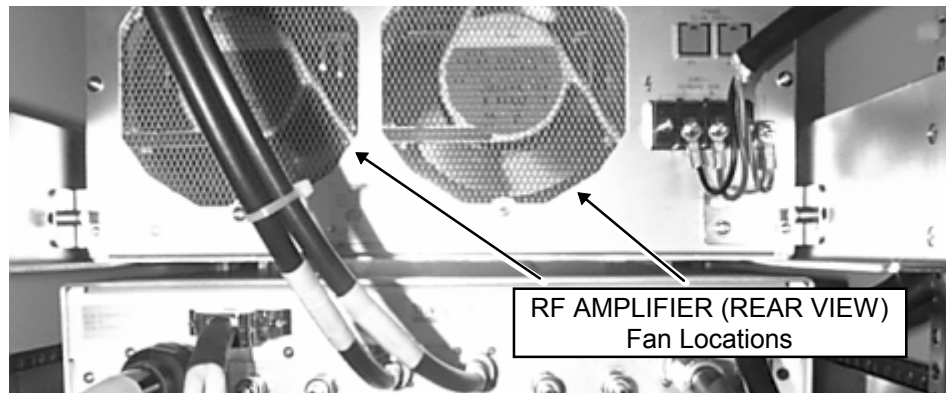

1.0T TELI RF AMPLIFIER FAN LOCATIONS
ILLUSTRATION 2-3

- i) Refer to the **1.0T RF/PDU Cabinet RF Amplifier Replacement Procedures** (RC3REA3.DOC) on the 8.X Service Methods CDROM to replace a fan in a Teli 1.0T amplifier installed in an RF/PDU cabinet.
- ii) Refer to the **1.0T SRF Cabinet RF Amplifier Replacement Procedures** (RC6REA3.DOC) on the 8.X Service Methods CDROM to replace a fan in a Teli 1.0T amplifier installed in an SRF cabinet.
- b) **For 1.5T:** Probe Fans (2176114), on the front of both RF Amplifiers, with a small ty-wrap to make sure they are operating. See Illustration 2-4.

FRONT VIEW

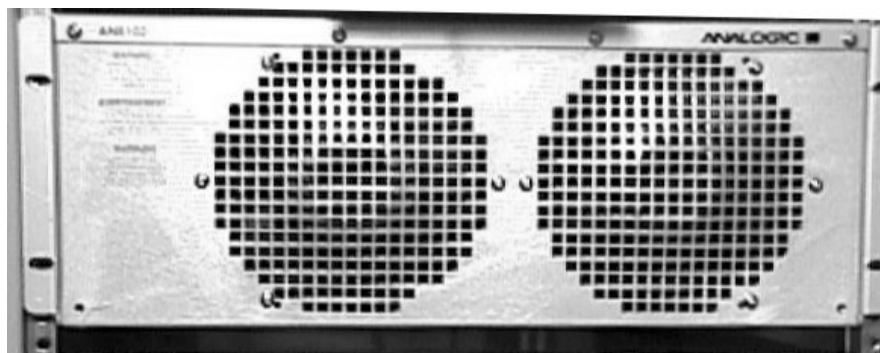

1.5T ANALOGIC RF AMPLIFIER FAN LOCATIONS
ILLUSTRATION 2-4

- i) Refer to the **1.5T RF/PDU Cabinet RF Amplifier Replacement Procedures** (RC4REA3.DOC) on the 8.X Service Methods CDROM to replace a fan in an Analogic 1.5T amplifier installed in an RF/PDU cabinet.

2- CHECK RF AMPLIFIER FANS AND CABINET FILTERS (Continued)

- ii) Refer to the **1.5T SRF Cabinet RF Amplifier Replacement Procedures** (RC5REA3.DOC) on the 8.X Service Methods CDROM to replace a fan in an Analogic 1.5T amplifier installed in an SRF cabinet.
- 8. Replace the front cover on the cabinet by inserting the lower cover lip behind the shoulder bolts at the bottom of the cabinet and swinging the top of the door into the spring loaded "slam-latch".

REVISION HISTORY

REV	DATE	AUTHOR	PRIMARY REASONS FOR CHANGE
A	July 23, 1997 Feb 13, 1998	K. Verdon (Erbtec) K. Keshena	Preliminary Version Updated to 1.0T RF/PDU Cabinet.
0	June 30, 1998	KK	Initial Release.
1	December 30, 1998	K. Keshena	Added correct GE part numbers for filters and fans. Added illustrations.
2	May 10, 1999	K. Keshena	Added 1.5T RF/PDU Cabinet information to file.
3	January 9, 2001	D. Thome	Added SRF cabinet information and picture.