

[new...](#) | [page status](#)

welcome!
ct tech pubs web page
ct water cooler
ct tech pubs updates
surveys
9800/hla
highspeed family (us)
ct/i
lightspeed family
yms family
all ct products
index
old ct emails
[communiques pending approval](#)
customize
members

search:

advanced search
news: daily | weekly

go offline | chat | notify |
print | tutorial | help

home> [communiques](#)
[pending approval](#)

ETC Slip Rings and Brush Replacements

christopher hardiman (christopher c hardiman), 07/16/2002 - 06:34 am



PROPRIETARY WARNING

This information is Property of GE - For GE Service Personnel Only.
Disclosure to third parties prohibited.

Communique Number

MQUE-5BBGK2

[Revision #CH-E5A9 of **ETC Slip Rings and Brush Replacements by Christopher C Hardiman**]

Equipment

LightSpeed QXi, CT/i, HSA

Problem

New brush blocks have been designed by Schleifring to replace the ETC-manufactured brushes. These new brushes are more reliable with increased longevity. GPO has been sending the field mixtures of blocks made by both manufacturers.

Corrective Action

DO NOT MIX THESE BRUSHES ON THE SAME RING. USE EITHER ALL SCHLEIFRING-MADE BLOCKS OR ETC-MADE BLOCKS. If mixed on the same ring, the Schleifring brushes will experience increased wear due to excessive debris deposits from the ETC brushes. A matrix showing the cross match between these brushes is attached for your reference. If you are uncertain how to identify your brush, see the attached brush block identification guide - the MFG variable will say "Schleifring," and "ETC" for the two manufacturers of these brush blocks.

You can download any of the files below by dragging them to your Windows desktop.
To open a file for reading, double-click it.



Author

Christopher C Hardiman

Revision

07/16/2002 06:34 AM

[new...](#) | [page status](#)

Drum Style Brush Block Part Cross-Reference

Description	ETC Brush Block	Schleifring Brush Block
SIGNAL BB (HSA, CT/i)	2189175	2302509-2
SIGNAL BB (QXi)	2177222	2302509
POWER BB (HSA, CT/i, QXi)	2177224	2302508
POWER BB (HSA)	46-297837G1	2302508
SIGNAL BB (HSA)	46-297839G1	2302509-2


For HSA, CT/i, and LightSpeed QX/i, all of the brush part numbers have changed to the below:

Signal Brush Blocks (HSA, CT/i) – 2302509-2


Power Brush Blocks (ALL) – 2302508

Signal Brush Blocks (LightSpeed QX/i) – 2302509

If you are sent a mixed batch, that is, some brushes made by Schleifring and some made by ETC, do not install them. **Do NOT mix brushes from the two manufacturers on the same ring.**

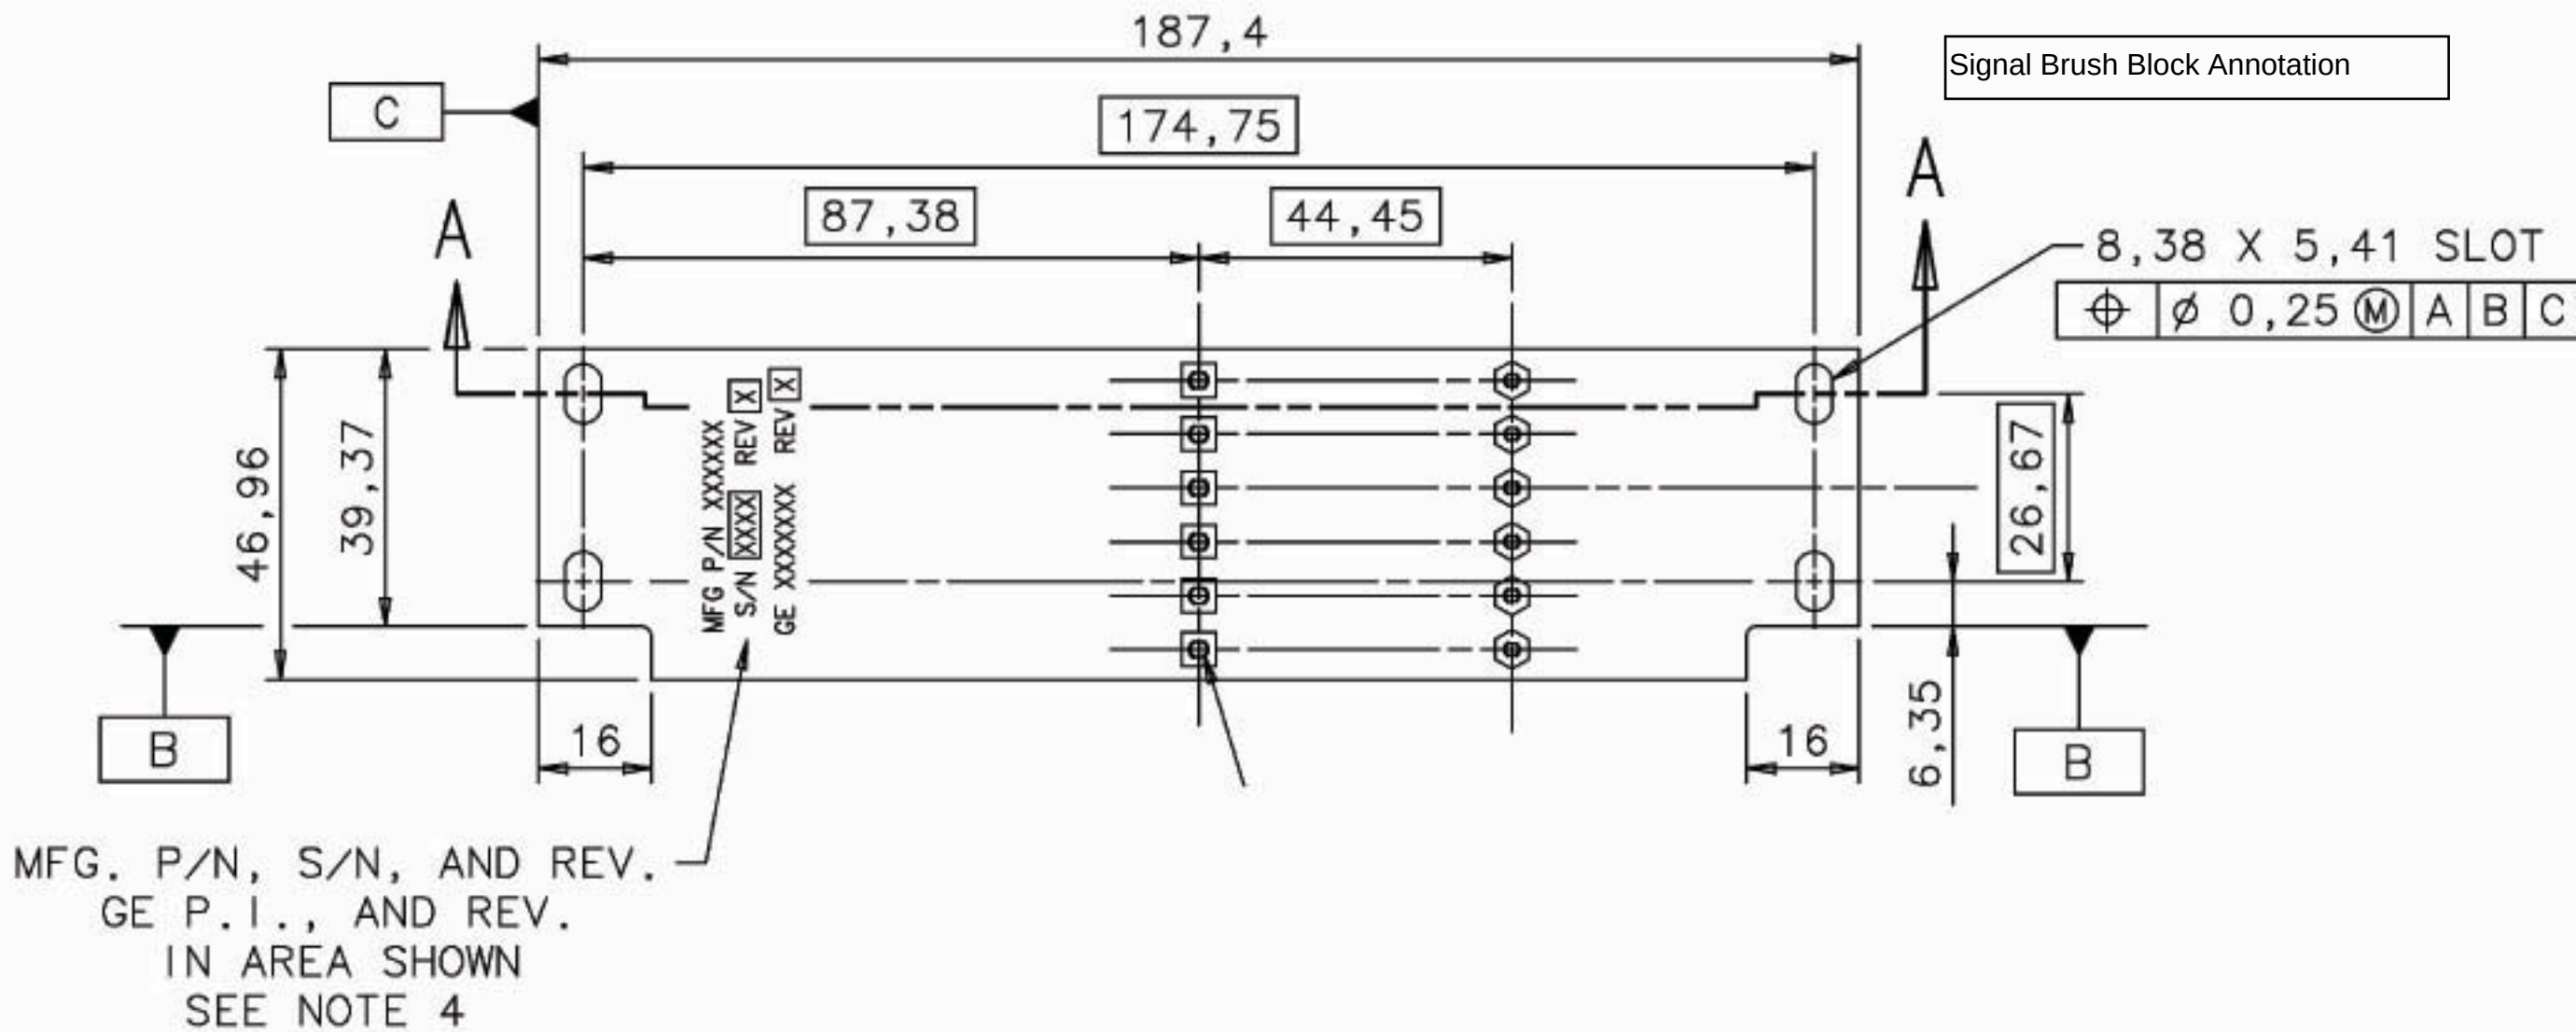

MFG. P/N, S/N, AND REV.
GE P.I., AND REV.
IN AREA SHOWN
SEE NOTE 4

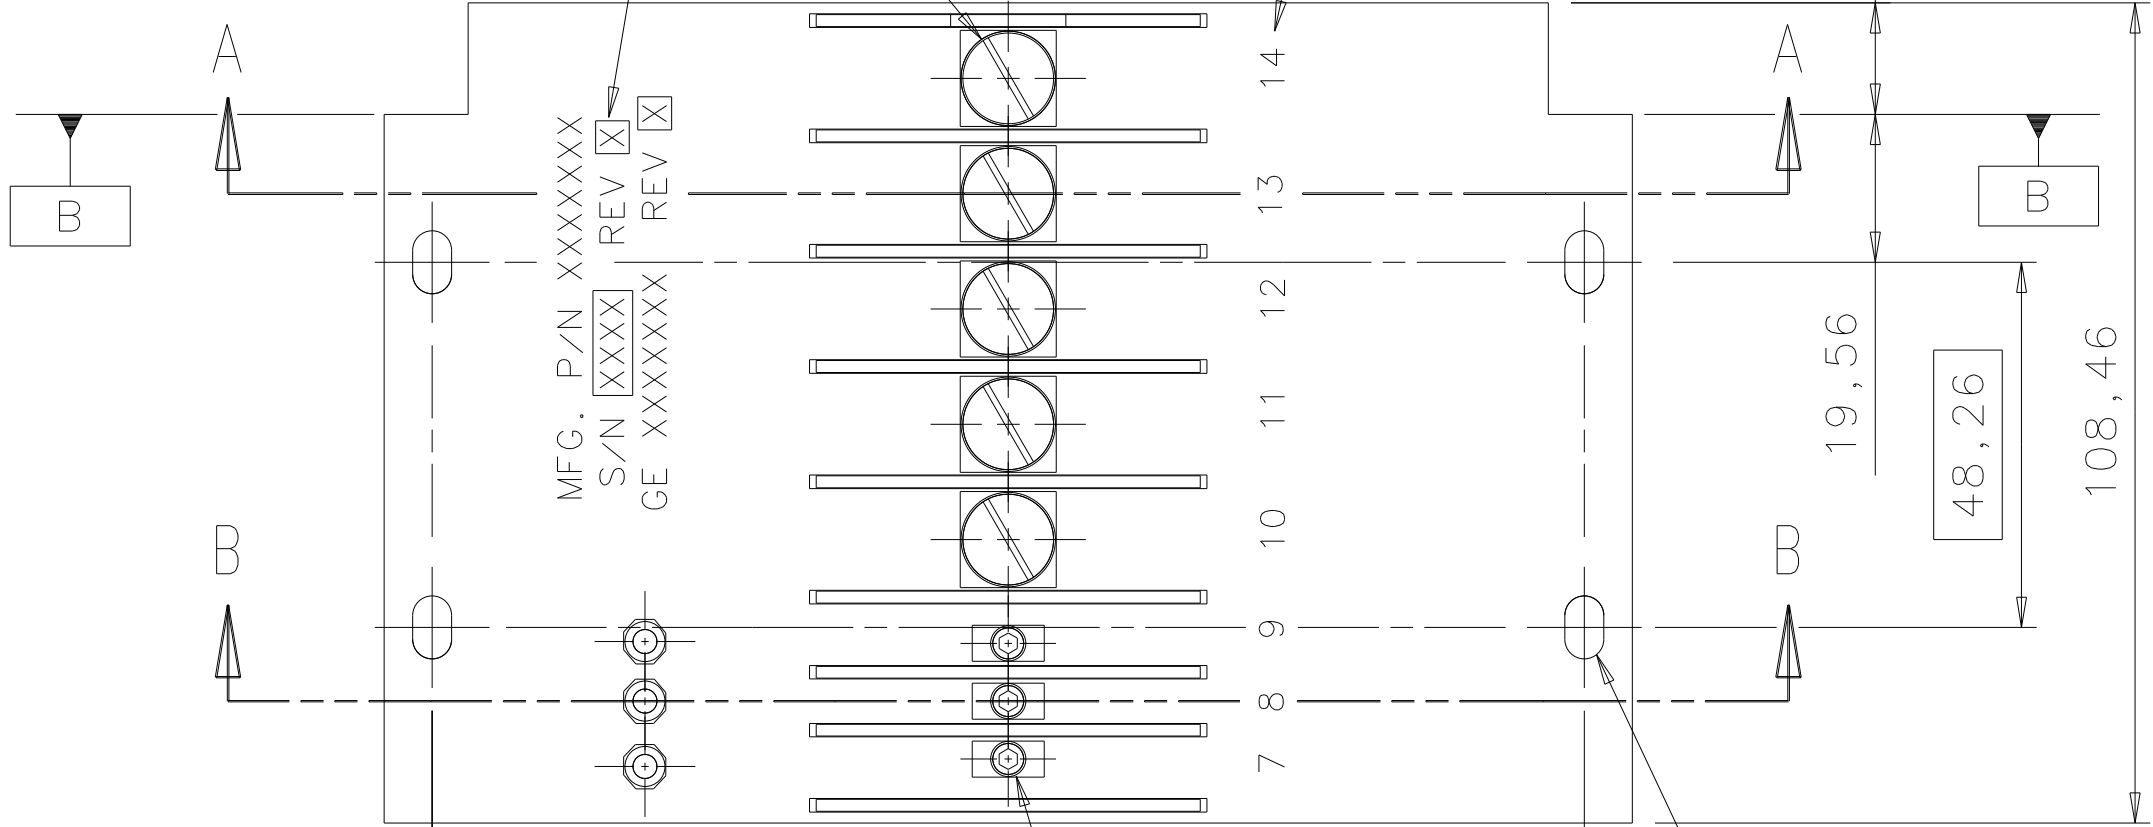

Power Brush Block Annotation