

[new...](#) | [page status](#)

welcome!
ct tech pubs web page
ct water cooler
ct tech pubs updates
surveys
9800/hla
highspeed family (us)
ct/i
lightspeed family
yms family
all ct products
index
old ct emails
[communiques pending approval](#)
customize
members

search:

advanced search
news: daily | weekly

go offline | chat | notify |
print | tutorial | help

home> [communiques](#)
[pending approval](#)

Mixing ETC and Schliefring Brush Blocks - Clarification

christopher hardiman (christopher c hardiman), 08/15/2002 - 12:47 pm

**Priority**

1 - Big Issue, Be Sure to Read

PROPRIETARY WARNING

This information is Property of GE - For GE Service Personnel Only.
Disclosure to third parties prohibited.

Communique Number

MQUE-5D2NEC

Equipment

HSA, CT/i, LightSpeed QXi

Problem

A misunderstanding has occurred that has resulted in erroneous information being delivered to the field on mixing and matching ETC and Schleifring brushes on the green drum-style slip rings.

Corrective Action

Do NOT mix signal brush blocks from different manufacturers on the same ring. Any matched pair of signal brush blocks may be installed with power blocks made by either manufacturer. There should never be brushes from different manufacturers in the same track. If brushes from different manufacturers are placed in the same TRACK, rapid, premature catastrophic failure will result as the ETC brush residue will tear up the Schleifring tips.

You can download any of the files below by dragging them to your Windows desktop.
To open a file for reading, double-click it.

**Author**

Christopher C Hardiman

Revision

08/15/2002 12:47 PM

[new...](#) | [page status](#)

Drum Style Brush Block Part Cross-Reference

Description	ETC Brush Block	Schleifring Brush Block
SIGNAL BB (HSA, CT/i)	2189175	2302509-2
SIGNAL BB (QXi)	2177222	2302509
POWER BB (HSA, CT/i, QXi)	2177224	2302508
POWER BB (HSA)	46-297837G1	2302508
SIGNAL BB (HSA)	46-297839G1	2302509-2

For HSA, CT/i, and LightSpeed QX/i, all of the brush part numbers have changed to the below:


Signal Brush Blocks (HSA, CT/i) – 2302509-2

Power Brush Blocks (ALL) – 2302508

Signal Brush Blocks (LightSpeed QX/i) – 2302509

If you are sent a mixed batch, that is, some signal brushes made by Schleifring and some made by ETC, do not install them.

Do NOT mix signal brushes from the two manufacturers on the same ring. You *may* use any matched pair of signal brush blocks with either power block.

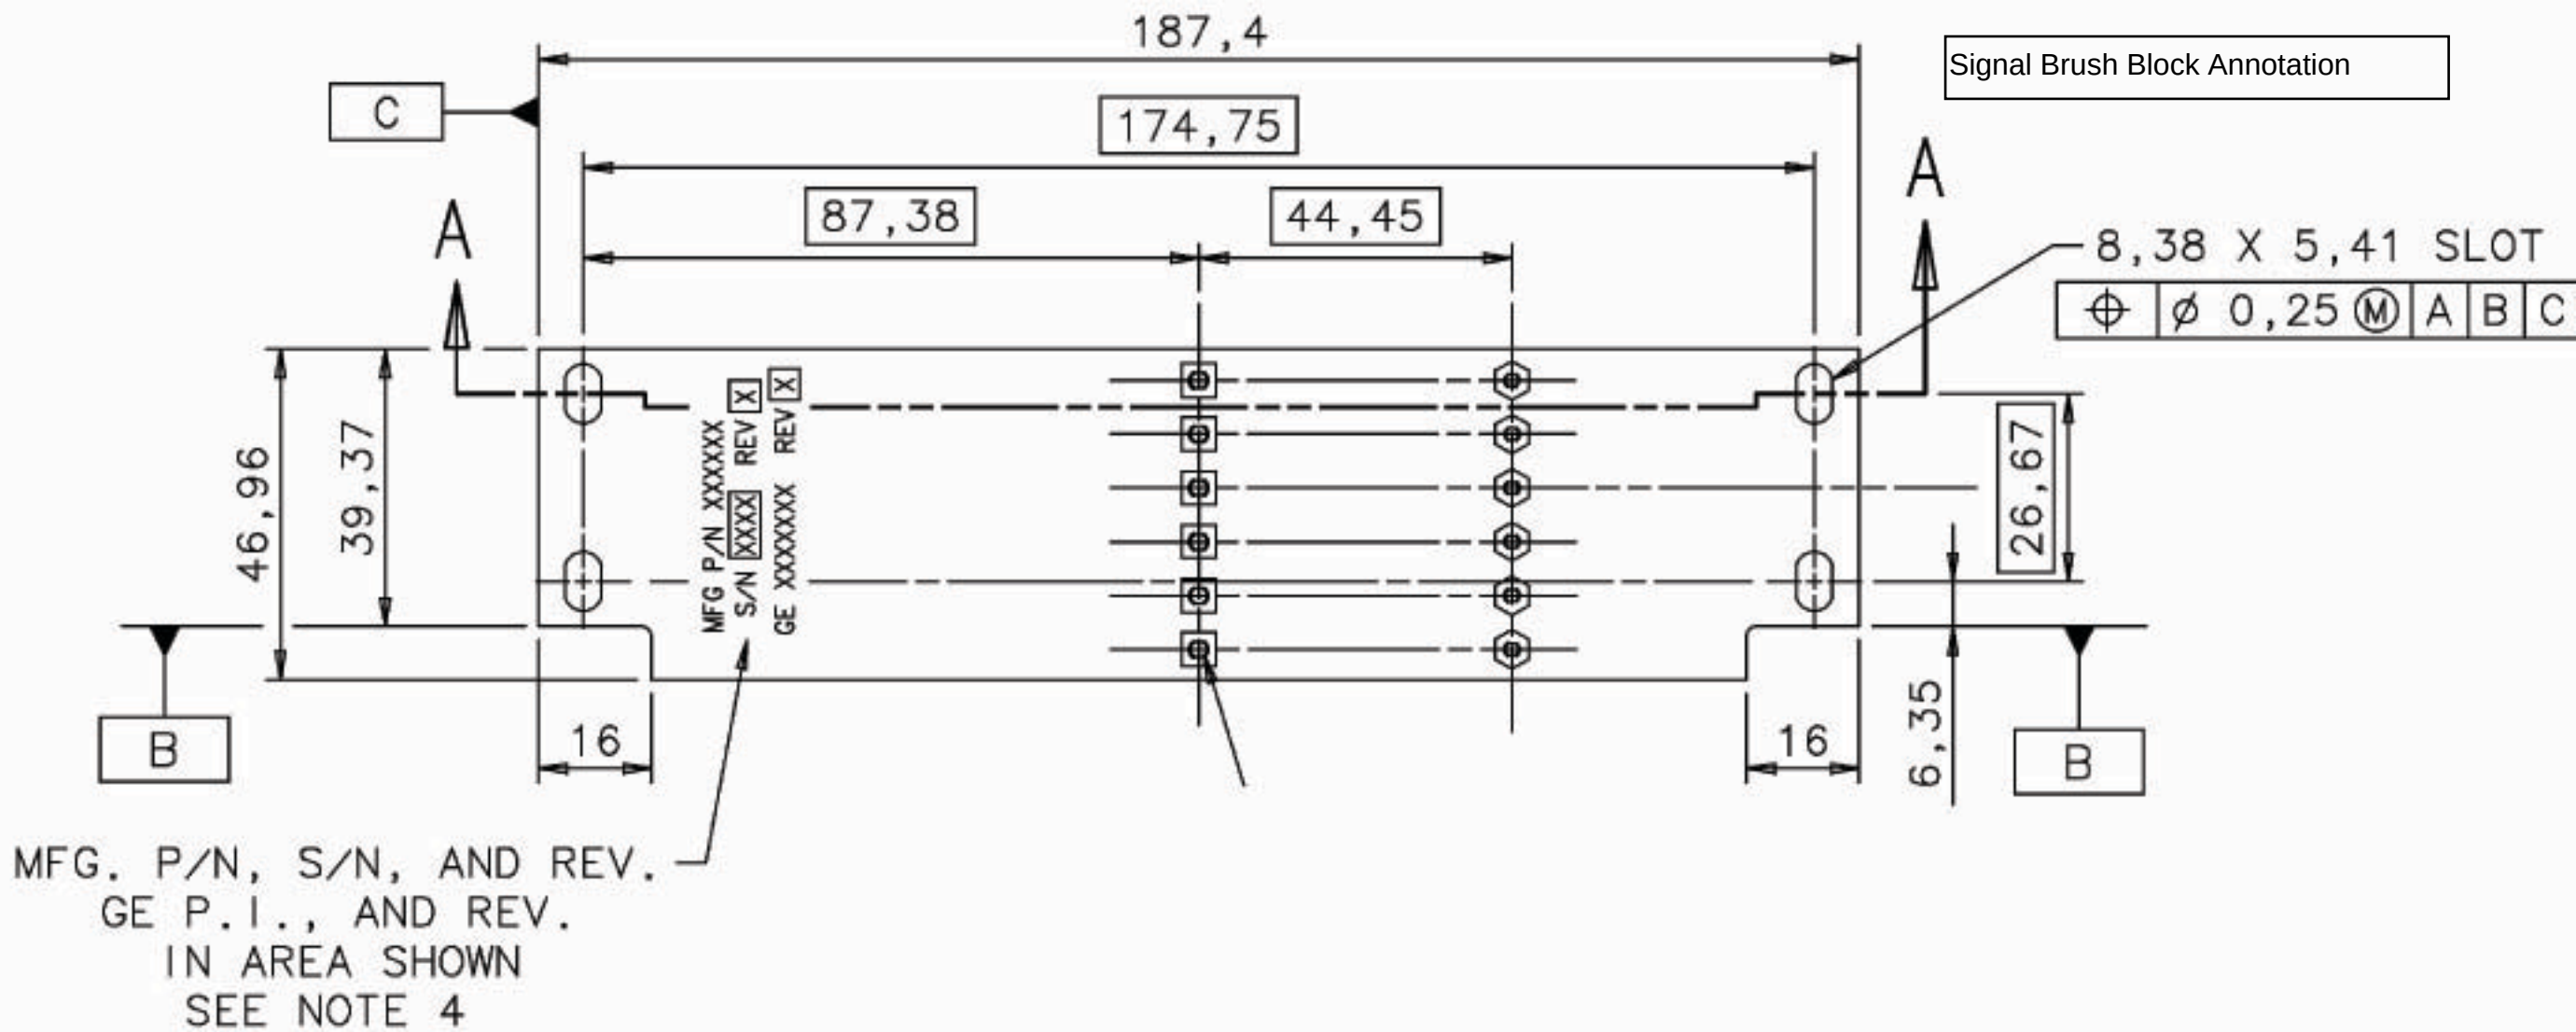

MFG. P/N, S/N, AND REV.
GE P.I., AND REV.
IN AREA SHOWN
SEE NOTE 4

