

**ADMINISTRATIVE INFORMATION****FMI No: 25370****FMI Title: VCT Intake Filter and EMI Gasket Upgrade**

FMI TYPE	CHARGE CODES	IMPLEMENTATION DATES
☒ Mandatory Safety	GEMS - AM:	Issue Date: April 28th, 2006
☐ Mandatory	GEMS - E:	
☐ Mandatory on Request	GEMS - A:	Close Date: Aug 4th, 2006

☒ Staged FMI	Customer List provided by FMI Administration. If you identify additional units within effectivity range, but they are not shown on the customer list, contact FMI Administration in your Pole.
☒	Parts and any special tools are furnished automatically. To address shortages and ordering exceptions, contact FMI Administration in your Pole.
☐	Parts Ordering: GEMS - Americas, Contact your Region logistics coordinator GEMS - Europe, Order FMI kits from GPO/EPL Buc GEMS - Asia, Contact your region logistics coordinator
☐	No Parts are required to complete this FMI.
☐ Batch with	_____
	To minimize costs, combine implementation of this FMI with the FMI's listed for all customers where the effectivity is the same (Please see your customer lists).
☐ Non-Staged	No Customer List is provided. Each service location must identify affected units, and place part orders as indicated in the Special Instructions.

Technical Support

GEMS - Americas	GEMS - Europe	GEMS - Asia
GE Medical Systems Insite Center (414) 524-5300 800-321-7973 Milwaukee, WI 53201, USA	GEMS - E / ESC BP34 F 78533 BUC CEDEX, FRANCE Tel: (33 1) 39 20 00 07 or ESC Fax: (33 1) 30 70 99 70	Asia Support Center Phone: 81-426-56-0033 Fax: 81-426-48-2905

Special Instructions:**Unit Tracked:** 5124069**FMI Instructions Part No.:** 5144788-100**Do NOT leave unsecured on site**

FMI Completion Certification Report

Mail To

GEMS - Americas

GEMS - Europe

G.E. Medical Systems
Attn: FMI Admin. W-523
P.O. Box 414
Milwaukee, WI 53201

GEMS - Europe
FMI Admin. 322
BP34
F78533 Buc Cedex, France

Send to your
Country FMI or Service
Administrator

FMI No.: FMI 25370

FMI Title: VCT Intake Filter and EMI Gasket Upgrade

Customer Full Name:

Number and Street Address:

City and Country:

Country Code

Site Number

System I.D.

Unit Tracked:

Model Number	Serial Number	Compl. Date DD/MM/YY	FMI Comp. Code	Service Hours	
				Labor	Travel

FMI Completion Code

1. Modification Complete or previously modified.
2. FMI not required per FMI instruction.
3. Not modified. Unit in storage. FMI kit returned to stock.
4. Modification refused or equipment altered. Customer signature and title required.
5. Unit location unknown or unit not in area. Product Locator notified.

Customer Refusal or Equipment Altered - Modification Pending.

Installer
Comments


Effectivity

VCT systems installed before July 2006.

Tracked Model numbers: 5124069 VCT and 5123200 VCT Select 32 Slice.

Inspection

Check the heater intake filter. If your gantry has the large heater intake filter (8"X12"), as pictured below, you should stop here. Close the dispatch as complete, Code 2 and return the unused kit to HM Product Solutions. If your filter is approximately 6"X6", please continue with this FMI.

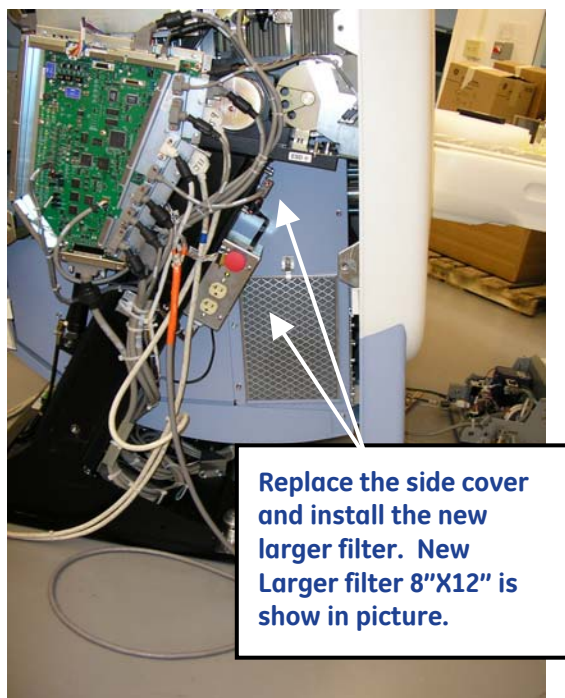

Note:

If your system does not need this FMI, please return unused FMI kit to:

**HM Product Solutions, LTD.
3225 Gateway Road, Suite 250
Brookfield, WI 53045
262-754-0424**

Purpose

The purpose of this FMI:

- Update early VCT systems with the new larger heater intake filter (8"X12") and cover.
- Install EMI gasket on the Slipring receivers.

Prerequisite FMIs

None

Related FMIs

None

Furnished Materials

FMI kit (5145024)

Qty	Description	Part #
1	FMI Document	514478-100
1	Kit of side panel and filter	5138874
1	Gasket Kit for VCT Slipring Receivers with installation instruction.	5144787
1	Tyrap with #10 screw mounting hole	46-208759P1
1	NUT, M4 X 0.7 HEX	46-312346P2

Tool Required

Qty	Description
1	Standard field service kit

Personnel Requirements

"4" hours labor and "1" hours of travel

Procedure

1. Replace Heater intake filter and cover

- Remove the gantry side and top covers.
- Remove the gantry front cover.
- Tilt the gantry to 22 degrees
- Remove power from the system and perform LOTO as appropriate.
- Remove the gantry heater from the lower left hand side of gantry. (Ref. Gantry Heater Replacement, if needed).


-Disconnect all cables to the heater assembly. **Make a note of how they were secured to the stationary assembly.** Early VCT systems may have a different cable routing scheme than shown in Ill. 1.

Illustration 1: Gantry Heater Cables





-Using a ratchet with a 6" extension and 5mm hex bit, remove the six (6) M6 hex head screws that secure the heater module to the gantry-mounting bracket.

Illustration 2: Gantry Heater Mounting Screws

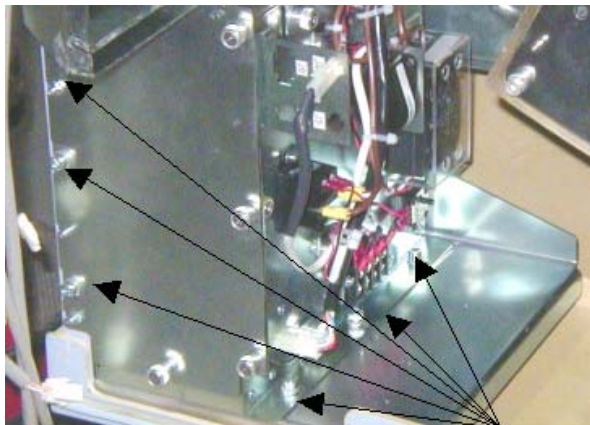


- Remove the cover and heater tray from the system by removing the 5 - M6 hex head screws and the 2 - 3/4 inch nuts (the 3/4 inch nuts will require Blue Loctite during reassembly).

Illustration 3-4: Gantry Heater cover and filter holder Mounting Screws (new style cover shown)

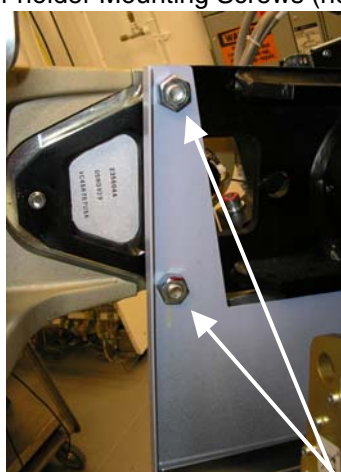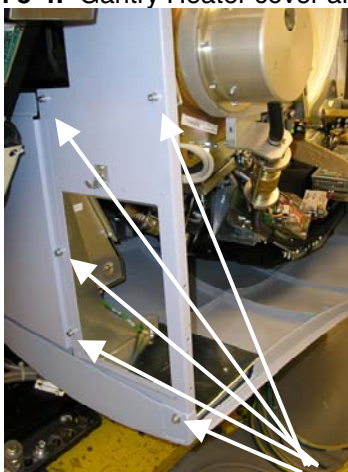


- Remove the heater tray from the old cover

Illustration 5: Heater Tray Mounting Screws (new style cover shown)

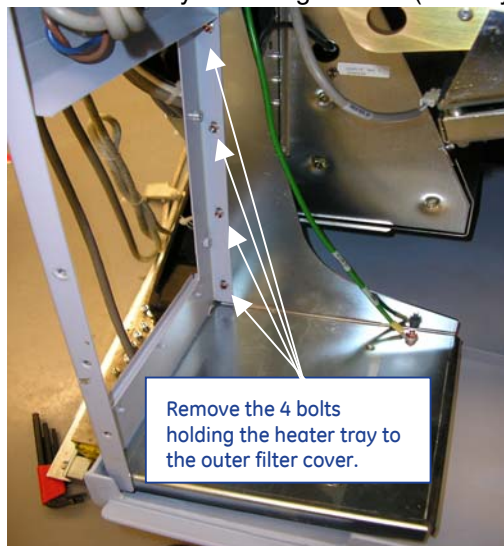


- Install old heater tray onto new cover from kit 5138874 (Torque to 2.3Nm - 1.7 ft-lbs). See III. 5
- Install new cover and heater tray onto the gantry using the previously removed 5 - M6 hex head screws (Torque to 7.9Nm – 5.8 ft-lbs) and the 2 - ¾ inch nuts (Torque to 66.4Nm - 49 ft-lbs) (the ¾ inch nuts will require **Blue Loctite** during reassembly).

Illustration 6: Gantry Heater cover and Tray

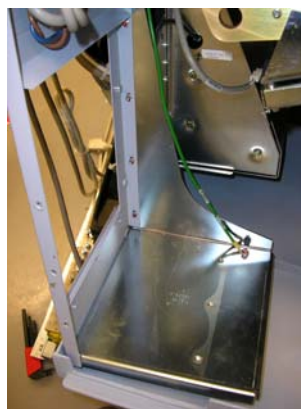

- Install heater onto heater tray (Torque to 7.9Nm - 5.8 ft-lbs).

Illustration 7: Gantry Heater Mounting Screws

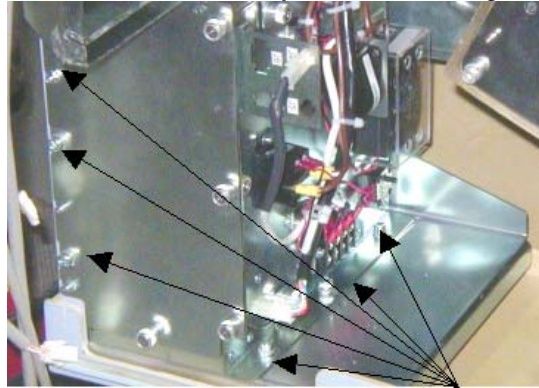

- Connect Heater cables; verify that the cables are correctly secured to the cover (Tyrap and nut are provided). **If done incorrectly, there is a chance that the rotating assembly will damage the cables.**
- The cable routing shown in Ill. 8 may not be the same as on your site. If it is different, do not try to make the cables reach the tyrap mounting point. Secure the cables the same way as noted when they were removed.
- Manually rotate gantry and look for interference between the cables and the rotating assembly.

Illustration 8: Gantry Heater Cable routing.



2. Install EMI gasket on slipring receivers

Install EMI gasket using instruction included in kit 5144787. Kit 5144787 contains two gaskets, two rubber spacers and the **instruction sheet**.

3. Finalization

1. Perform the **Gantry Rotation Safety Check**, found under Functional Checks on the Common Service Desktop.
2. Perform a test scan using the 20cm QA phantom to verify system operation.
3. Close the FMI.