

TABLE OF CONTENTS

TABLE OF CONTENTS 1

DESCRIPTION 2

1- FIBER OPTIC REPEATER BOARD REMOVAL..... 2

2- FIBER OPTIC REPEATER BOARD INSTALLATION 2

3- BOARD SET UP..... 3

4- SYSTEM RESTORATION 4


REVISION HISTORY 5

DESCRIPTION

Procedure for replacing the Fiber Optic Repeater Board, which is located on the Penetration Panel.

1- FIBER OPTIC REPEATER BOARD REMOVAL

1. Lock out and tag out circuit breaker MR1 A14 CB6 at rear of RF/Pen Cabinet on Magnet Enclosure Power Supply (MEPS) Module. (Refer to CD-ROM *Dir. 2187583-3 [or -2], MR Release Signa 5x/8x Service Methods, Renewal Parts and Service Tools*, Procedure for Safety, Section 6, OSHA LOCKOUT/TAGOUT REQUIREMENTS.)
2. Verify that voltage is between MR1 A14 TP4 (+) and TP13 (–) is 0 Vdc.
3. Follow steps 1 through 4 in Illustration L2519A.

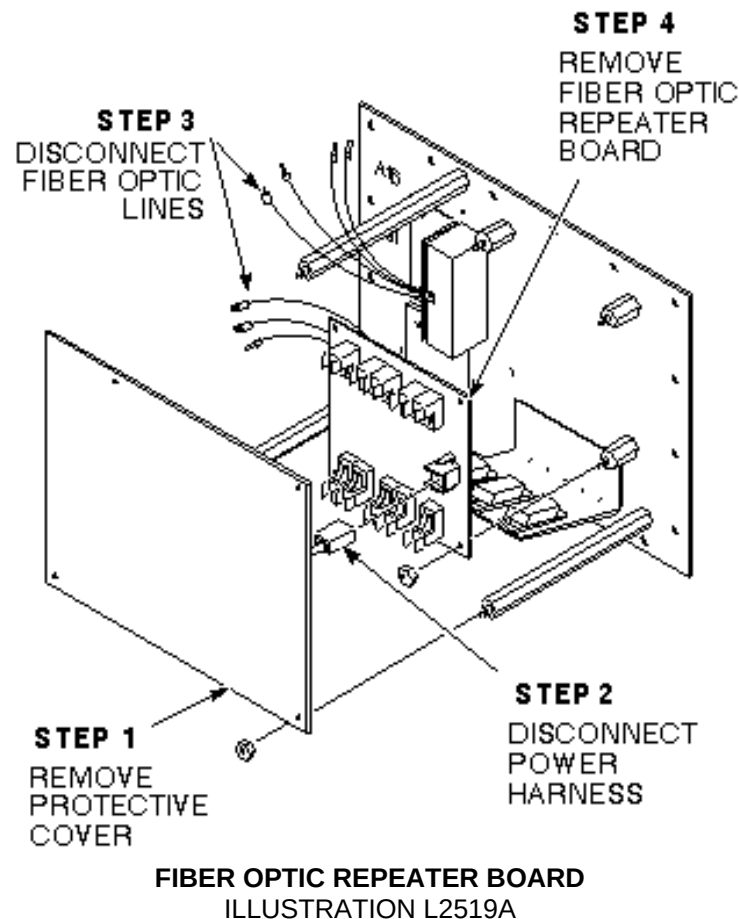


2- FIBER OPTIC REPEATER BOARD INSTALLATION

1. Install replacement repeater board. See Illustration L2519A in Section 1.
2. Connect Fiber Optic lines as labeled. See Illustration L2519A in Section 1.

3. Connect power harness to Repeater Board. See Illustration L2519A in Section 1.
4. Install protective cover. See Illustration L2519A in Section 1.

3- BOARD SET UP

See Illustration L2520A, Fiber Optic Repeater Board.

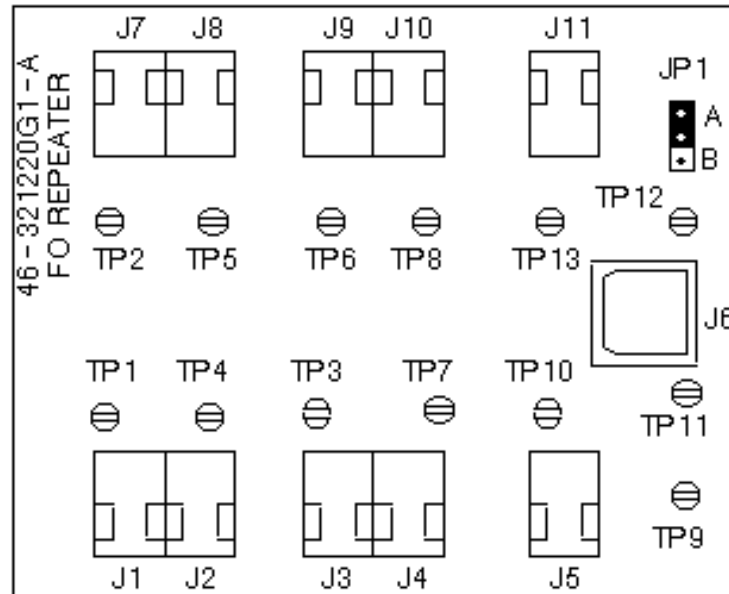

FIBER OPTIC REPEATER BOARD
ILLUSTRATION L2520A

See Table 1 for jumper information.

TABLE 1
TEST POINT INFORMATION

Test Point	Location Schematic	Name	Notes
TP1	P.3		F.O. TRANSMITTER INPUT: TO PAC (PAC DATA)
TP2	P.3		F.O. RECEIVER OUTPUT: FROM TYME (PAC DATA)
TP3	P.3		F.O. TRANSMITTER INPUT: TO SRI (SRI DATA)
TP4	P.3		F.O. RECEIVER OUTPUT: FROM PAC (PAC DATA)
TP5	P.3		F.O. TRANSMITTER INPUT: TO TYME (PAC DATA)
TP6	P.3		F.O. RECEIVER OUTPUT: FROM TYME (SRI DATA)
TP7	P.3		F.O. RECEIVER OUTPUT: FROM SRI (SRI DATA)
TP8	P.3		F.O. TRANSMITTER INPUT: TO TYME (SRI DATA)
TP9	P.4		GROUND
TP10	P.3		F.O TRANSMITTER INPUT: TO SRI (RESET)
TP11	P.4		Vin
TP12	P.4		+5 V
TP13	P.3		F.O RECEIVER OUTPUT: FROM TYME (SRI RESET)

See Table 2 for test point information.

TABLE 2
JUMPER INFORMATION

Test Point	Location Schematic	Position	Description	Notes
JP1	P4	A	Loopback	Position "B" For Loopback Test Only

4- SYSTEM RESTORATION

1. Remove tag from circuit breaker MR1 A14 CB6 at rear of RF/Pen Cabinet on Magnet Enclosure Power Supply (MEPS) Module.
2. Restore power to the Fiber Optic Repeater by switching on circuit breaker MR1 A14 CB6.
3. Perform Fiber Optic Repeater Loopback test. Refer to procedure for Fiber Optics Checks for details.

REVISION HISTORY

REV	DATE	AUTHOR	PRIMARY REASONS FOR CHANGE
0	July 14, 1998	J. Saperstein	Initial conversion from Toolbook to Word.