

2 Wiring Diagrams

2.1 Magnet System Wiring

Illustration 6-5: Magnet System Wiring: Sleeve Connections

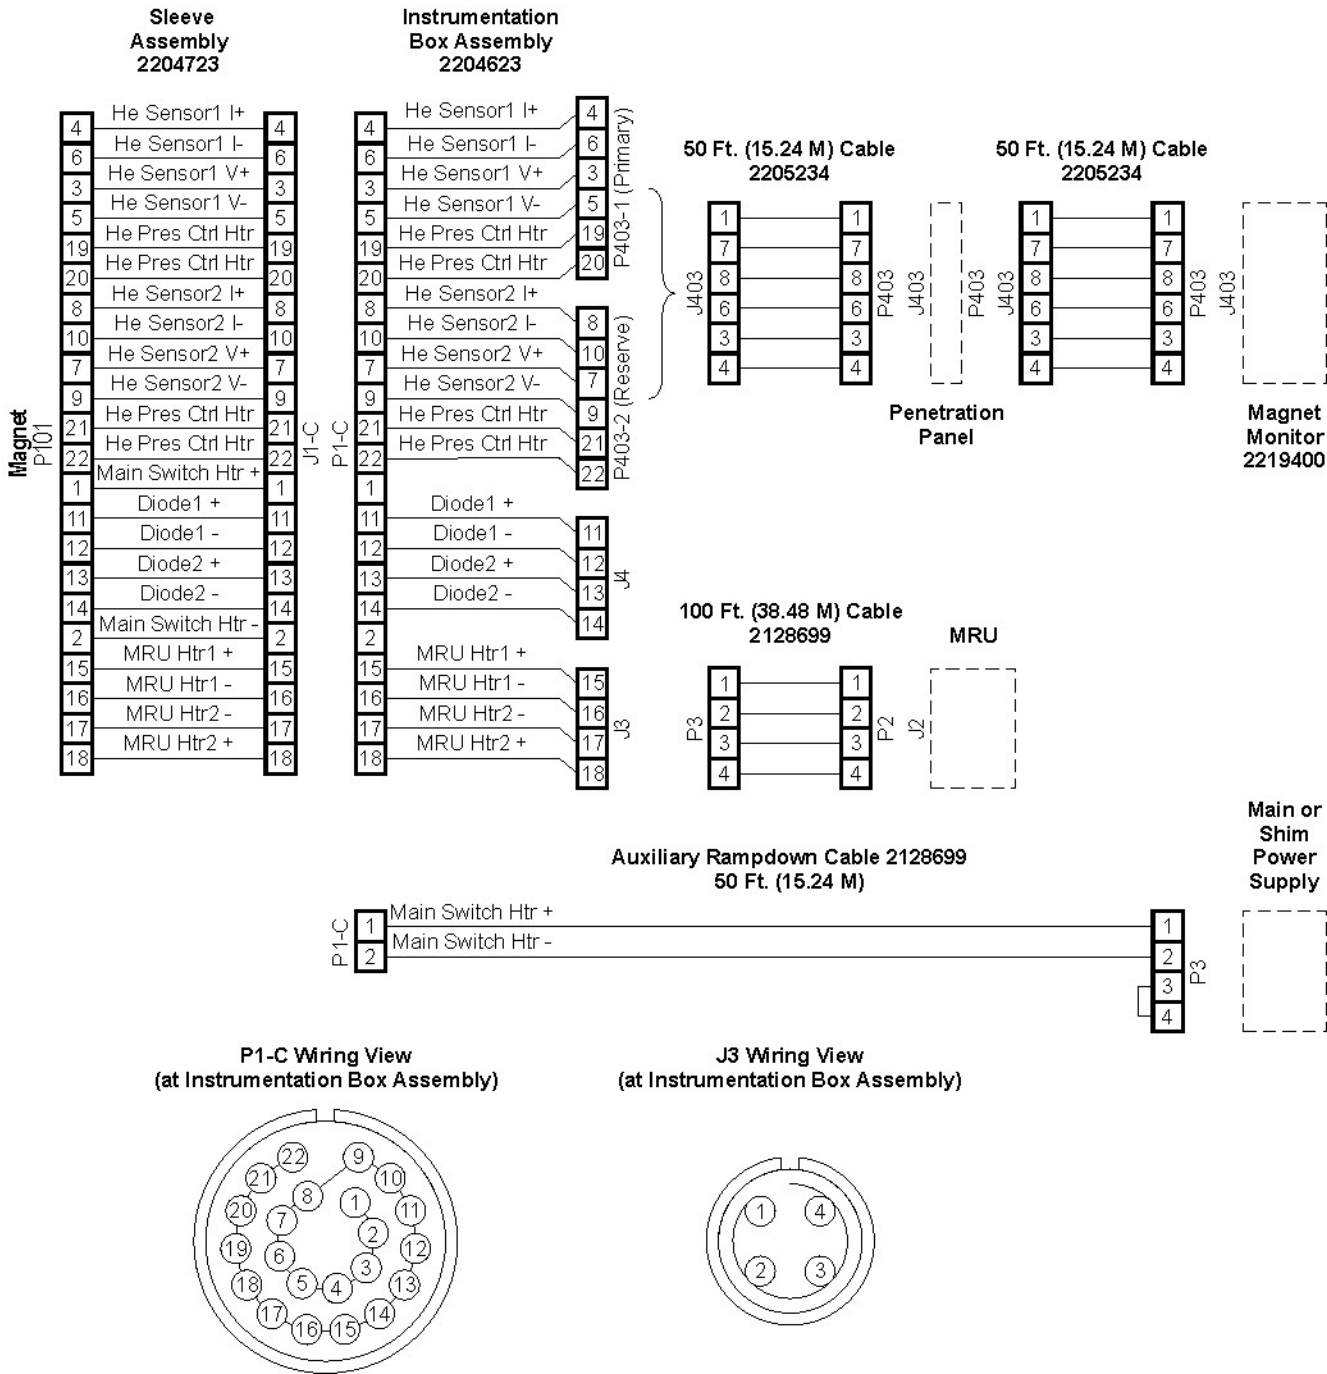


Illustration 6-6: Magnet System Wiring: Shim Lead Connections




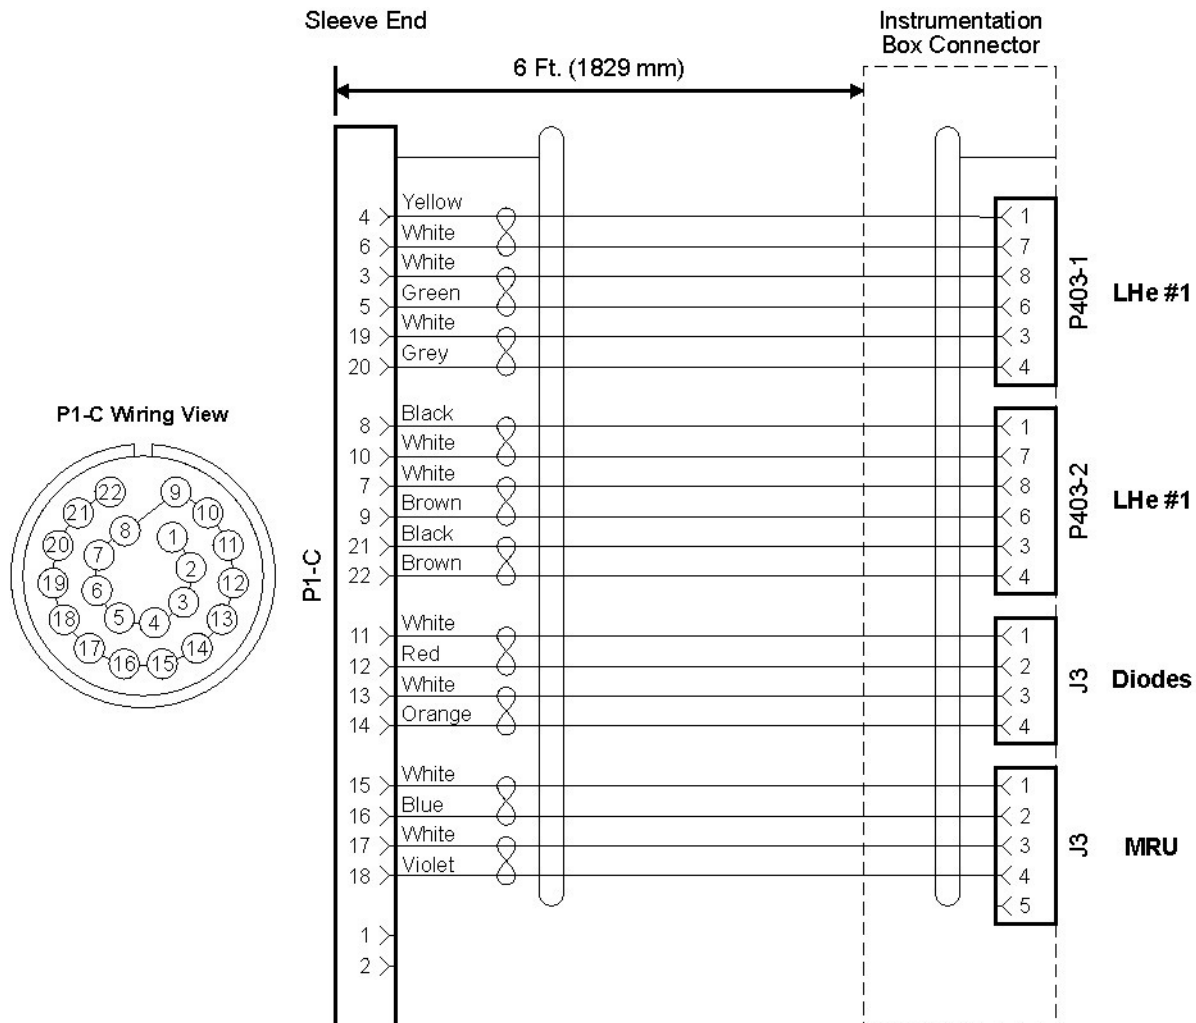
Illustration 6-7: Instrumentation Box Assembly 2204623 Wiring

Illustration 6-8: Shim Lead Pigtail Adapter Cable 2135362 Wiring

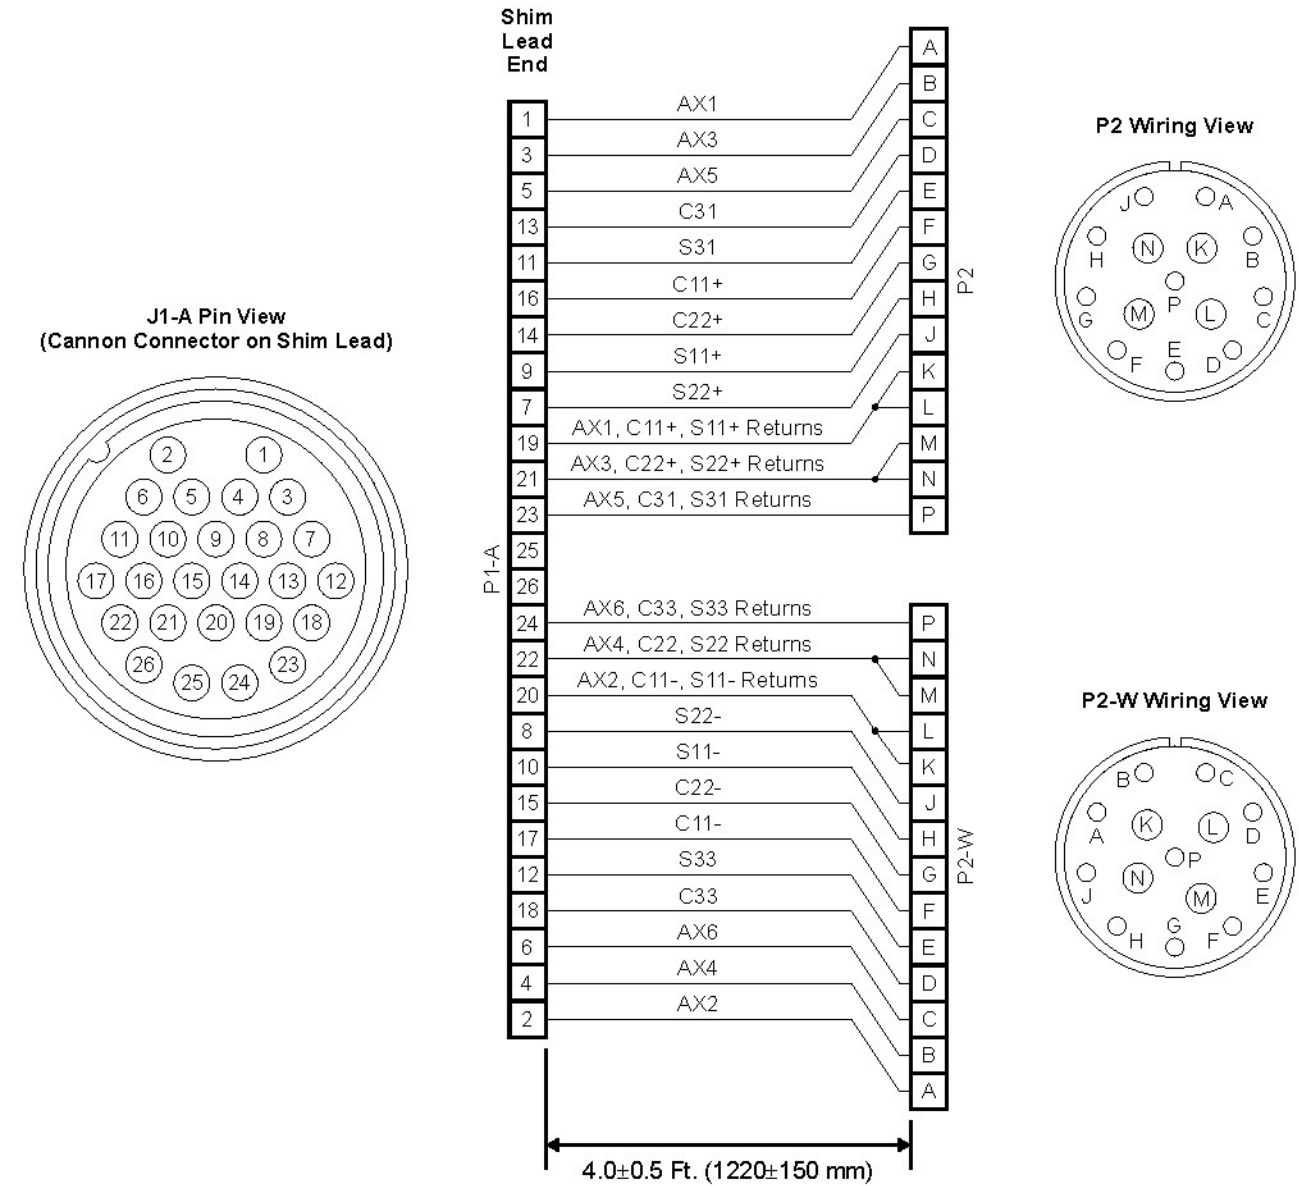


Illustration 6-9: Shim Coil Power Supply Cable 46-260726G1

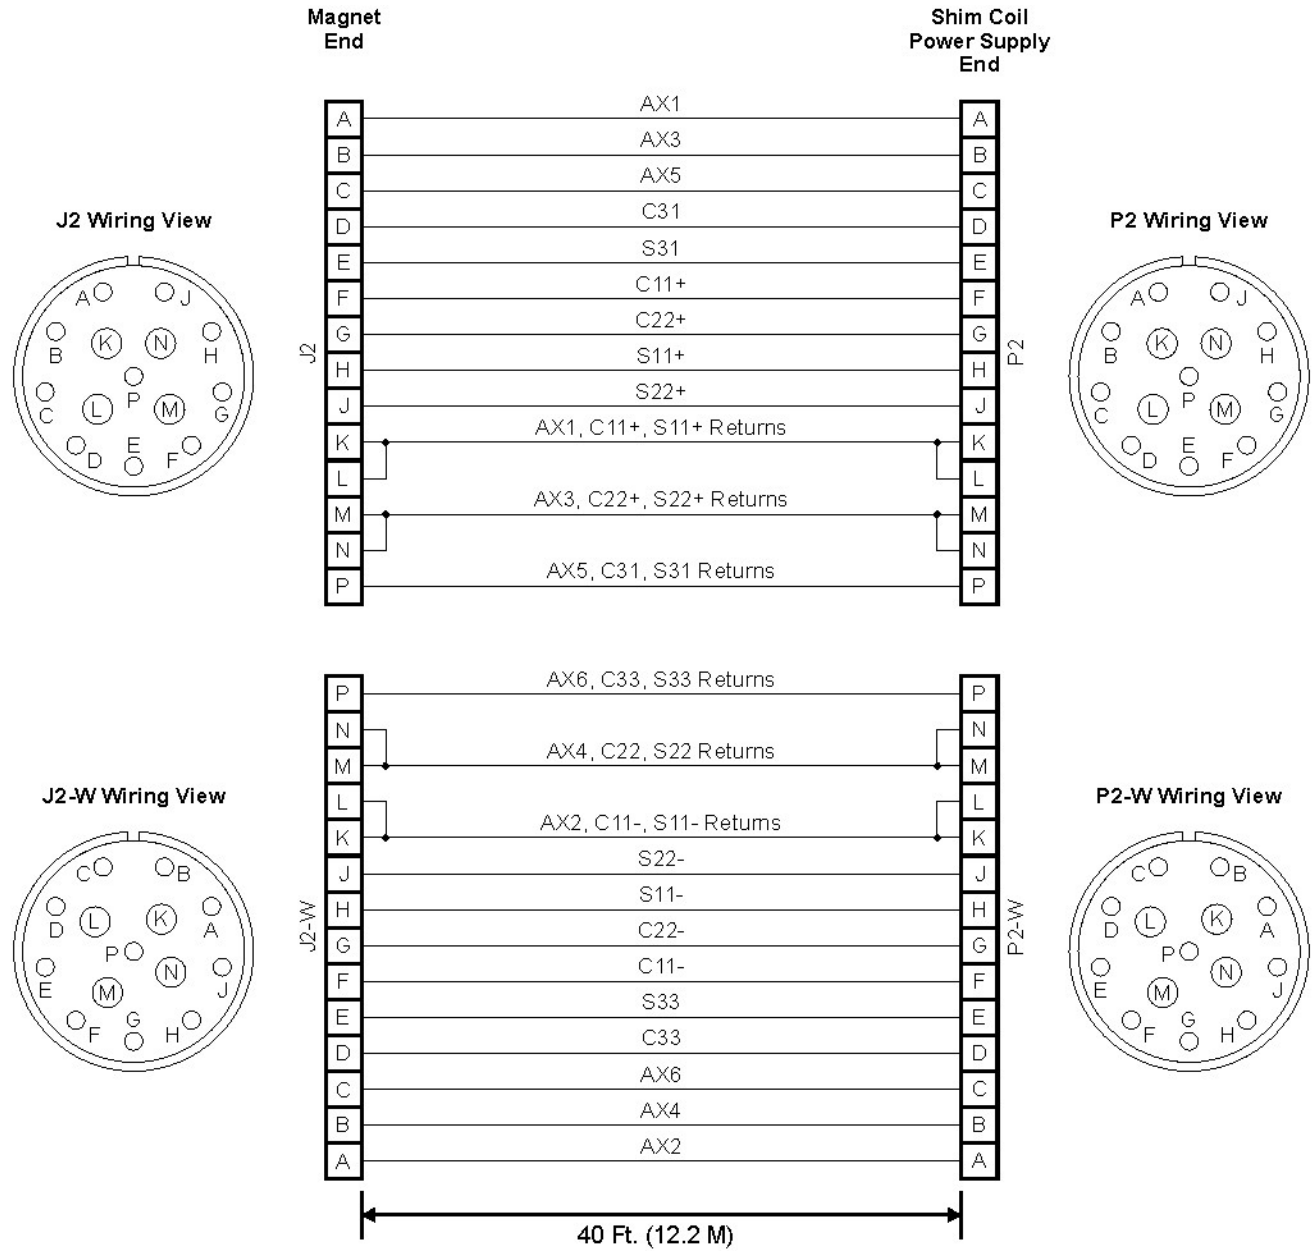


Illustration 6-10: Liquid Helium Monitor Circuit Wiring (Cables 2205234)

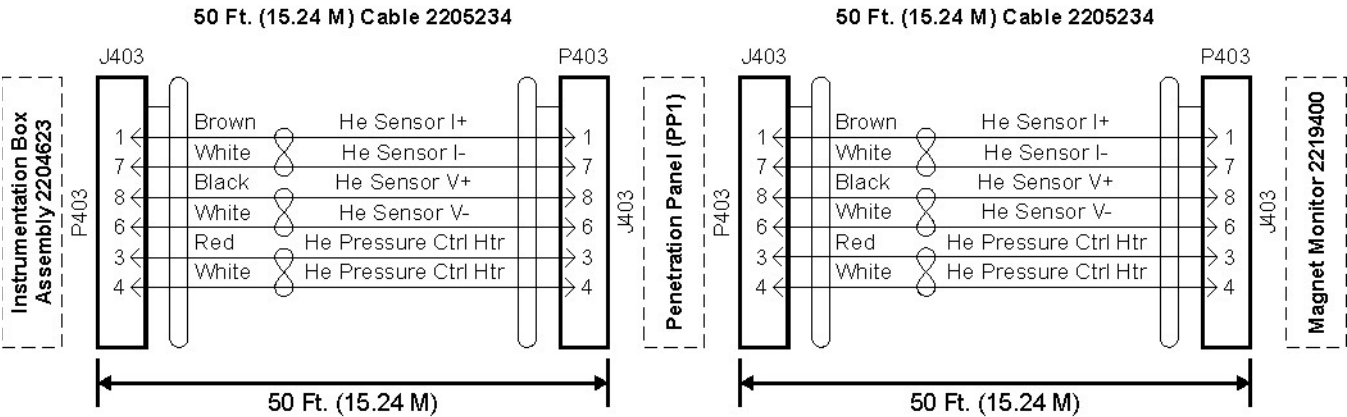
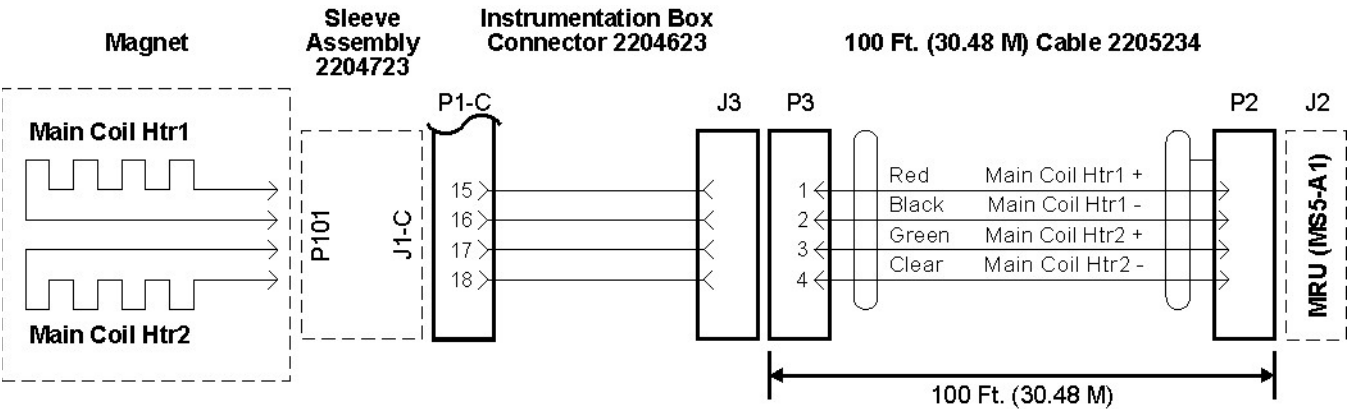


Illustration 6-11: Main Coil Heater Rundown Wiring



2.2 RuO Circuits and Pinouts

Illustration 6-12: RuO Circuit & Pinouts, Recondenser Vacuum Sleeve

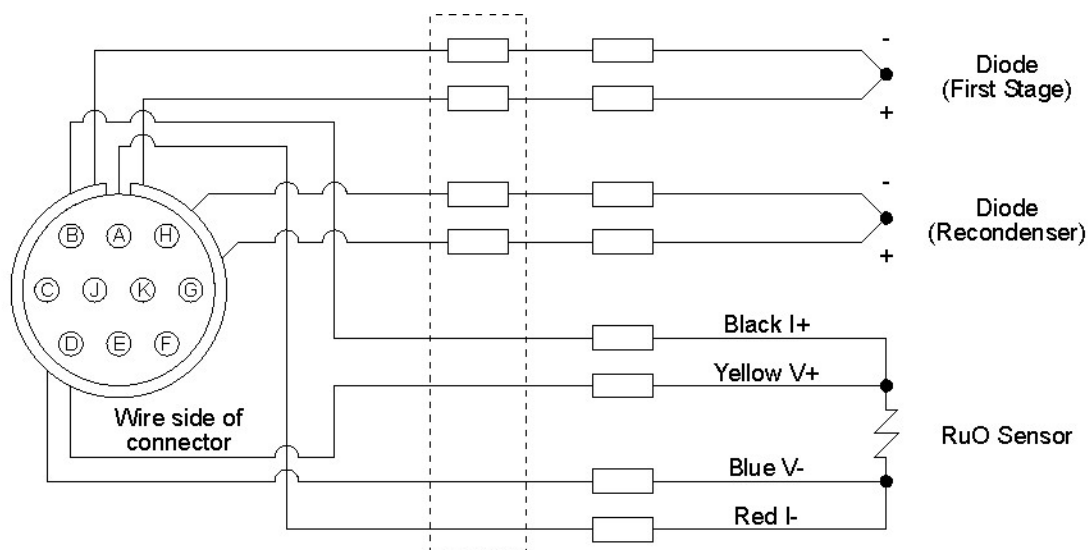
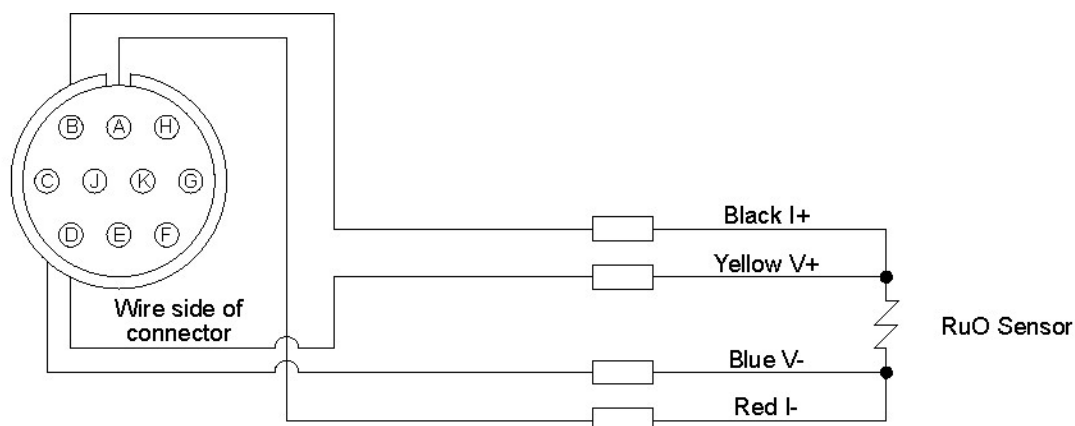


Illustration 6-13: RuO Circuit & Pinouts, Coldhead Transition Flange



2.3 Magnet Monitor Cables

Illustration 6-14: Magnet Monitor Cable A (Run 832): 2214062

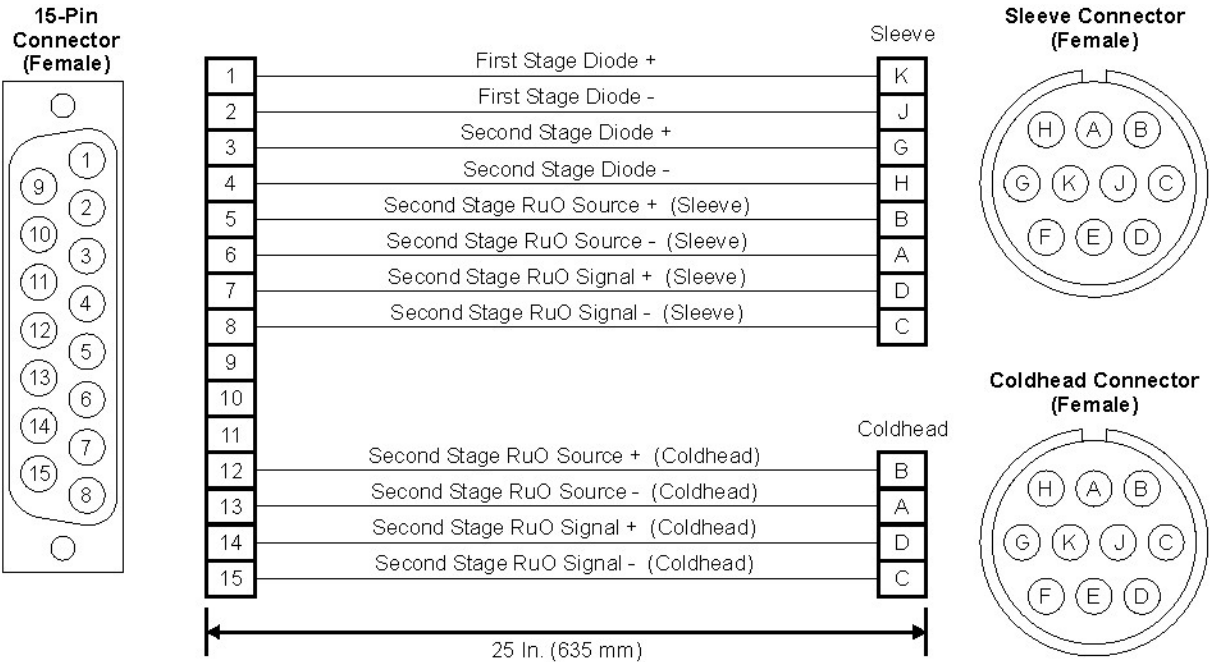


Illustration 6-15: Magnet Monitor Cables D (Run 828) and H (Run 824): 46-271609G29

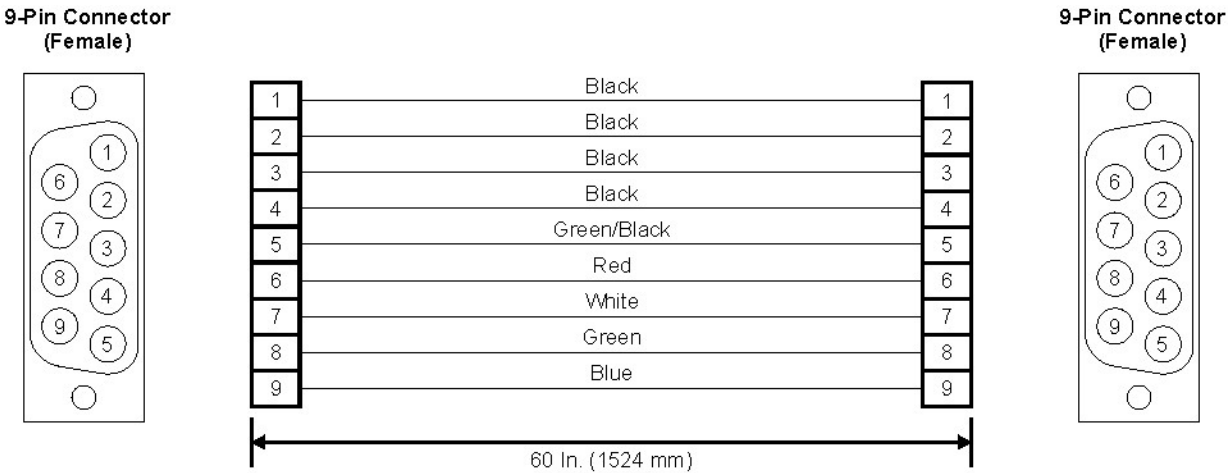


Illustration 6-16: Magnet Monitor Cable C (Run 829): 46-271601G29

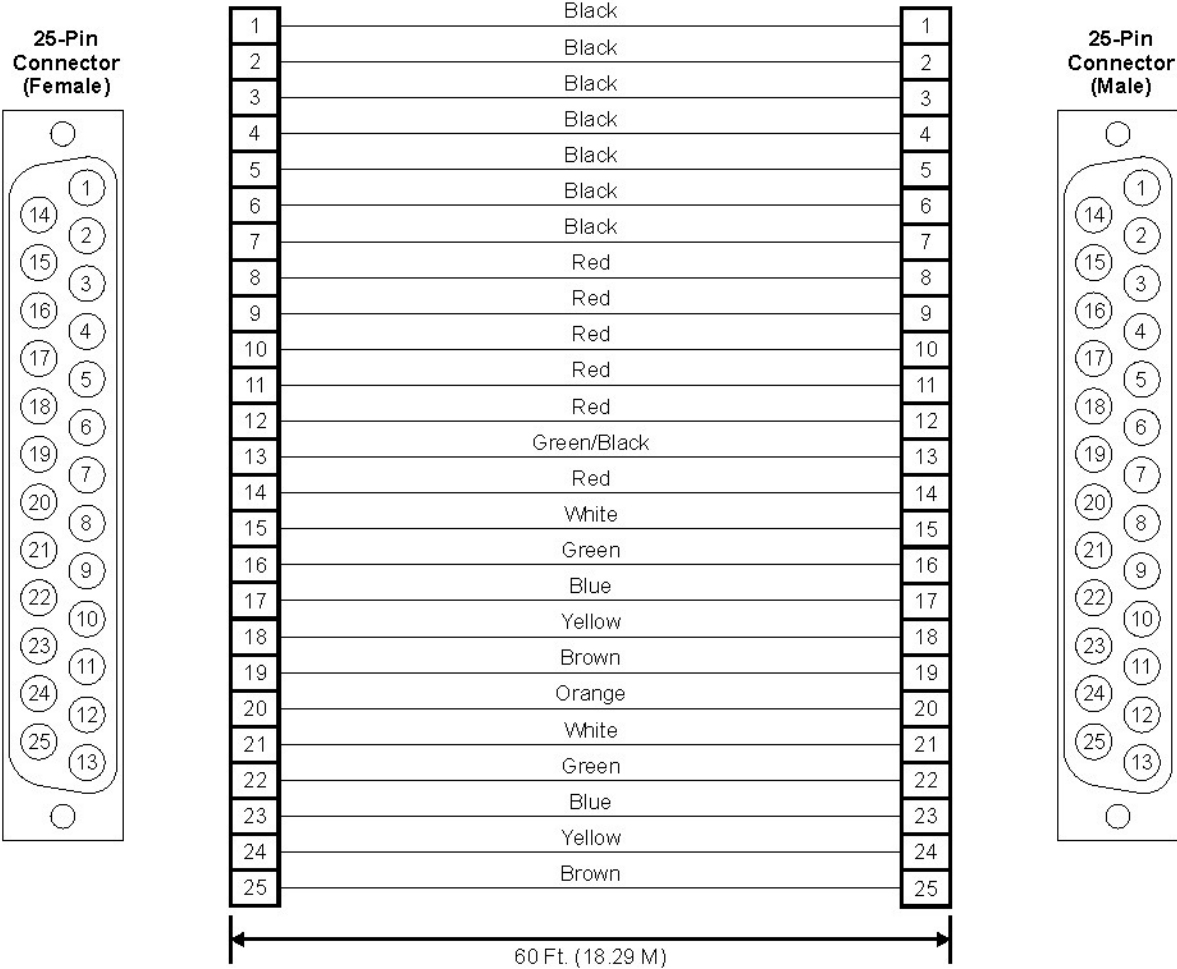


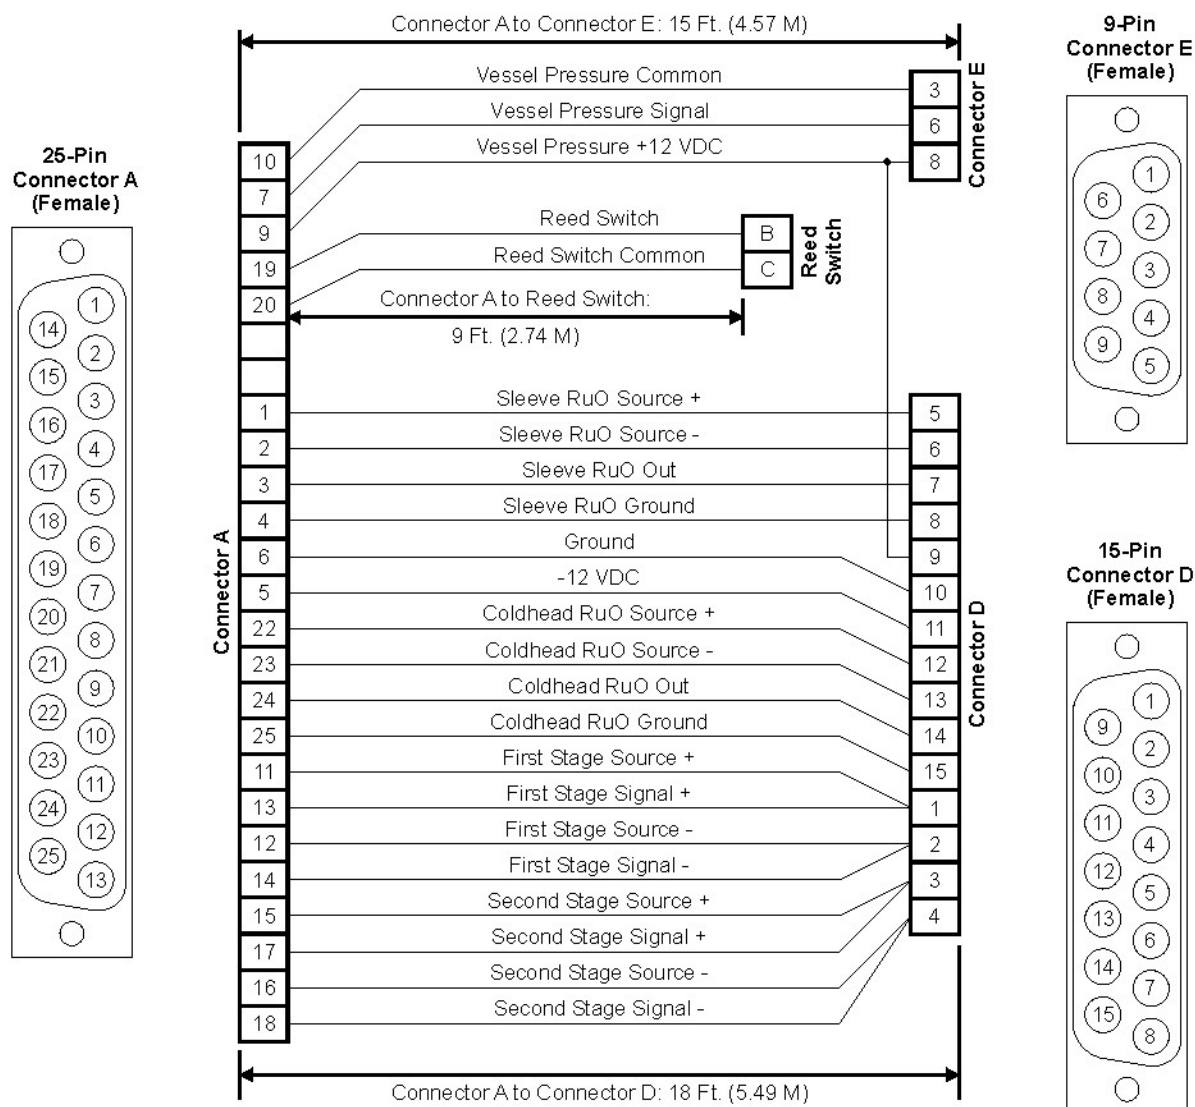
Illustration 6-17: Magnet Monitor Cable B (Run 830): 2222797

Illustration 6-18: Magnet Monitor Cable E (Run 823) and K (Run 826): 46-271603G29

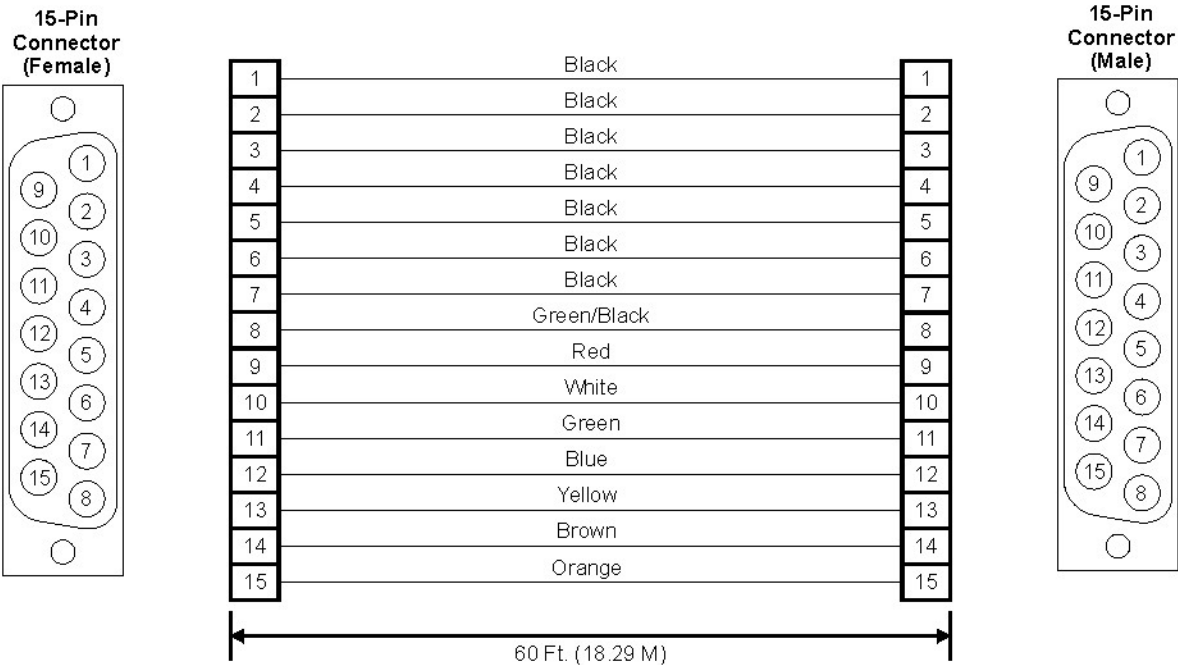


Illustration 6-19: Magnet Monitor Cable F: 2204485

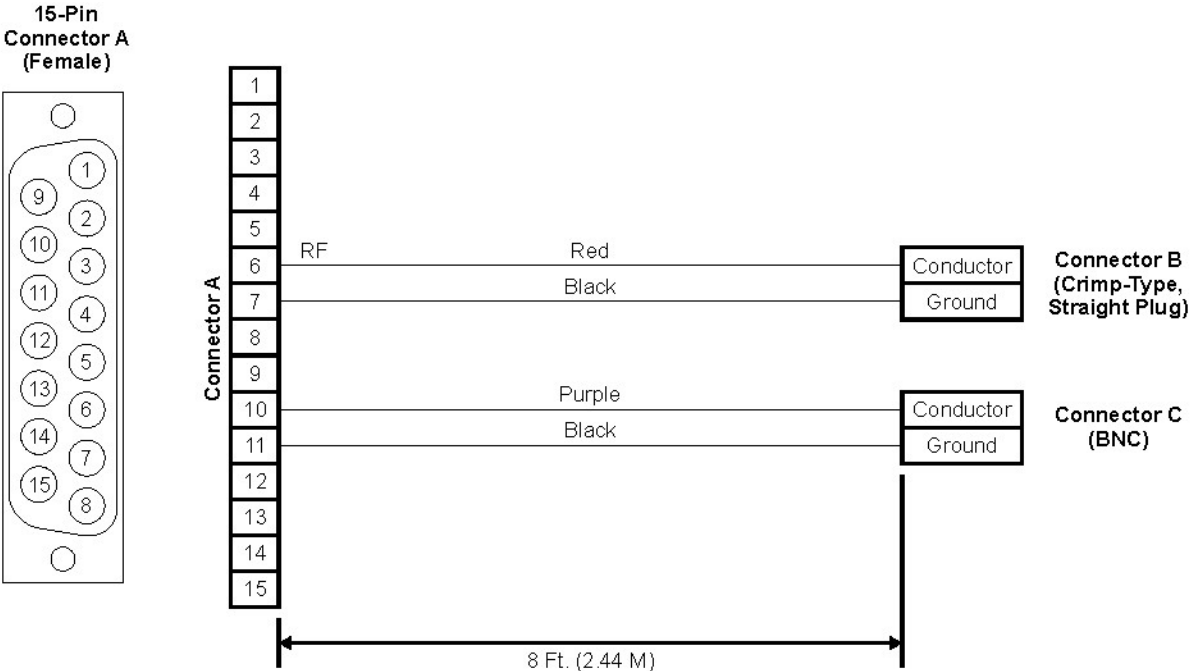


Illustration 6-20: Magnet Monitor Cable G (Run 831): 2204488-5

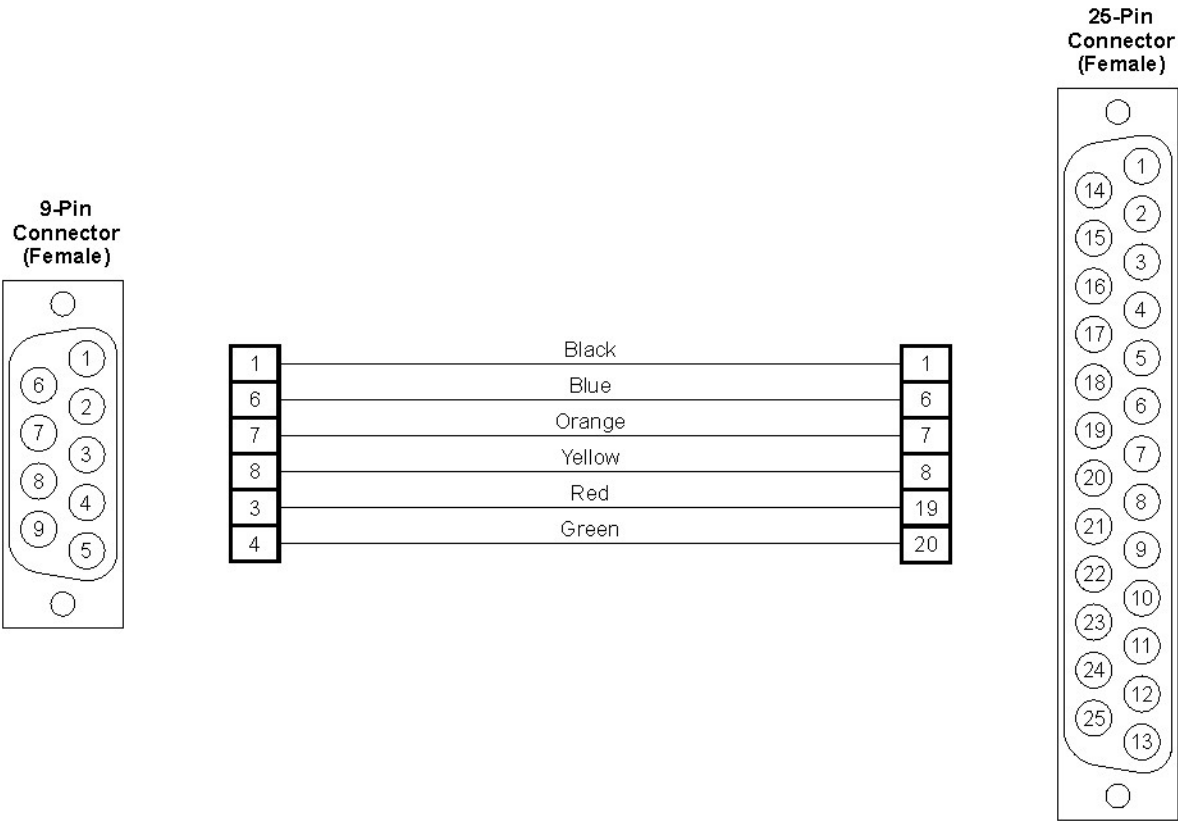


Illustration 6-21: Magnet Monitor Cable L (Run 827): 46-328578P1

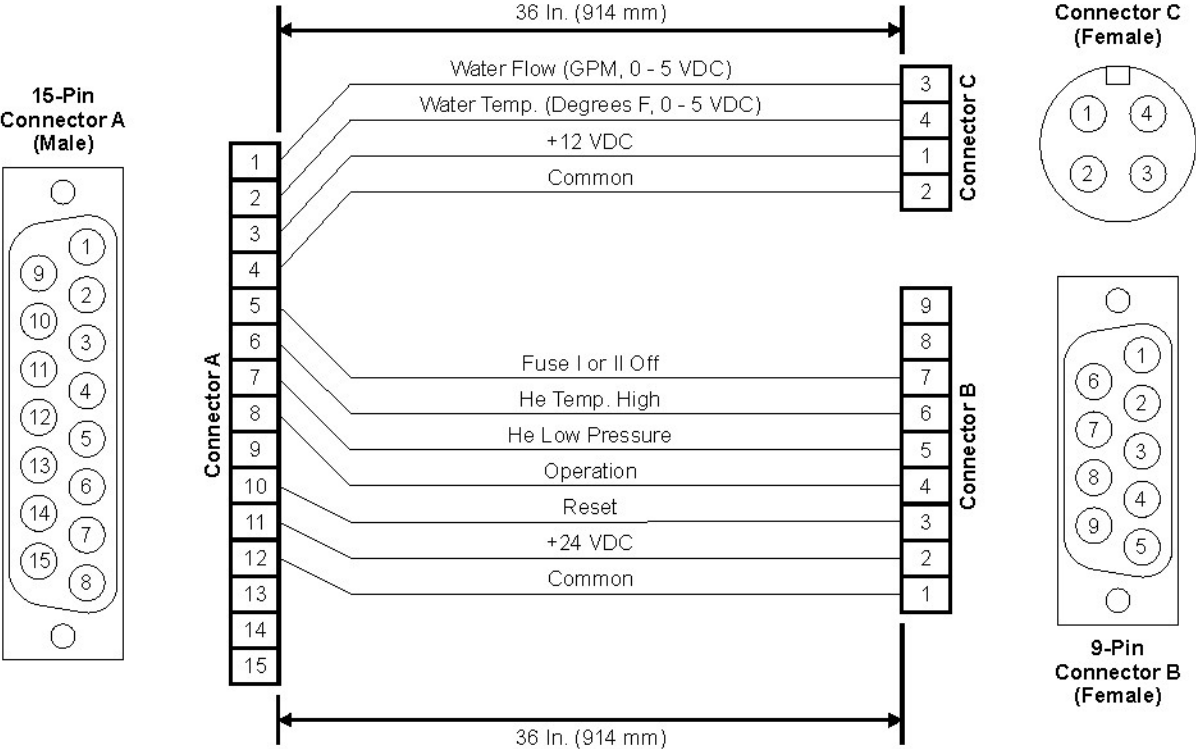


Illustration 6-22: Magnet Monitor Cable J (Run 825): 46-271600G29

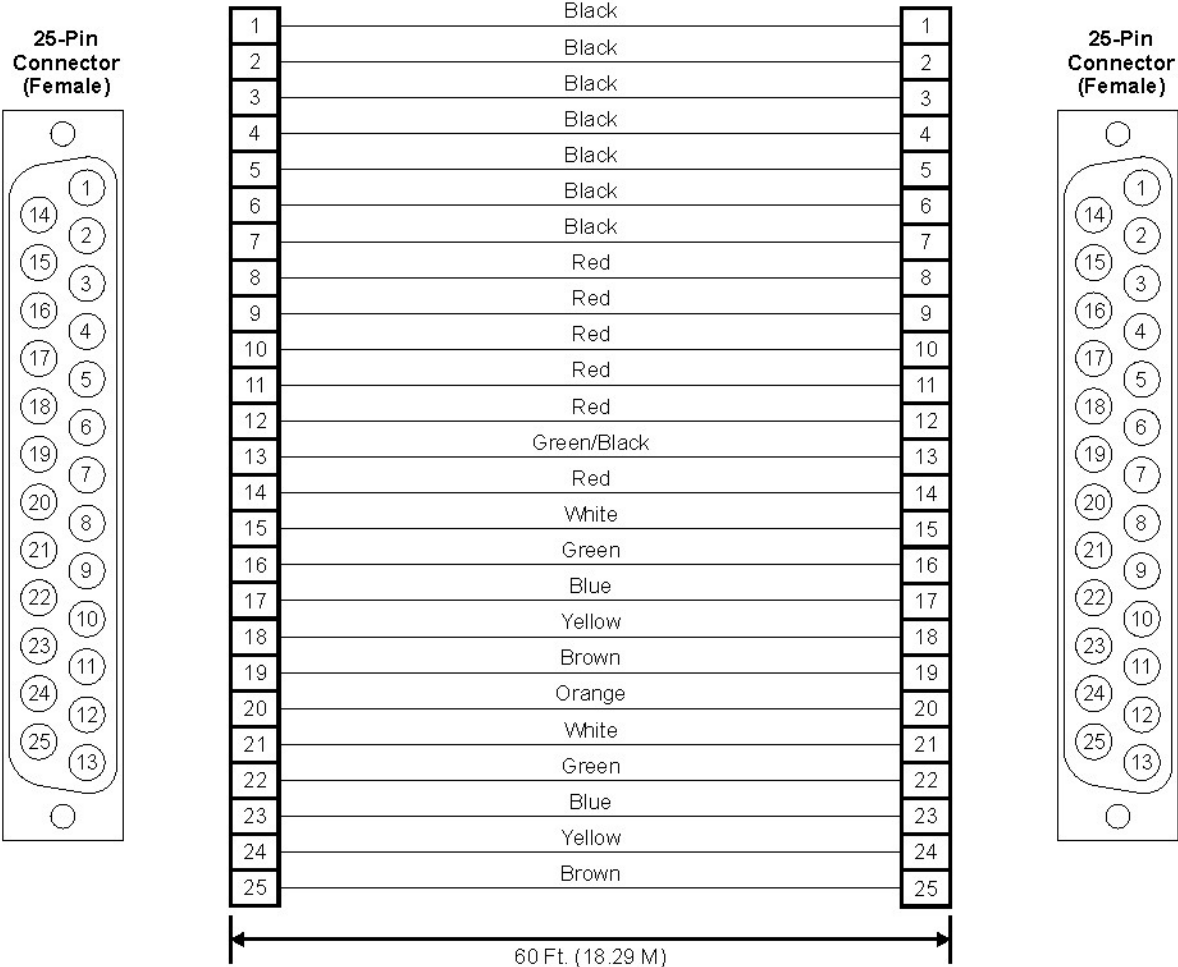


Illustration 6-23: Magnet Monitor Cable M (Run 833): 2225805-1

