

Effectivity

The following CT Equipment is affected:

2276776 LightSpeed Plus Table Assembly

Purpose

The purpose of this FMI is to add a handle to table cradles that do not have one.

Related FMIs

- FMI 25282: Table Cradle Installation
- FMI 25283: IV Pole Installation

Furnished Materials

FMI Kit Part Number 2299383 includes the items listed below.

Qty	Description	Part #
1	FMI Document	2299185-100
1	Table Handle	2287357
2	Screws	46-328417P20

Required Tools

Qty	Description	Part #
1	3/16" Allen Wrench	

People Power

Allow 0.5 hours of labor for the installation of the table cradle handle.

This page intentionally left blank.

Procedure

1 Remove Cradle

- 1.) Raise the table to a comfortable working height.
- 2.) Drive the Cradle/carriage to the latched, home position.

**NOTICE**

An unlatched Cradle/carriage assembly could quickly move toward the gantry, and damage the longitudinal encoder assembly.

- 3.) Remove and retain the six plug buttons that cover the cradle bolt holes.
- 4.) Loosen and remove the six screws located beneath the plug buttons.
- 5.) Lift the Cradle upward, to remove the assembly from the table.

2 Attach Handle

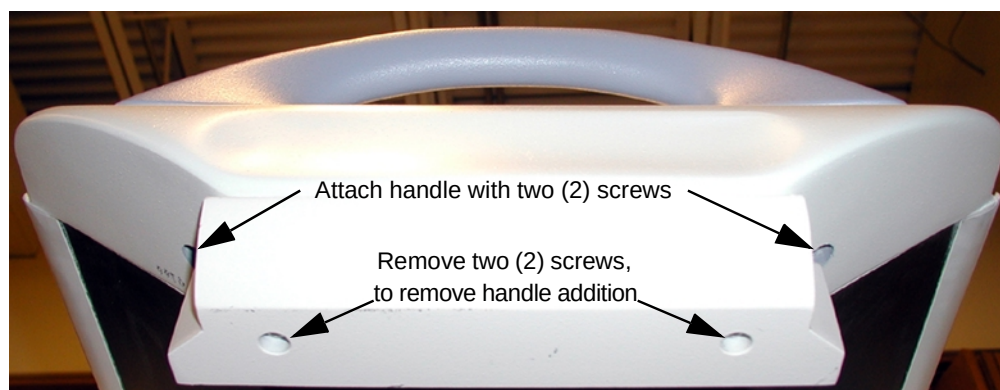


Figure 1 Table cradle, with handle attached

- 1.) Remove the handle addition, by removing two (2) screws.
- 2.) Remove plugs from holes in handle, and secure handle to cradle with two (2) screws (46-328417P20).

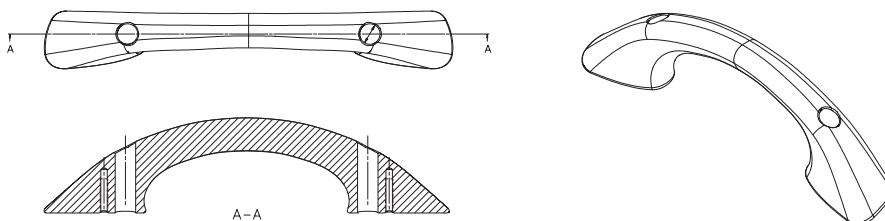


Figure 2 Table handle, showing mounting holes (cross-sectional) and accessory holes

- 3.) Reattach the handle addition.

3 Reattach Cradle

- 1.) Position the rear end of the Cradle over the carriage.
- 2.) Align the holes in the cradle to the threads in the carriage.
- 3.) Start, but do not tighten, all six screws.
- 4.) Look through the gantry bore at the end of table.
- 5.) Laterally position the Cradle on the drive rollers, until the same gap exists between the sloped sides of the Cradle and the guide rollers.
- 6.) Tighten the six screws to 13 ft-lbs.
- 7.) Replace the plug buttons.
- 8.) Make sure the cradle/carriage does not rest against the latch.

End of Document