

1-7 INSTALLATION PROCEDURE

1-7-1 Installation Flow

Note

All on-site construction must be completed before equipment is delivered and installation starts. Attempting to install the system while construction is being completed will impact installation efficiency and further delay site completion. Making sure that all preinstallation and construction work is completed before equipment is delivered will usually result in an earlier turnover date.

The flow chart in Illustration 1-2 should be followed for an orderly and efficient installation of the Signa MR/i system. Note that many procedures may be performed in parallel and may be performed in any order according to the specific situation of each site.

Note

The flow chart references the Tab number and the PIP (Pictorial Installation Procedure) Direction number for the procedure. PIP Directions are similar to cable maps in that they are to be removed from this binder and used at the location where hardware installation is being performed. The PIP Direction may be returned to the binder for future reference upon completion of the installation. Other Directions and installation drawings delivered with kits are also referenced by the flowchart.


This installation flowchart has been developed assuming that all Signa MR/i equipment has been delivered together. Ensure that every part required is available before starting.

The general installation flow is as follows:

- Hardware installation per applicable Pictorial Installation Procedure (PIP) Direction
- Power-up and other pre-software load checks (this can be done while Magnet is being ramped)
- Software reconfiguration (this can be done while Magnet is being ramped)
- Function checks, Set-up and Calibration, and other activity requiring software running that can be done while magnet field is stabilizing
- Mechanical shim of Magnet
- System calibrations
- System performance checks
- Cover replacement
- Final sign-off and records
- Customer turn over

1-7-2 Installation Flowchart Explanation

Shown below are three examples of the flow chart Installation Procedures and an explanation of the areas within the procedures.

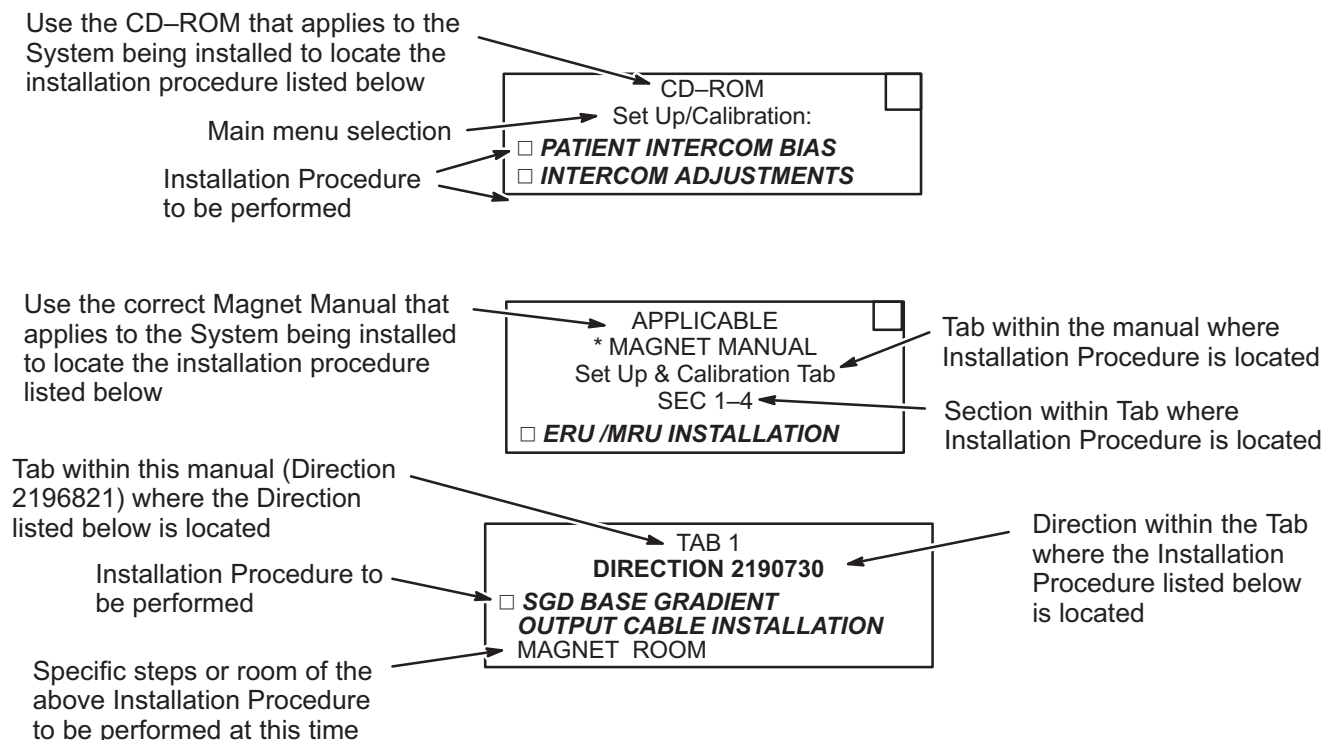

LEGEND FOR FOLLOWING INSTALLATION FLOWCHART



INDICATES MILESTONE COMPLETION GOAL IN DAYS



INDICATES AND OPTIONAL PATH DEPENDING ON SYSTEM CONFIGURATION



INDICATES GE PROPRIETARY PROCEDURE



INDICATES AN ADDITIONAL PROPRIETARY TEST OR ALTERNATIVE PROPRIETARY CALIBRATION PROCEDURE AVAILABLE FOR GE USE OR TO CUSTOMERS WITH AN ADVANCED SERVICE PACKAGE LIMITED LICENSE.



AFTER GRADIENT SHIM (OR LV SHIM) IT MAY BE NECESSARY TO REPAIR THE MAGNET.

NOTE 1: STANDARD CORRELATED NOISE CHECK NOT REQUIRED IF PROPRIETARY SPT FULL TEST MODE PROCEDURE PERFORMED EARLIER DURING INSTALLATION (HOWEVER, MULTICOIL AND FAST RECEIVER OPTION CORRELATED NOISE CHECKS IN PROCEDURE STILL REQUIRED).

NOTE 2: IF TROUBLESHOOTING NECESSARY.

NOTE 3:

NOTE 4: A "saveINFO" SHOULD BE DONE BEFORE SPT IS RUN. IF YOU HAVE THE EPI OPTION, IT IS NECESSARY TO "saveINFO" AGAIN. IN THIS WAY, ANY DATA COLLECTED FOR CALIBRATION WILL NOT BE LOST IF A PROBLEM OCCURS.


NOTE 5: VALUES OF LVSHIM ARE DEPENDENT UPON EDDY CURRENT COMPENSATION.

NOTE 6: VALUES OF EDDY CURRENT COMPENSATION ARE INDEPENDENT OF MAGNET SHIM.

NOTE 7: OVERNIGHT DIAGS MAY BE RUN AT END OF ANY DAY TO DETECT POSSIBLE ERRORS.

**MARK OFF
PERFORMED
ITEMS**

IMPORTANT: PER ISO 9001 REQUIREMENTS

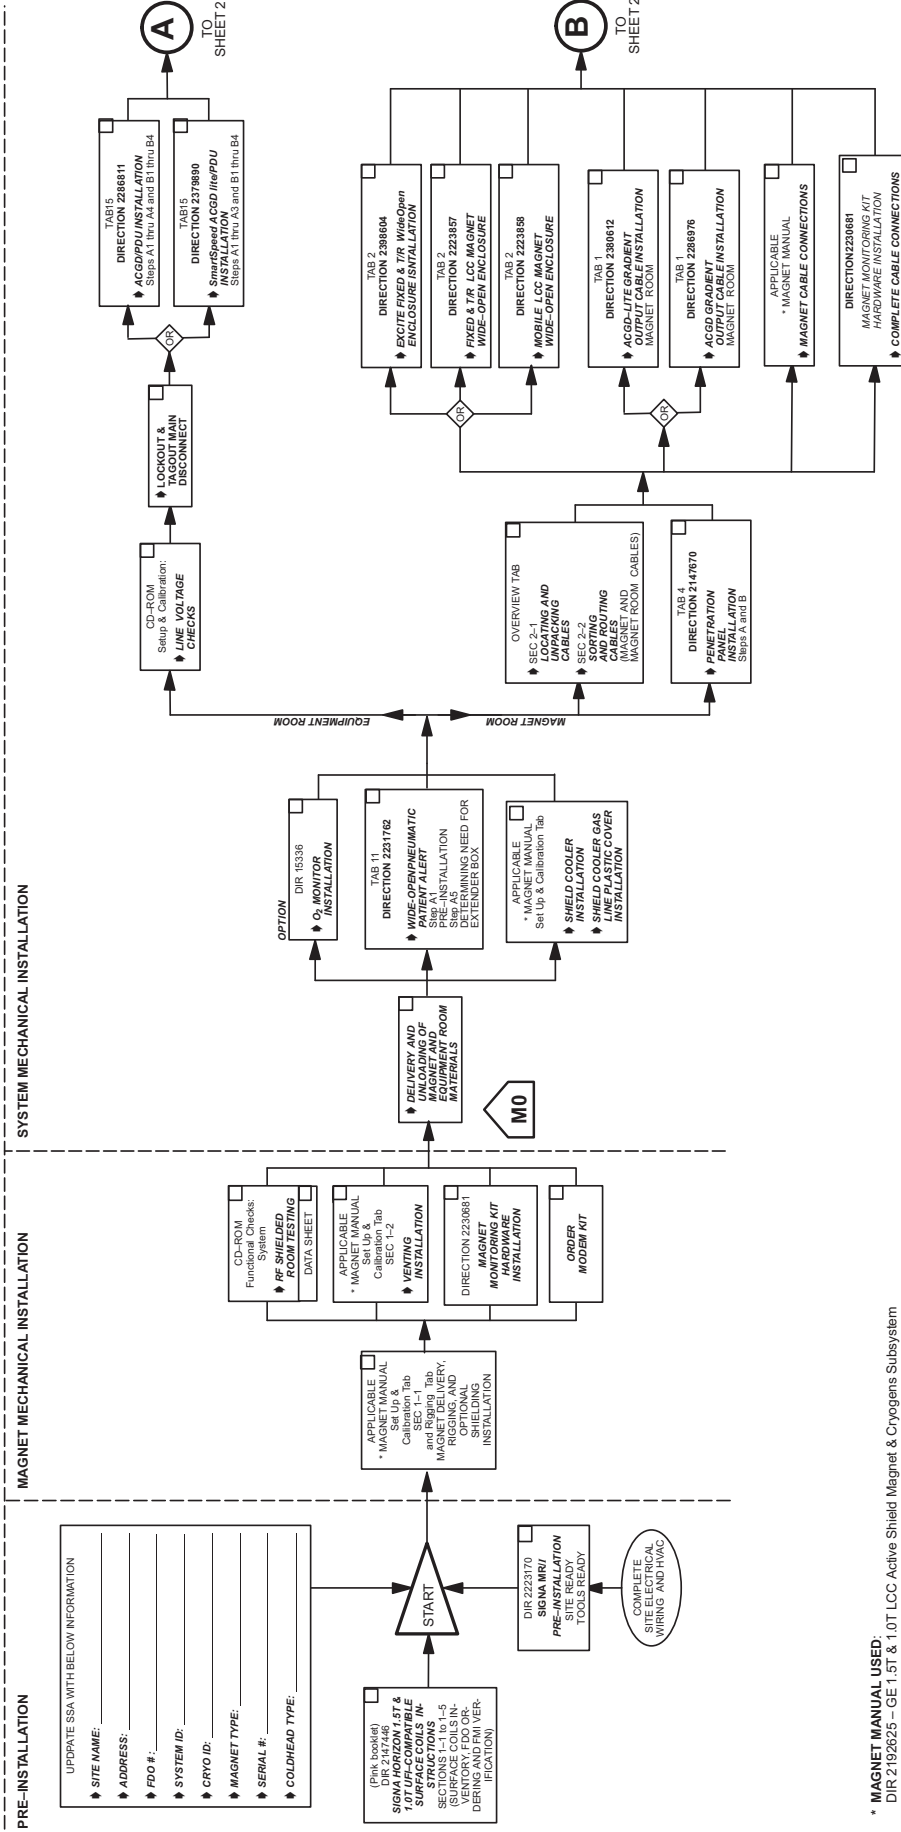


* MAGNET MANUAL USED:
DIR 2192625 – GE 1.5T & 1.0T LCC Active Shield Magnet & Cryogens Subsystem
DIR 2226319 – GE 1.5T & 1.0T LCC Magnet Sigma MR/i; & CV/i Delivery & Installation

THIS PAGE LEFT BLANK INTENTIONALLY

MARK OFF
PERFORMED
ITEMS

IMPORTANT: PER ISO
9001 REQUIREMENTS


SYSTEM MECHANICAL INSTALLATION

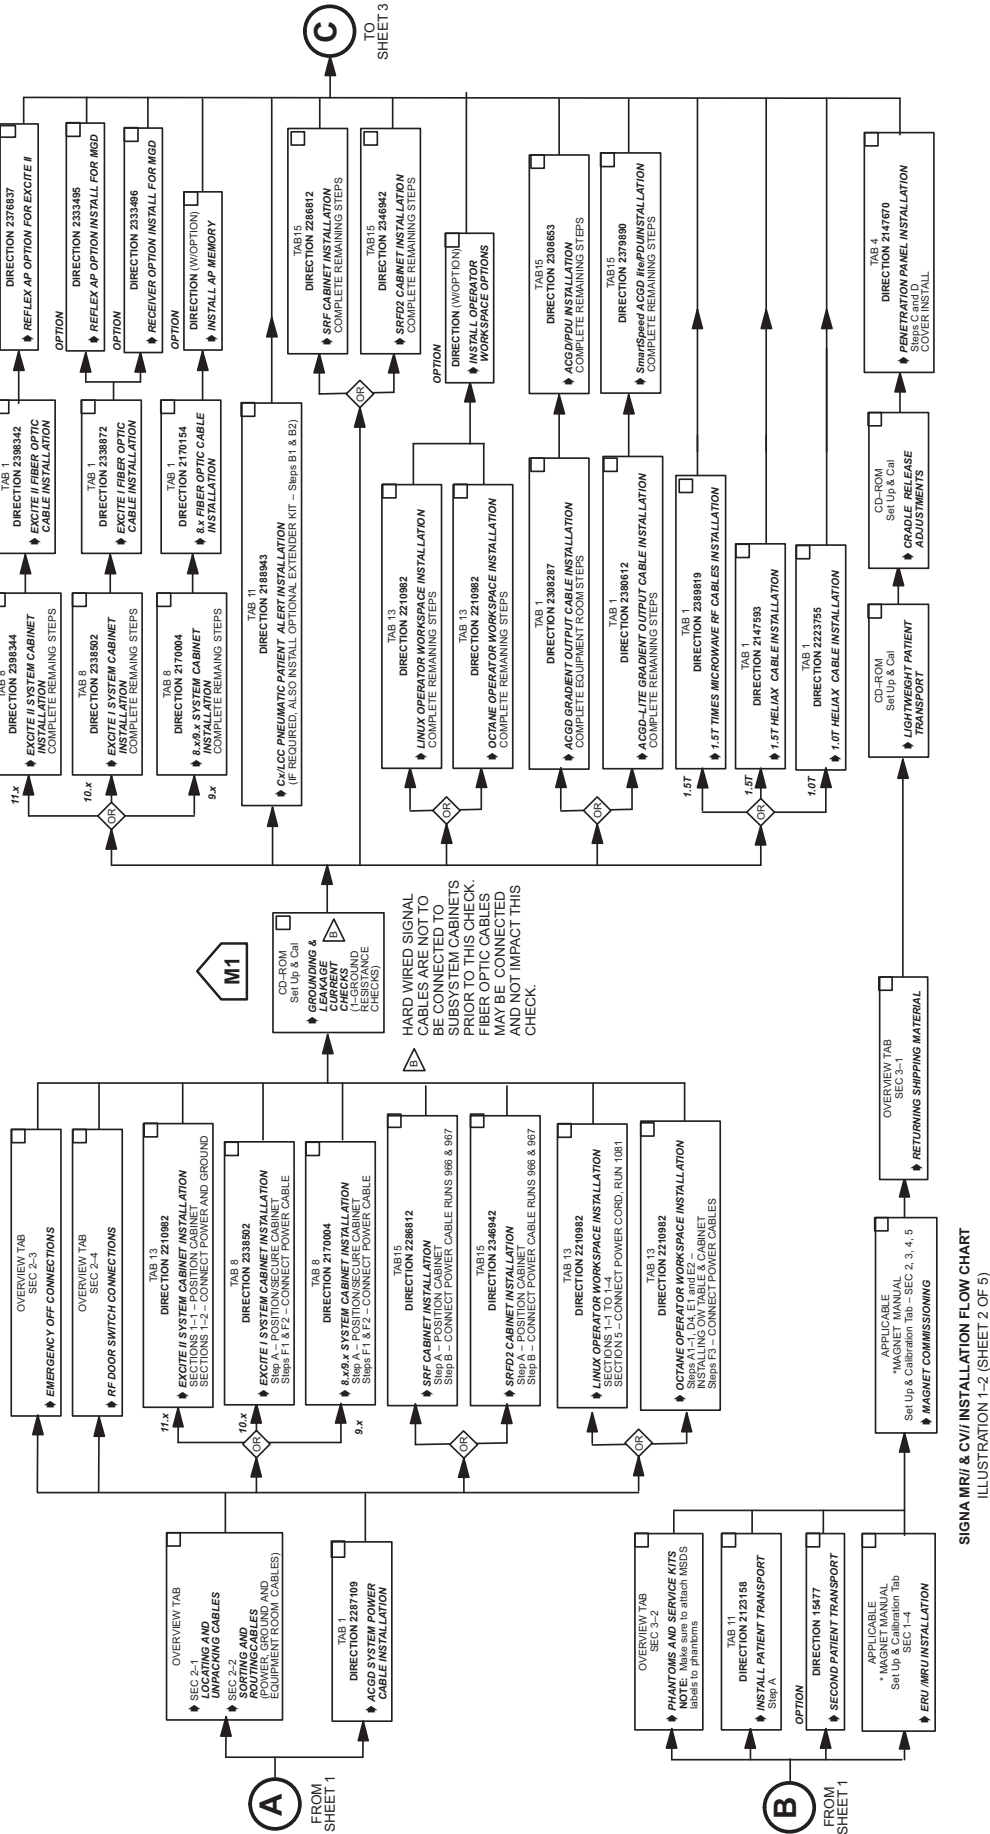

SIGNA MR/i & CV/i INSTALLATION FLOW CHART
ILLUSTRATION 1-2 (SHEET 2 OF 5)


THIS PAGE LEFT BLANK INTENTIONALLY

MARK OFF PERFORMED ITEMS

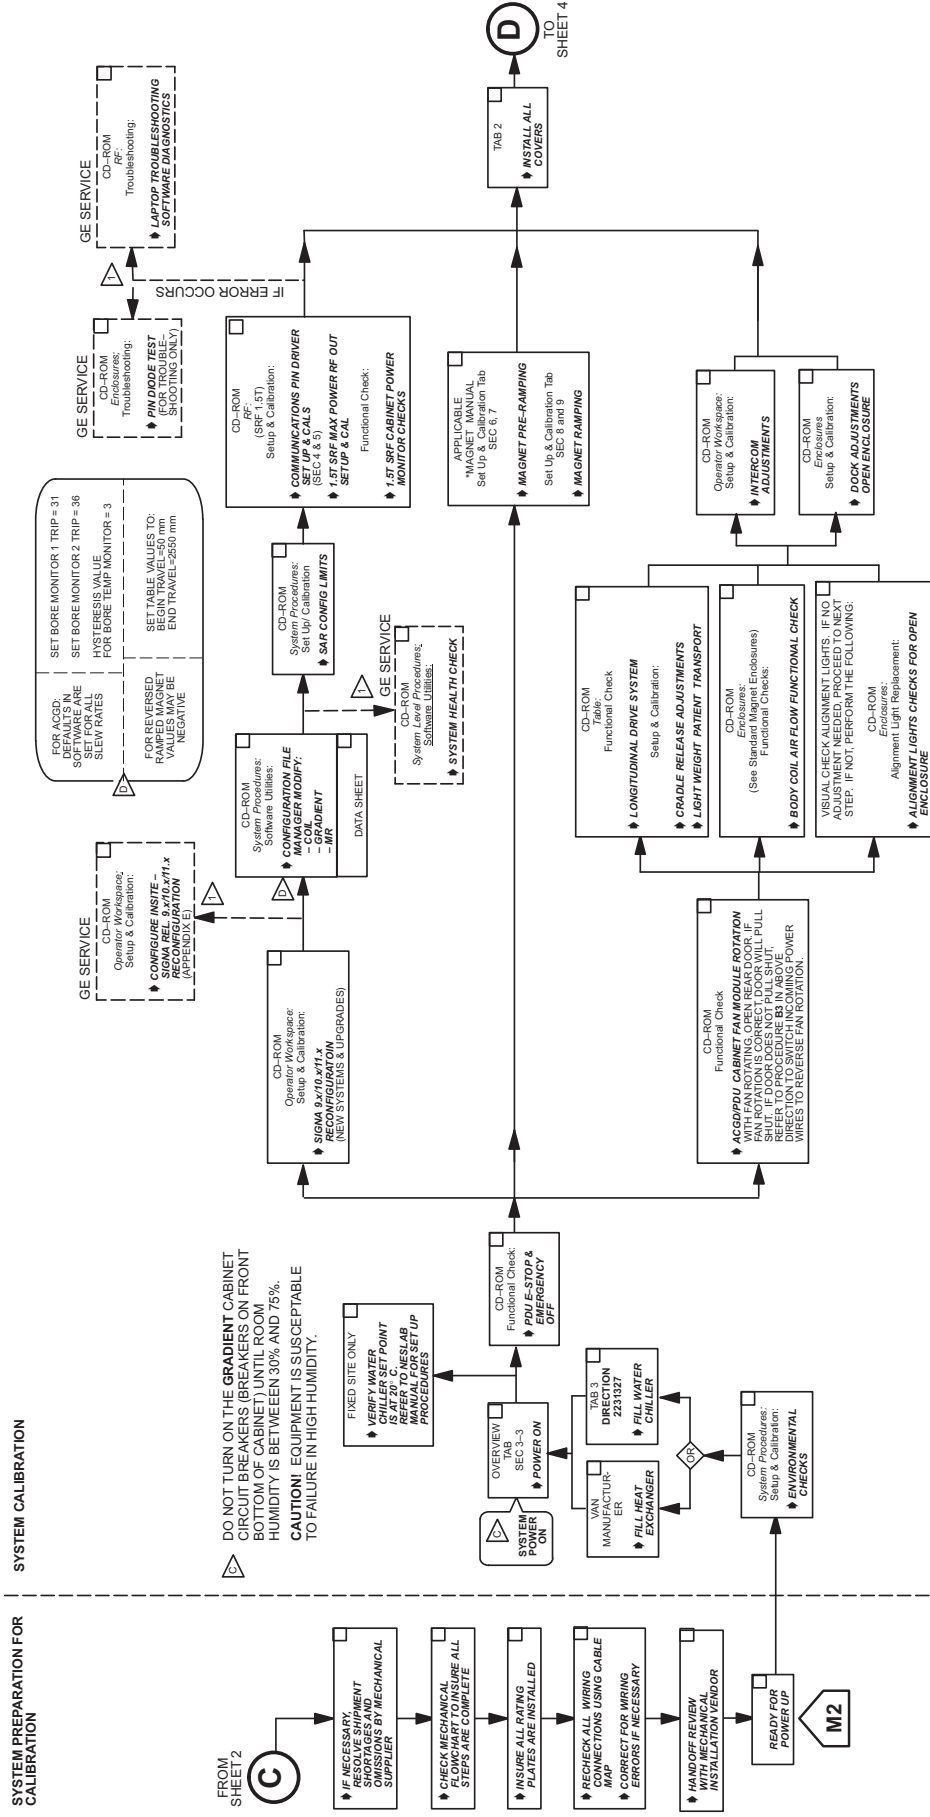

SIGNA MR//i & CV//i INSTALLATION FLOW CHART
ILLUSTRATION 1-2 (SHEET 3 OF 5)

THIS PAGE LEFT BLANK INTENTIONALLY

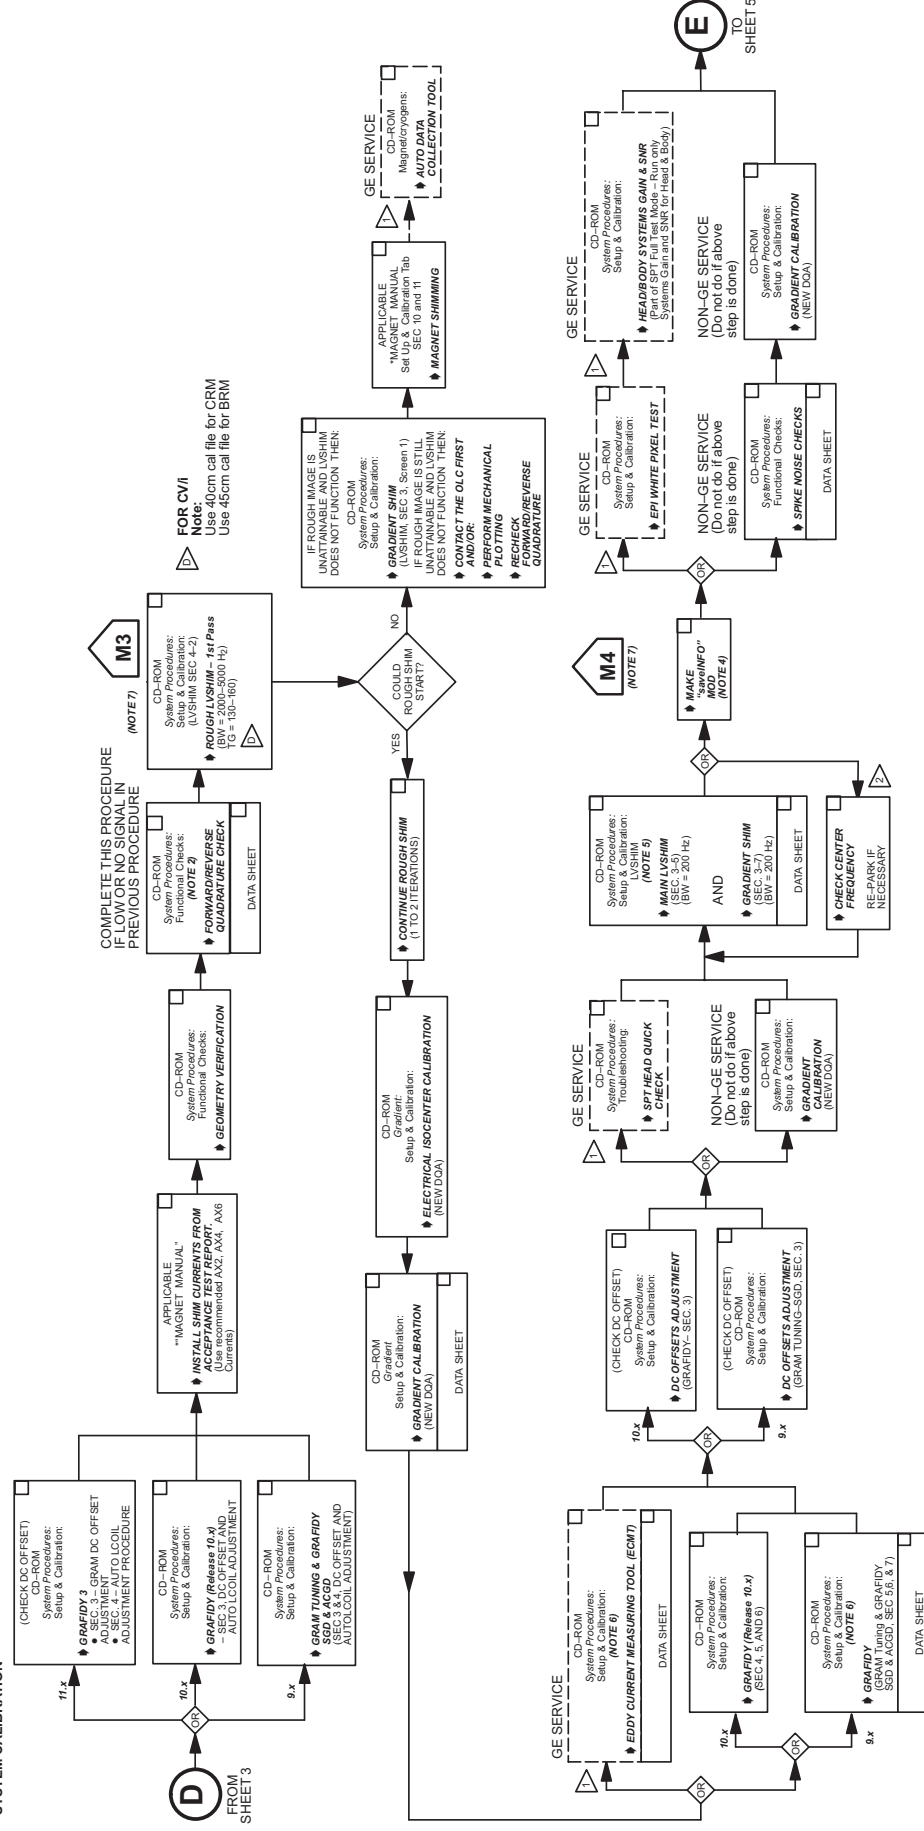


1-23

THIS PAGE LEFT BLANK INTENTIONALLY

**MARK OFF
PERFORMED
ITEMS**

IMPORTANT: PER ISO 9001 REQUIREMENTS

SYSTEM CALIBRATION

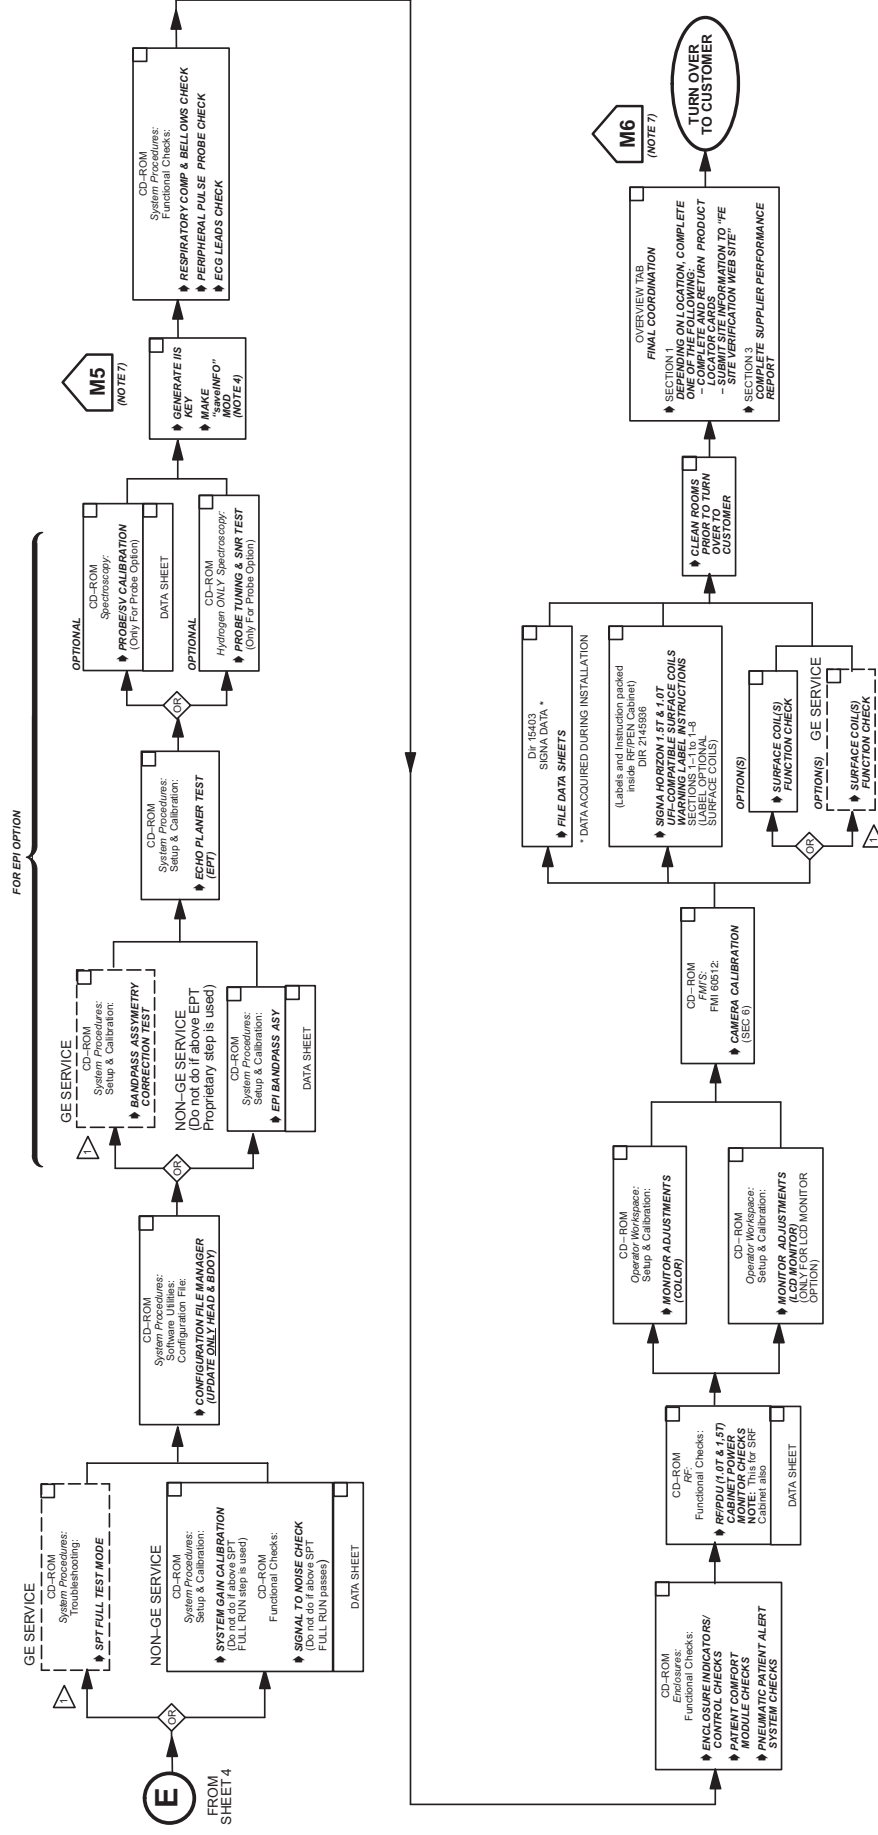

SIGNA MR//i & CV//i INSTALLATION FLOW CHART
ILLUSTRATION 1-2 (SHEET 5 OF 5)