

TABLE OF CONTENTS

TABLE OF CONTENTS	1
1- OVERVIEW	2
2- CHECK RF AMPLIFIER FANS AND CABINET FILTERS	2
REVISION HISTORY	4


1- OVERVIEW

This section describes the air filter replacement performed on both the 1.0T/1.5T RF/PDU cabinets. The cabinet uses forced air cabinet cooling. The cabinet air passes through viscous impingement air filters that must be replaced as necessary to ensure proper cabinet cooling. **Replace filters during the initial installation of the site before turning the system over to the customer.**

When replacing air filters, be sure to use GE part number 2160200-44. See Illustration 2-1.

2- CHECK RF AMPLIFIER FANS AND CABINET FILTERS

1. Turn the recessed screw at the top center of the front cover 1/4 turn counterclockwise to release the cover latch.
2. Tilt the top of the front cover forward, and lift up and out to remove the cover for access to the filter(s).
3. Remove each filter by lifting up slightly and pulling bottom edge outward.
4. Inspect the filter for dust build-up, and replace as required.
5. First insert the filters up and into the top bracket, then drop down into lower bracket, keeping the intake side (side with cleaning instructions) facing the door.

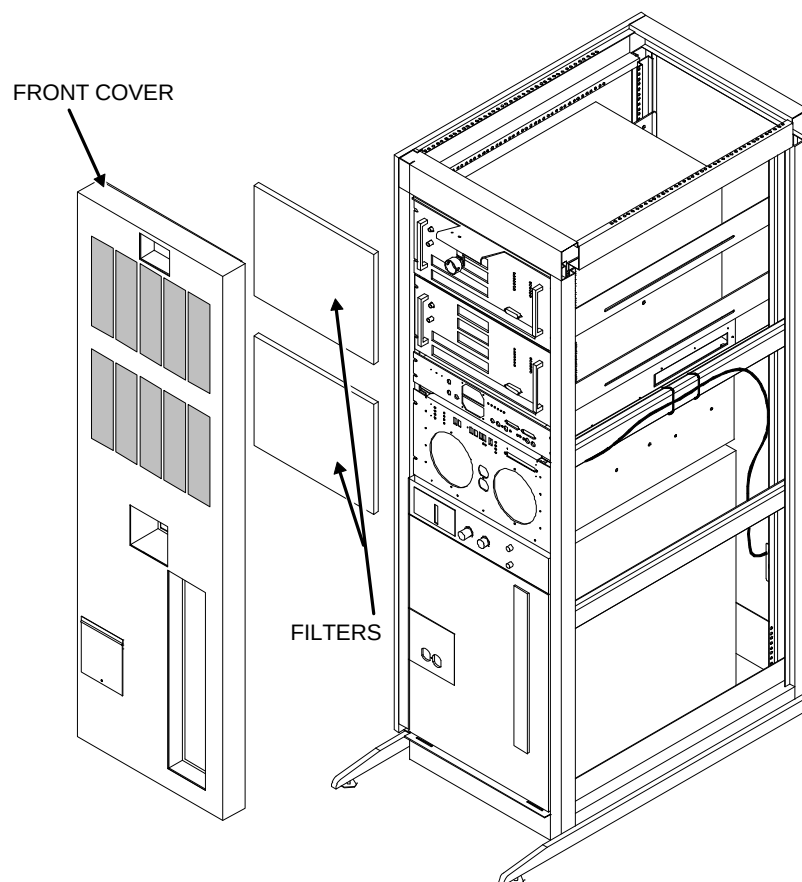


RF/PDU CABINET COVERS AND FILTER LOCATIONS
ILLUSTRATION 2-1

2- CHECK RF AMPLIFIER FANS AND CABINET FILTERS (continued)

6. **For 1.0T:** Probe Fans (2195572), on the rear of both RF Amplifiers, with a small ty-wrap to make sure they are operating. See Illustration 2-2.

For 1.5T: Probe Fans (2176114), on the front of both RF Amplifiers, with a small ty-wrap to make sure they are operating. See Illustration 2-3.

7. Replace the front cover on the cabinet by inserting the lower cover lip behind the shoulder bolts at the bottom of the cabinet and swinging the top of the door into the spring loaded "slam-latch".

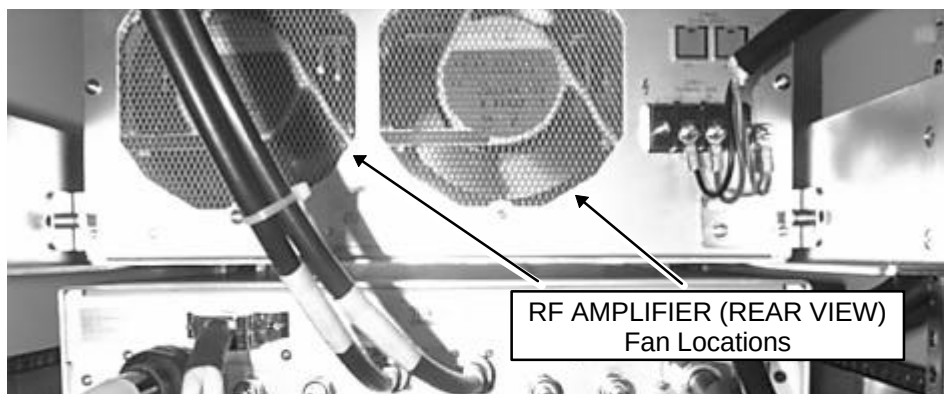

1.0T RF AMPLIFIER FAN LOCATIONS
ILLUSTRATION 2-2

FRONT VIEW



1.5T RF AMPLIFIER FAN LOCATIONS
ILLUSTRATION 2-3

REVISION HISTORY

REV	DATE	AUTHOR	PRIMARY REASONS FOR CHANGE
A	July 23, 1997 Feb 13, 1998	K.Verdon (Erbtec) K. Keshena	Preliminary Version Updated to 1.0T RF/PDU Cabinet.
0	June 30, 1998	KK	Initial Release.
1	December 30, 1998	K. Keshena	Added correct GE part numbers for filters and fans. Added illustrations.
2	May 10, 1999	K. Keshena	Added 1.5T RF/PDU Cabinet information to file.