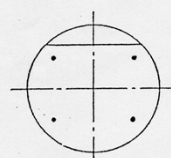
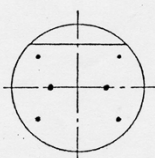
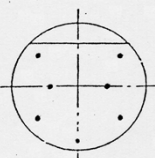
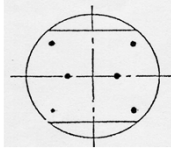
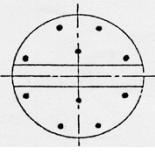
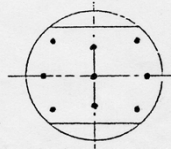


Table 1: Dimension Tolerance for Sieve Tray

Tower Tag No.		T-xxx
Tray Type		2
Tray Outer Diameter	D	1,000
Liquid Flow Path		1

Inspection Item		Tray Type		Tolerance
		<u>1: Cartridge type</u>	<u>2: Sectional type</u>	
1.	Tray Outer Diameter	+ 0 - (1+D/600)	+ 3 - (3+D/600)	+ 3 - 4.7
2.	Tray Spacing	± 1.0	+ 0 - 4.5	+ 0 - 4.5
3.	Tray Floor Level (Table 1) measure point number measure point location	min(0.5+D/600,6) refer to Table 2 "	min(0.5+D/600,6) refer to Table 2 "	2.2
4.	Weir Height	± 1.5	± 1.5	± 1.5
5.	Downcomer Clearance	± 1.5	± 1.5	± 1.5
6.	Downcomer Length, Width	± 1.5	± 2 if D < 1,000 ± 3 if D ≥ 1,000	± 3
7.	Downcomer Bar Hole Pitch distance between first and last hole		± 1.5 ± 3	± 1.5 ± 3
8.	Hole Diameter	± 0.15	± 0.15	± 0.15
9.	Hole Pitch	± 0.25	± 0.25	± 0.25
10.	Hole Number	± 3%	± 3%	± 3%

Table 2: Measure Point Number and Location for Tray Floor Level

Path No.	Outer Dia. of Tray	Measure Point		
		Number	Location	
1	≤ 1,500	4	Fig.1	
	1,501~2,500	6	Fig.2	
	> 2,500	7	Fig.3	
2	1,501~2,500	side outweir: 6	Fig.4	
		center outweir: 10	Fig.5	
	> 2,500	side outweir: 9	Fig.6	
		center outweir: 12	Fig.7	