


## Conduction Fins 09

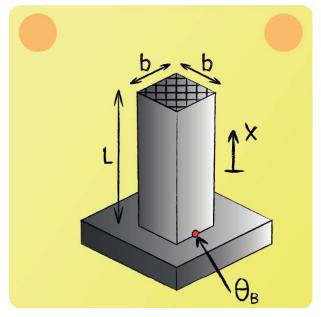

Calculate the transferred heat for the given fin with an adiabatic head!

Boundary conditions:

$$\theta(x=0) = \theta_B$$

$$-\lambda \cdot \frac{d\theta}{dx}\bigg|_{x=L} = 0$$

Heat flow through the fin:



$$\dot{Q} = \lambda \cdot A_{\rm c} \cdot m \cdot \theta_{\rm B} \cdot \tanh\left(m \cdot L\right)$$

Where:

$$m = \sqrt{\frac{4 \cdot \alpha}{\lambda \cdot b}}$$
 
$$A_{\rm c} = b^2$$

And thus:

$$\dot{Q} = \lambda \cdot b^2 \cdot \sqrt{\frac{4 \cdot \alpha}{\lambda \cdot b}} \cdot \theta_{\rm B} \cdot \tanh\left(\sqrt{\frac{4 \cdot \alpha}{\lambda \cdot b}} \cdot L\right)$$