BVSS (BDCOM Virtual Switch System) Configuration in Ring Topology with 3 units of BDCOM L2 Switches

Topology:

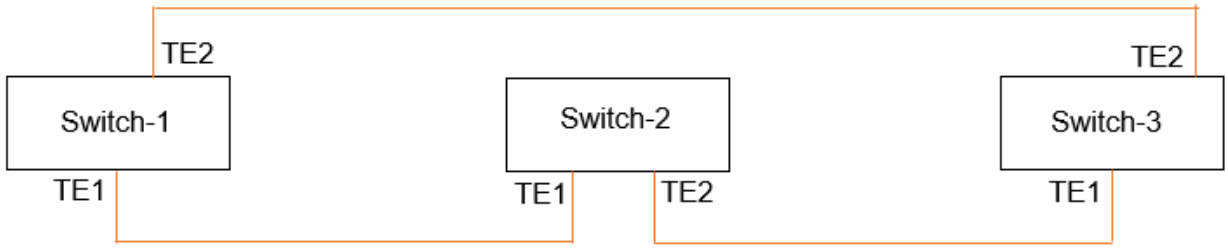

Configuration:

SW-1

```
SW-1_config#
SW-1_config#bvss
SW-1_config_bvss#bvss enable
SW-1_config_bvss#bvss mode enhanced
SW-1_config_bvss#bvss domain-id 1
SW-1_config_bvss#bvss member-id 1
SW-1_config_bvss#bvss priority 253
SW-1_config_bvss#bvss interface 1 slot 0 port 1 group 1
SW-1_config_bvss#bvss interface 2 slot 0 port 2 group 2
SW-1_config_bvss#exit
SW-1#write bvss-config
SW-1#reboot
```

SW-2

```
SW-2_config#
SW-2_config#bvss
SW-2_config_bvss#bvss enable
SW-2_config_bvss#bvss mode enhanced
SW-2_config_bvss#bvss domain-id 1
SW-2_config_bvss#bvss member-id 2
SW-2_config_bvss#bvss priority 252
SW-2_config_bvss#bvss interface 1 slot 0 port 1 group 2
SW-2_config_bvss#bvss interface 2 slot 0 port 2 group 1
SW-2_config_bvss#exit
SW-2#write bvss-config
SW-2#reboot
```

SW-3

```
SW-3_config_bvss#
SW-3_config_bvss#bvss enable
SW-3_config_bvss#bvss mode enhanced
SW-3_config_bvss#bvss domain-id 1
SW-3_config_bvss#bvss member-id 3
SW-3_config_bvss#bvss priority 251
SW-3_config_bvss#bvss interface 1 slot 0 port 1 group 2
SW-3_config_bvss#bvss interface 2 slot 0 port 2 group 1
SW-3_config_bvss#exit
SW-3#write bvss-config
SW-3#reboot
```

Result:

Switch#**show interface brief**

Port	Description	Status	Vlan	Duplex	Speed	Type
g1/0/1		down	1	auto	auto	Giga-TX
g1/0/2		down	1	auto	auto	Giga-TX
g1/0/3		down	1	auto	auto	Giga-TX
g1/0/4		down	1	auto	auto	Giga-TX
g1/0/5		down	1	auto	auto	Giga-TX
g1/0/6		down	1	auto	auto	Giga-TX
g1/0/7		down	1	auto	auto	Giga-TX
g1/0/8		down	1	auto	auto	Giga-TX
g1/0/9		down	1	auto	auto	Giga-TX
g1/0/10		down	1	auto	auto	Giga-TX
g1/0/11		down	1	auto	auto	Giga-TX
g1/0/12		down	1	auto	auto	Giga-TX
g1/0/13		down	1	auto	auto	Giga-TX
g1/0/14		down	1	auto	auto	Giga-TX
g1/0/15		down	1	auto	auto	Giga-TX
g1/0/16		down	1	auto	auto	Giga-TX
g1/0/17		down	1	auto	auto	Giga-TX
g1/0/18		down	1	auto	auto	Giga-TX
g1/0/19		down	1	auto	auto	Giga-TX
g1/0/20		down	1	auto	auto	Giga-TX
g1/0/21		down	1	auto	auto	Giga-TX
g1/0/22		down	1	auto	auto	Giga-TX
g1/0/23		down	1	auto	auto	Giga-TX
g1/0/24		down	1	auto	auto	Giga-TX
g2/0/1		down	1	auto	auto	Giga-TX
g2/0/2		down	1	auto	auto	Giga-TX
g2/0/3		down	1	auto	auto	Giga-TX
g2/0/4		down	1	auto	auto	Giga-TX
g2/0/5		down	1	auto	auto	Giga-TX
g2/0/6		down	1	auto	auto	Giga-TX
g2/0/7		down	1	auto	auto	Giga-TX
g2/0/8		down	1	auto	auto	Giga-TX
g2/0/9		down	1	auto	auto	Giga-TX

g2/0/10	down	1	auto	auto	Giga-TX
g2/0/11	down	1	auto	auto	Giga-TX
g2/0/12	down	1	auto	auto	Giga-TX
g2/0/13	down	1	auto	auto	Giga-TX
g2/0/14	down	1	auto	auto	Giga-TX
g2/0/15	down	1	auto	auto	Giga-TX
g2/0/16	down	1	auto	auto	Giga-TX
g2/0/17	down	1	auto	auto	Giga-TX
g2/0/18	down	1	auto	auto	Giga-TX
g2/0/19	down	1	auto	auto	Giga-TX
g2/0/20	down	1	auto	auto	Giga-TX
g2/0/21	down	1	auto	auto	Giga-TX
g2/0/22	down	1	auto	auto	Giga-TX
g2/0/23	down	1	auto	auto	Giga-TX
g2/0/24	down	1	auto	auto	Giga-TX
g3/0/1	down	1	auto	auto	Giga-TX
g3/0/2	down	1	auto	auto	Giga-TX
g3/0/3	down	1	auto	auto	Giga-TX
g3/0/4	down	1	auto	auto	Giga-TX
g3/0/5	down	1	auto	auto	Giga-TX
g3/0/6	down	1	auto	auto	Giga-TX
g3/0/7	down	1	auto	auto	Giga-TX
g3/0/8	down	1	auto	auto	Giga-TX
g3/0/9	down	1	auto	auto	Giga-TX
g3/0/10	down	1	auto	auto	Giga-TX
g3/0/11	down	1	auto	auto	Giga-TX
g3/0/12	down	1	auto	auto	Giga-TX
g3/0/13	down	1	auto	auto	Giga-TX
g3/0/14	down	1	auto	auto	Giga-TX
g3/0/15	down	1	auto	auto	Giga-TX
g3/0/16	down	1	auto	auto	Giga-TX
g3/0/17	down	1	auto	auto	Giga-TX
g3/0/18	down	1	auto	auto	Giga-TX
g3/0/19	down	1	auto	auto	Giga-TX
g3/0/20	down	1	auto	auto	Giga-TX
g3/0/21	down	1	auto	auto	Giga-TX
g3/0/22	down	1	auto	auto	Giga-TX
g3/0/23	down	1	auto	auto	Giga-TX
g3/0/24	down	1	auto	auto	Giga-TX
tg1/0/1	up	1	full	10000Mb	10Giga-FX-SFP
tg1/0/2	up	1	full	10000Mb	10Giga-FX
tg1/0/3	down	1	full	10000Mb	10Giga-FX
tg1/0/4	down	1	full	10000Mb	10Giga-FX
tg2/0/1	up	1	full	10000Mb	10Giga-FX-SFP
tg2/0/2	up	1	full	10000Mb	10Giga-FX-SFP
tg2/0/3	down	1	full	10000Mb	10Giga-FX
tg2/0/4	down	1	full	10000Mb	10Giga-FX
tg3/0/1	up	1	full	10000Mb	10Giga-FX-SFP
tg3/0/2	up	1	full	10000Mb	10Giga-FX
tg3/0/3	down	1	full	10000Mb	10Giga-FX
tg3/0/4	down	1	full	10000Mb	10Giga-FX

#Show version

```
File  Edit  Setup  Control  Window  Help

Switch#show version
BDCOM(tm) S2928-P Software, Version 2.2.0F Build 120083
Copyright by Shanghai Baud Data Communication CO. LTD.
Compiled: 2023-11-10 15:26:13 by SYS, Image text-base: 0x80010000
ROM: System Bootstrap, Version 0.1.4, Serial num:0G20028000258
System image file is "Switch.bin"
hardware version:A
(RISC) processor with 262144K bytes of memory, 32768K bytes of flash
Base ethernet MAC Address: 00:37:00:00:11:c9
PCB version:A
snmp info:
  product_ID:469   system_ID:1.3.6.1.4.1.3320.1.469.0
Switch uptime is 1:01:23:12, The current time: 2000-1-2 1:24:14
 Reboot history information:
  No. 1: System is rebooted by power-on
  No. 2: System is rebooted by command at 2000-1-1 2:5:27, uptime 0:02:05:12
  No. 3: System is rebooted by command at 2000-1-1 0:2:28, uptime 0:00:02:17
Switch#
```

#Show bvss management

```
File  Edit  Setup  Control  Window  Help
Switch#
Switch#
Switch#show bvss management
bvss member 1 management information:
 active member: 1, standby member: 2
 lgroup: 1, rgroup: 2
 internal topology:0 , global topology: LOOP-TOPO
Switch#
Switch#
```

#Show bvss link

```
File  Edit  Setup  Control  Window  Help
Switch#
Switch#show bvss link

Member 1
 Group      Interface          Peer-Interface      Status
 1          tg1/0/1            tg2/0/1             Protocal-Up
 2          tg1/0/2            tg3/0/2             Protocal-Up

Switch#
Switch#
```

#show bvss running-config

```
File  Edit  Setup  Control  Window  Help
SW1#
SW1#
SW1#show bvss running-config
bvss configuration information:
 bvss enable: TRUE
 bvss domain-id: 1
 bvss member-id : 1
 bvss mode: enhanced
 bvss priority: 253
 bvss vlan: 4094
 bvss mac-address mode: use-active-member
SW1#
```

#show bvss rnp

```
File  Edit  Setup  Control  Window  Help
Switch#
Switch#show bvss rnp

  RNP is running. CfgPri 253, SwitchType 0x1171, Slot 0
  System started, ignoreTimeoutCnt 0
  DomainId 1, MemberId 1, LoopTopology 0, Merge 0, Master State
  MasterMemId 1, BackupMemId 2, MasterGlbMacAddr 0037.0000.11c9
  OldMasterMemberId 0, OldMasterWhile 0, txAdvPduCnt 36423
  lacpMad: OldActiveId 0, OldActiveWhile 0, ActiveWhile 0

  bvss link group 1 is usable, bvss link group 2 is usable.

  Pri info for member 1 (SwitchType 1171, slot 0):
    Priority 253, RunningTime 91666, MAC 0037.0000.11c9

  Pri info for member 2 (SwitchType 1171, slot 0):
    Priority 252, RunningTime 83411, MAC 0037.0000.18cf

  Pri info for member 3 (SwitchType 1171, slot 0):
    Priority 251, RunningTime 91672, MAC 0037.0000.1960

Switch#
```

#show bvss sgnp

```
File  Edit  Setup  Control  Window  Help
Switch#
Switch#show bvss sgnp

  SGNP is running, Running Time 91803, NeighbourTimeout 10, Started TMP

  bvss Role notified, System started, ignoreTimeoutCnt 182392
  DomainId 1, MemberId 1, bvss Mode 3, LoopTopology 0
  MAC Addr:0037.0000.11c9, portMap:1-2

  bvss link group info for group 1:
    cfgMemberPt: 1; validMemberPt: 1
    peerMemberId 2, peerGroupId 2
  bvss link group info for group 2:
    cfgMemberPt: 2; validMemberPt: 2
    peerMemberId 3, peerGroupId 1

  bvss port info for port 1:
   tg2/0/1 slotId 0, groupId 1, peerPortId 1, peerSlotId 0, peerGroupId 2
  bvss port info for port 2:
   tg3/0/2 slotId 0, groupId 2, peerPortId 2, peerSlotId 0, peerGroupId 1

Switch#
Switch#
```

The End