

MobilTM

Unit ID: 1212

Asset ID: 51414378

Description: right front final drive

Caution

Account Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample Information

Sample ID: 25296320029

Service Level: Essential

Bottle ID: a037323315

Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Equipment Information

Asset Class: Gear Drive


Manufacturer: CATERPILLAR

Model:

Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Sample Data & Trends

Sample Info	Report Status	Normal	Normal	Alert	Alert	Caution
	Sample ID	24010131047	24122146004	25059237026	25111107052	25296320029
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a030116214	a029199566	a033577756	a035394840	a037323315
	Tested Lubricant	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50
	Sampled	04 Jan 2024	25 Apr 2024	11 Dec 2024	02 Apr 2025	13 Oct 2025
	Reported	15 Jan 2024	08 May 2024	04 Mar 2025	23 Apr 2025	24 Oct 2025
	Equipment Age	10738		13369	14245	
	Equipment UOM	Hours		Hours	Hours	
	Oil Age					
	Make-up Volume					
	Oil Changed	No	Yes	Yes	No	No
	Filter Changed	No	No	Yes	No	No
Lubricant	Contamination Rating	Normal	Normal	Caution	Normal	Caution
	Equipment Rating	Normal	Normal	Alert	Alert	Normal
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	Visc@100C (cSt)	17.2	17.2	17.2	17.2	16.9
	Oxidation (Ab/cm)	0	0	0	0	1
	Water (Vol.%)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	2	2	5	4	2
	Cr (Chromium)	0	1	1	1	0
	Cu (Copper)	11	13	21	20	11
	Fe (Iron)	124	199	727	763	179
	Mo (Molybdenum)	1	0	2	0	1
	Ni (Nickel)	0	0	1	1	0
	Pb (Lead)	0	1	1	0	0
	Sn (Tin)	1	1	0	0	0
Contaminant (ppm)	K (Potassium)	0	0	3	1	1
	Na (Sodium)	0	3	1	1	1
	Si (Silicon)	9	9	15	13	19
Additive (ppm)	B (Boron)	1	2	1	1	3
	Ba (Barium)	0	1	0	0	0
	Ca (Calcium)	3188	3043	3537	2823	3779
	Mg (Magnesium)	12	11	15	12	19
	P (Phosphorus)	875	859	934	796	994
	Zn (Zinc)	966	908	912	716	1105

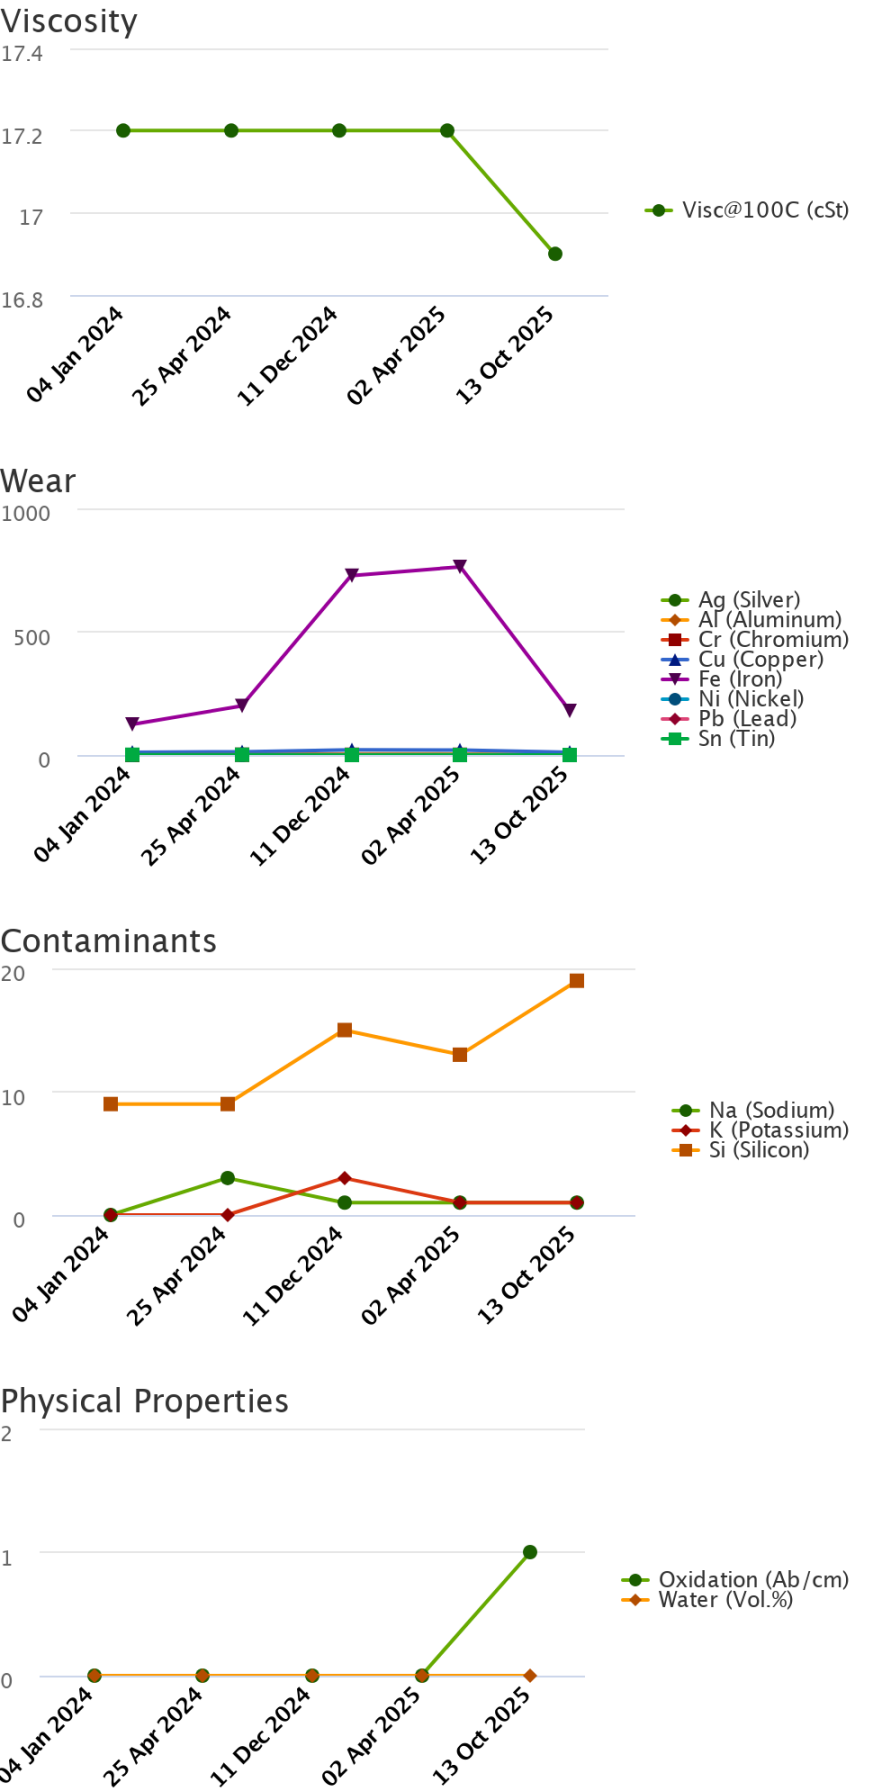

	Caution	
	Unit ID: 1212	Asset ID: 51414378
	Description: right front final drive	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25296320029 Service Level: Essential Bottle ID: a037323315 Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50	Asset Class: Gear Drive Manufacturer: CATERPILLAR Model: Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Continued

Recommendation/Comments

CAUTION - ELEVATED SILICON LEVEL. Determine source of Silicon (Si) and take corrective action. If the silicon level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. If wear metals levels are low, then the silicon likely exists in a non-abrasive form. Possible sources of non-abrasive silicon include: a. Defoamants; b. Sealant compounds. If wear metal levels are elevated, then the silicon likely exists in an abrasive form. Possible sources of abrasive silicon include: a. Abrasive dirt remaining in equipment due to ineffective purification and / or filtration; b. Faulty seals, breather, fill caps; c. Improper sampling techniques that result in dirt contaminating the sample. The oil may be unfit for continued use and should be monitored closely for further condition regressions. Prolonged usage of lubricants with elevated levels of abrasive silicon can cause severe wear and damage to the equipment. Inspect the equipment for signs of excessive wear. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 13 Oct 2025 3:22 PM UTC - Josh Simmons - In Service Oil Sample Comments: Photo: