

MobilTM

Unit ID: 772

Asset ID: 51852116

Description: 980 g right rear final

Alert

Account Information

ID: 402009
Name: Greer Lime
Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US
Parent Account: MATTHEWS LUBRICANTS, INC.

Sample Information


Sample ID: 25286131002
Service Level: Essential
Bottle ID: a037050807
Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Equipment Information

Asset Class: Final Drive
Manufacturer: CATERPILLAR
Model:
Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Alert	Normal	Alert
	Sample ID	24039222076	24330195068	25059439049	25111107047	25286131002
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a030127636	a033565138	a033595170	A035376824	a037050807
	Tested Lubricant	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50
	Sampled	30 Jan 2024	14 Nov 2024	20 Jan 2025	01 Apr 2025	10 Sep 2025
	Reported	12 Feb 2024	26 Nov 2024	04 Mar 2025	22 Apr 2025	15 Oct 2025
	Equipment Age	57117	58702	5399	60106	61231
	Equipment UOM	Hours	Hours	Hours	Hours	Hours
	Oil Age					
	Make-up Volume					
	Oil Changed		No	Yes	Yes	Yes
	Filter Changed		No	Yes	No	Yes
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Alert	Alert	Alert	Normal	Alert
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	Visc@100C (cSt)	17.4	16.7	16.5	16.5	16.7
	Oxidation (Ab/cm)	0	0	0		1
	Water (Vol.%)	NotDetected	NotDetected	NotDetected		NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	7	5	5	3	6
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	93	74	65	35	77
	Fe (Iron)	153	79	92	55	102
	Mo (Molybdenum)	1	1	1	0	0
	Ni (Nickel)	3	2	2	1	3
	Pb (Lead)	1	0	0	0	0
	Sn (Tin)	1	1	1	0	1
Contaminant (ppm)	K (Potassium)	2	1	2	0	0
	Na (Sodium)	1	1	1	1	1
	Si (Silicon)	8	12	10	12	17
Additive (ppm)	B (Boron)	2	1	2	2	2
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	3221	3399	3291	3094	3532
	Mg (Magnesium)	16	15	14	11	14
	P (Phosphorus)	945	977	930	847	1037
	Zn (Zinc)	1056	1030	1062	950	1071

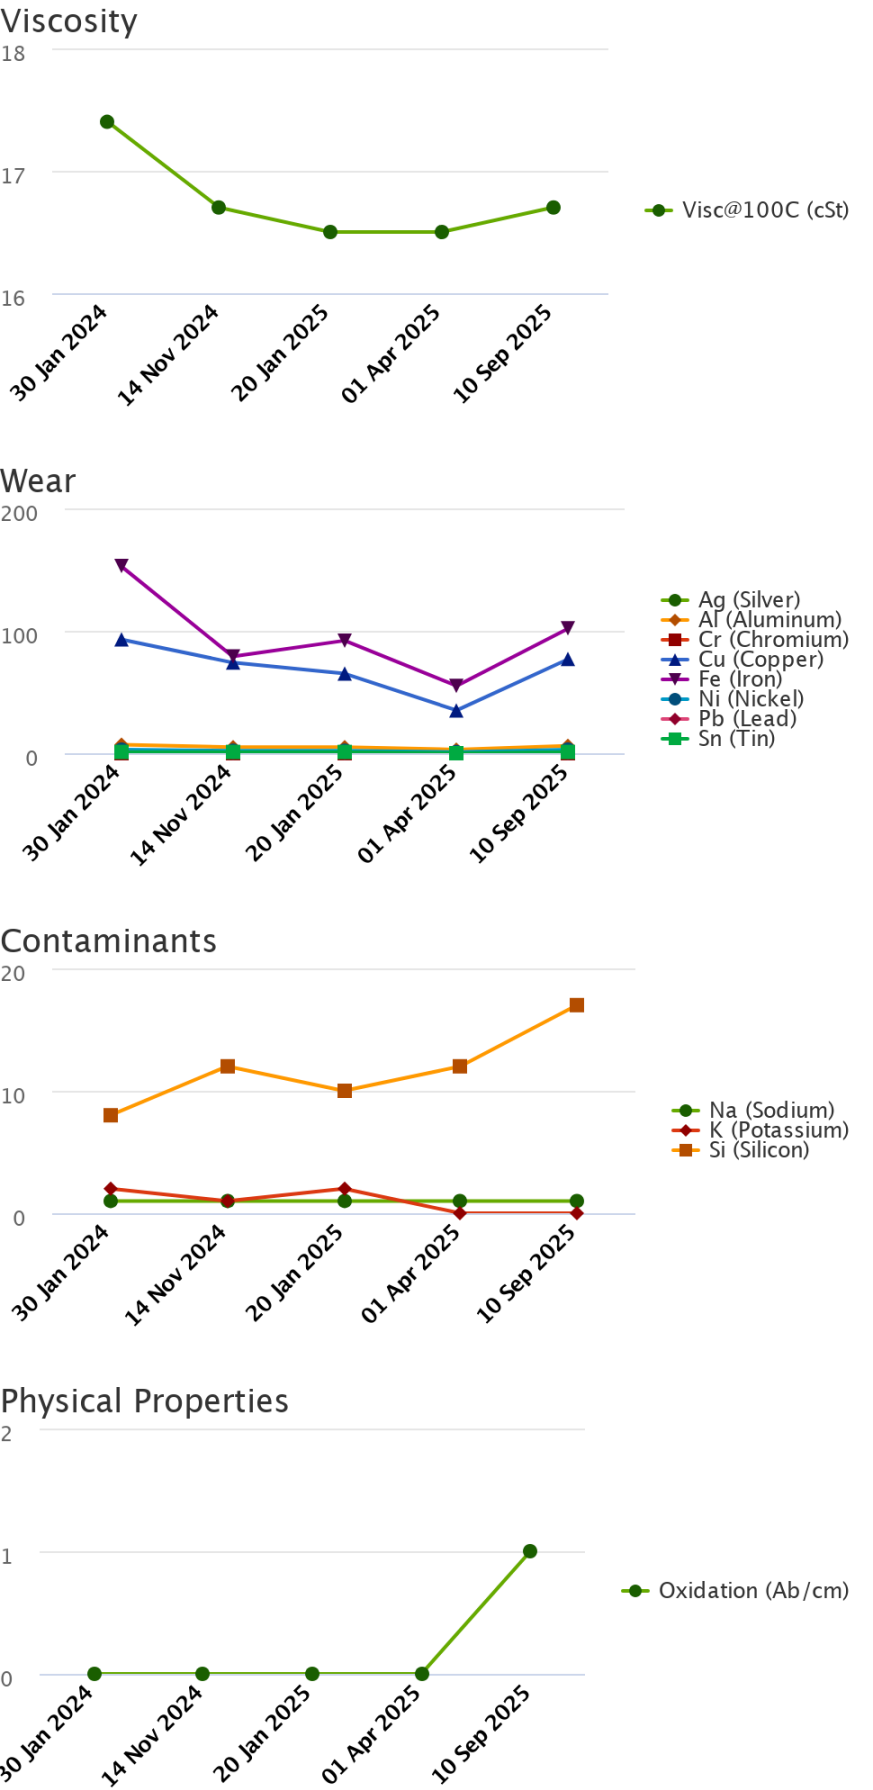

	Alert	
	Unit ID: 772	Asset ID: 51852116
	Description: 980 g right rear final	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25286131002 Service Level: Essential Bottle ID: a037050807 Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50	Asset Class: Final Drive Manufacturer: CATERPILLAR Model: Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Continued

Recommendation/Comments

ACTION REQUIRED - ELEVATED WEAR METALS LEVELS. Determine cause of elevated wear metals levels and take corrective action. If the wear metals levels are elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Because silicon levels are not also elevated, abrasive dirt is not the cause of this condition. Possible causes of elevated wear metals include: a. Worn of oil-wetted parts; b. Contamination from previous fill; c. Over-extended oil service life; d. Normal break-in of new equipment. Continue to closely monitor the equipment and oil for signs of further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 10 Sep 2025 3:22 PM UTC - Josh Simmons - In Service Oil Sample Comments: Photo: