

MobilTM

Unit ID: 772

Asset ID: 51852117

Description: 980 g left rear final

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25286131067

Service Level: Essential

Bottle ID: a037040983

Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Asset Class: Final Drive


Manufacturer: CATERPILLAR

Model:

Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Alert	Normal	Alert
	Sample ID	24039222023	24330195076	25059439046	25111382018	25286131067
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a030135385	a033574438	a033579967	A033681812	a037040983
	Tested Lubricant	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50
	Sampled	30 Jan 2024	29 Oct 2024	20 Jan 2025	01 Apr 2025	10 Sep 2025
	Reported	12 Feb 2024	26 Nov 2024	04 Mar 2025	23 Apr 2025	15 Oct 2025
	Equipment Age	57117	58702	59441	60106	61231
	Equipment UOM	Hours	Hours	Hours	Hours	Hours
	Oil Age					
	Make-up Volume					
	Oil Changed		No	Yes	Yes	Yes
	Filter Changed		No	Yes	No	Yes
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Alert
	Equipment Rating	Alert	Alert	Alert	Normal	Normal
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	Visc@100C (cSt)	17.5	16.7	16.5	16.6	16.7
	Oxidation (Ab/cm)	0	0	0		0
	Water (Vol.%)	NotDetected	NotDetected	NotDetected		NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	1	0
	Al (Aluminum)	6	6	6	3	15
	Cr (Chromium)	0	0	0	0	2
	Cu (Copper)	73	68	80	25	1
	Fe (Iron)	146	92	121	46	482
	Mo (Molybdenum)	1	1	1	0	0
	Ni (Nickel)	2	2	2	1	1
	Pb (Lead)	0	0	0	0	0
	Sn (Tin)	1	1	1	0	0
Contaminant (ppm)	K (Potassium)	2	1	4	0	5
	Na (Sodium)	1	0	1	1	3
	Si (Silicon)	8	12	11	15	109
Additive (ppm)	B (Boron)	2	2	2	4	48
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	3128	3342	3370	3538	205
	Mg (Magnesium)	16	15	13	12	4
	P (Phosphorus)	904	954	923	955	722
	Zn (Zinc)	1032	1005	1076	1093	73

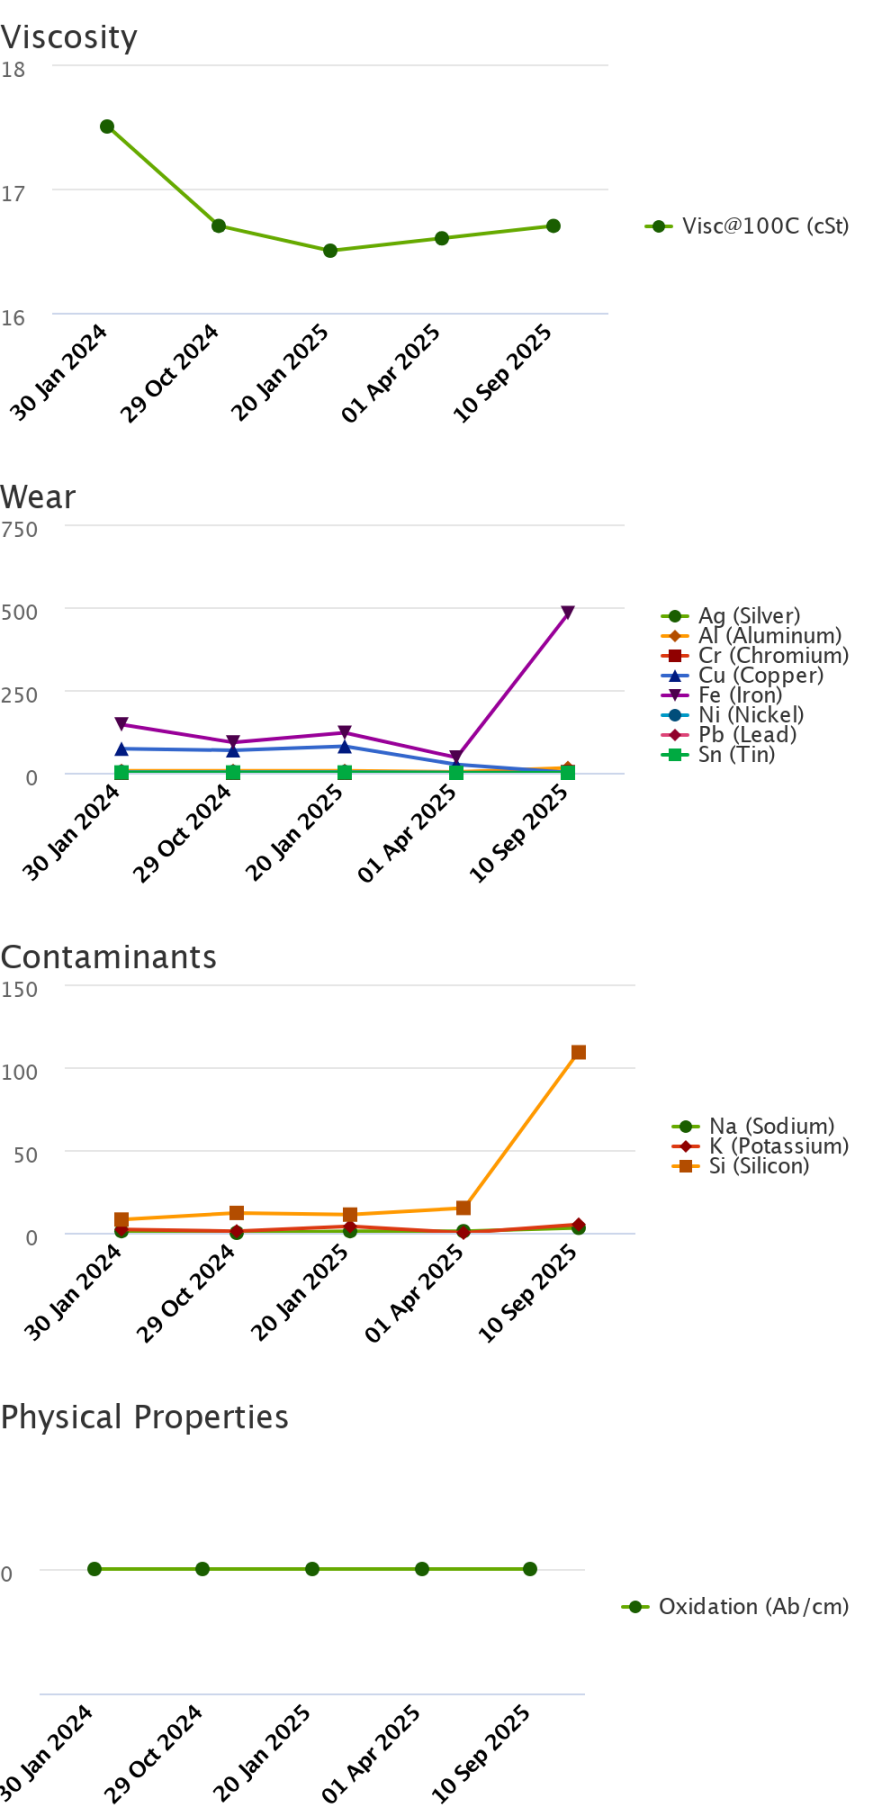

	Alert	
	Unit ID: 772	Asset ID: 51852117
	Description: 980 g left rear final	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25286131067 Service Level: Essential Bottle ID: a037040983 Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50	Asset Class: Final Drive Manufacturer: CATERPILLAR Model: Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Continued

Recommendation/Comments

ACTION REQUIRED - EXCESSIVE SILICON LEVEL. Determine source of excessive Silicon (Si) and take corrective action. Because wear metals levels are not also elevated, the silicon most likely exists in a non-abrasive form. Possible sources of non-abrasive silicone include: a. Defoamants, gasket or sealing compounds; b. Improper sampling / handling procedures (i.e. sample container contaminated with dirt, sample taken under conditions of high wind in a situation where dust is present, sample caps left-off the sample bottles for an extended length of time); c. Engine fuel gas that contains a non-abrasive siloxane. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 10 Sep 2025 3:21 PM UTC - Josh Simmons - In Service Oil Sample Comments: Photo: