

MobilTM

Unit ID: 772

Asset ID: 51852120

Description: 980 g right front final

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25286131062

Service Level: Essential

Bottle ID: a037065828

Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Asset Class: Final Drive


Manufacturer: CATERPILLAR

Model:

Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Sample Data & Trends

Sample Info	Report Status	Normal	Normal	Normal	Caution	Alert
	Sample ID	23264173009	24330385001	25059439066	25111107057	25286131062
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a029576534	a033555134	a033580099	A035378987	a037065828
	Tested Lubricant	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50
	Sampled	31 Aug 2023	29 Oct 2024	20 Jan 2025	01 Apr 2025	10 Sep 2025
	Reported	25 Sep 2023	27 Nov 2024	04 Mar 2025	22 Apr 2025	15 Oct 2025
	Equipment Age	54581	58702	5399	60106	61231
	Equipment UOM	Hours	Hours	Hours	Hours	Hours
	Oil Age					
	Make-up Volume					
	Oil Changed	No	No	Yes	Yes	Yes
	Filter Changed	No	No	Yes	No	Yes
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Alert
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Normal	Normal	Normal	Caution	Normal
	Visc@100C (cSt)	17.6	17.3	17.1		16.8
	Oxidation (Ab/cm)	0	0	0		1
	Water (Vol.%)	NotDetected	NotDetected	NotDetected		NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	2	1	2	1	11
	Cr (Chromium)	0	0	0	0	2
	Cu (Copper)	12	8	6	1	1
	Fe (Iron)	38	27	23	11	148
	Mo (Molybdenum)	1	1	2	0	0
	Ni (Nickel)	0	0	0	0	1
	Pb (Lead)	1	1	0	0	0
	Sn (Tin)	0	2	0	0	0
Contaminant (ppm)	K (Potassium)	0	0	3	0	3
	Na (Sodium)	1	2	1	1	1
	Si (Silicon)	11	11	11	12	45
Additive (ppm)	B (Boron)	2	2	2	1	75
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	3365	3241	3463	3063	132
	Mg (Magnesium)	17	13	13	11	5
	P (Phosphorus)	1104	867	945	844	858
	Zn (Zinc)	1129	999	1108	949	42

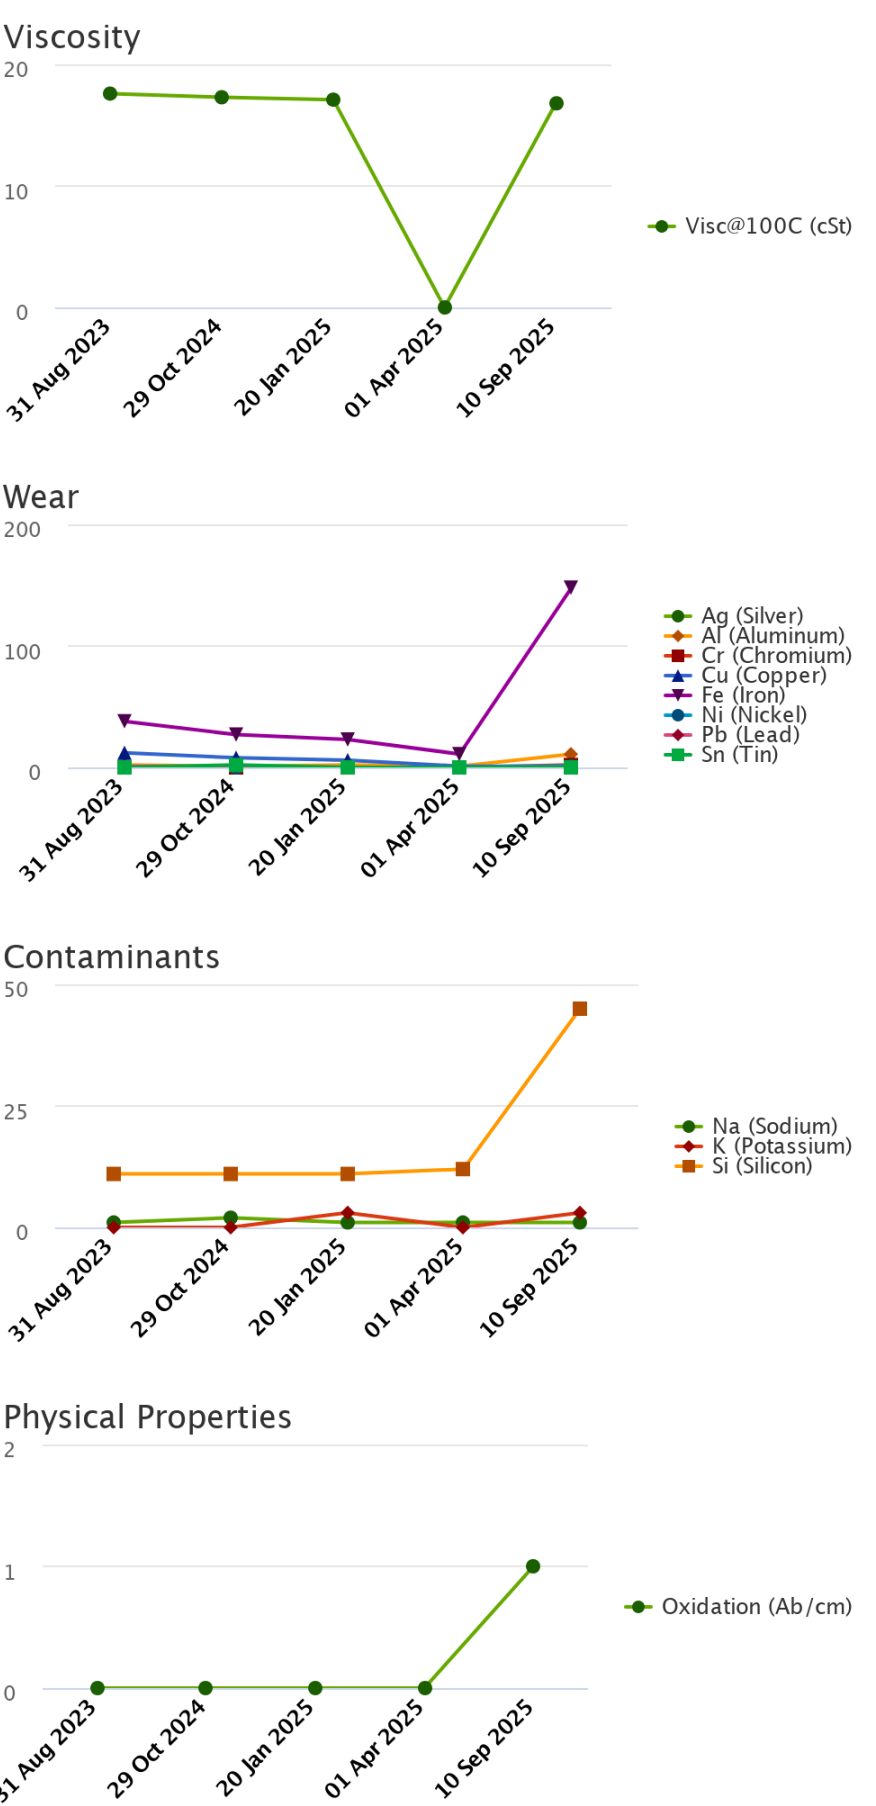

	Alert	
	Unit ID: 772	Asset ID: 51852120
	Description: 980 g right front final	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25286131062 Service Level: Essential Bottle ID: a037065828 Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50	Asset Class: Final Drive Manufacturer: CATERPILLAR Model: Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Continued

Recommendation/Comments

ACTION REQUIRED - EXCESSIVE SILICON LEVEL. Determine source of excessive Silicon (Si) and take corrective action. Because wear metals levels are not also elevated, the silicon most likely exists in a non-abrasive form. Possible sources of non-abrasive silicone include: a. Defoamants, gasket or sealing compounds; b. Improper sampling / handling procedures (i.e. sample container contaminated with dirt, sample taken under conditions of high wind in a situation where dust is present, sample caps left-off the sample bottles for an extended length of time); c. Engine fuel gas that contains a non-abrasive siloxane. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 10 Sep 2025 3:23 PM UTC - Josh Simmons - In Service Oil Sample Comments: Photo: