

MobilTM

Alert

Unit ID: 2-VS-1 Upper

Asset ID: 50254146

Description: 2-VS-1 upper

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25308253043

Service Level: Essential

Bottle ID: a037063066

Tested Lubricant: MOBIL SHC 629

Asset Class: Circulating System


Manufacturer:

Model:

Lubricant: MOBIL SHC 629

Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Alert	Alert	Alert
	Sample ID	25069376060	25154135008	25196140052	25196140053	25308253043
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a003617376	a003622564	a033684957	a033686452	a037063066
	Tested Lubricant	MOBIL SHC 629	MOBIL SHC 629	MOBIL SHC 629	MOBIL SHC 629	MOBIL SHC 629
	Sampled	04 Mar 2025	21 May 2025	23 Jun 2025	23 Jun 2025	28 Oct 2025
	Reported	12 Mar 2025	07 Jun 2025	17 Jul 2025	17 Jul 2025	06 Nov 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Alert	Normal	Normal	Normal	Normal
	Equipment Rating	Alert	Alert	Alert	Alert	Caution
	Lubricant Rating	Caution	Alert	Alert	Alert	Alert
	Visc@40C (cSt)		229.0	222.0	219.8	222.6
	TAN (mg KOH/g)	0.30	0.43	0.35	0.34	0.36
	Water (Hot Plate)	Detected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	1	1	0	0
	Cr (Chromium)	0	0	1	1	0
	Cu (Copper)	8	14	10	10	4
	Fe (Iron)	69	65	73	74	48
	Mo (Molybdenum)	2	2	2	1	1
	Ni (Nickel)	0	0	1	1	0
	Pb (Lead)	1	2	2	1	1
	Sn (Tin)	0	1	0	0	0
Contaminant (ppm)	K (Potassium)	0	1	1	2	0
	Na (Sodium)	0	0	0	0	0
	Si (Silicon)	8	10	12	12	10
	B (Boron)	0	1	0	0	0
Additive (ppm)	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	95	178	41	40	42
	Mg (Magnesium)	1	1	0	2	0
	P (Phosphorus)	435	451	470	479	517
	Zn (Zinc)	10	14	13	12	13

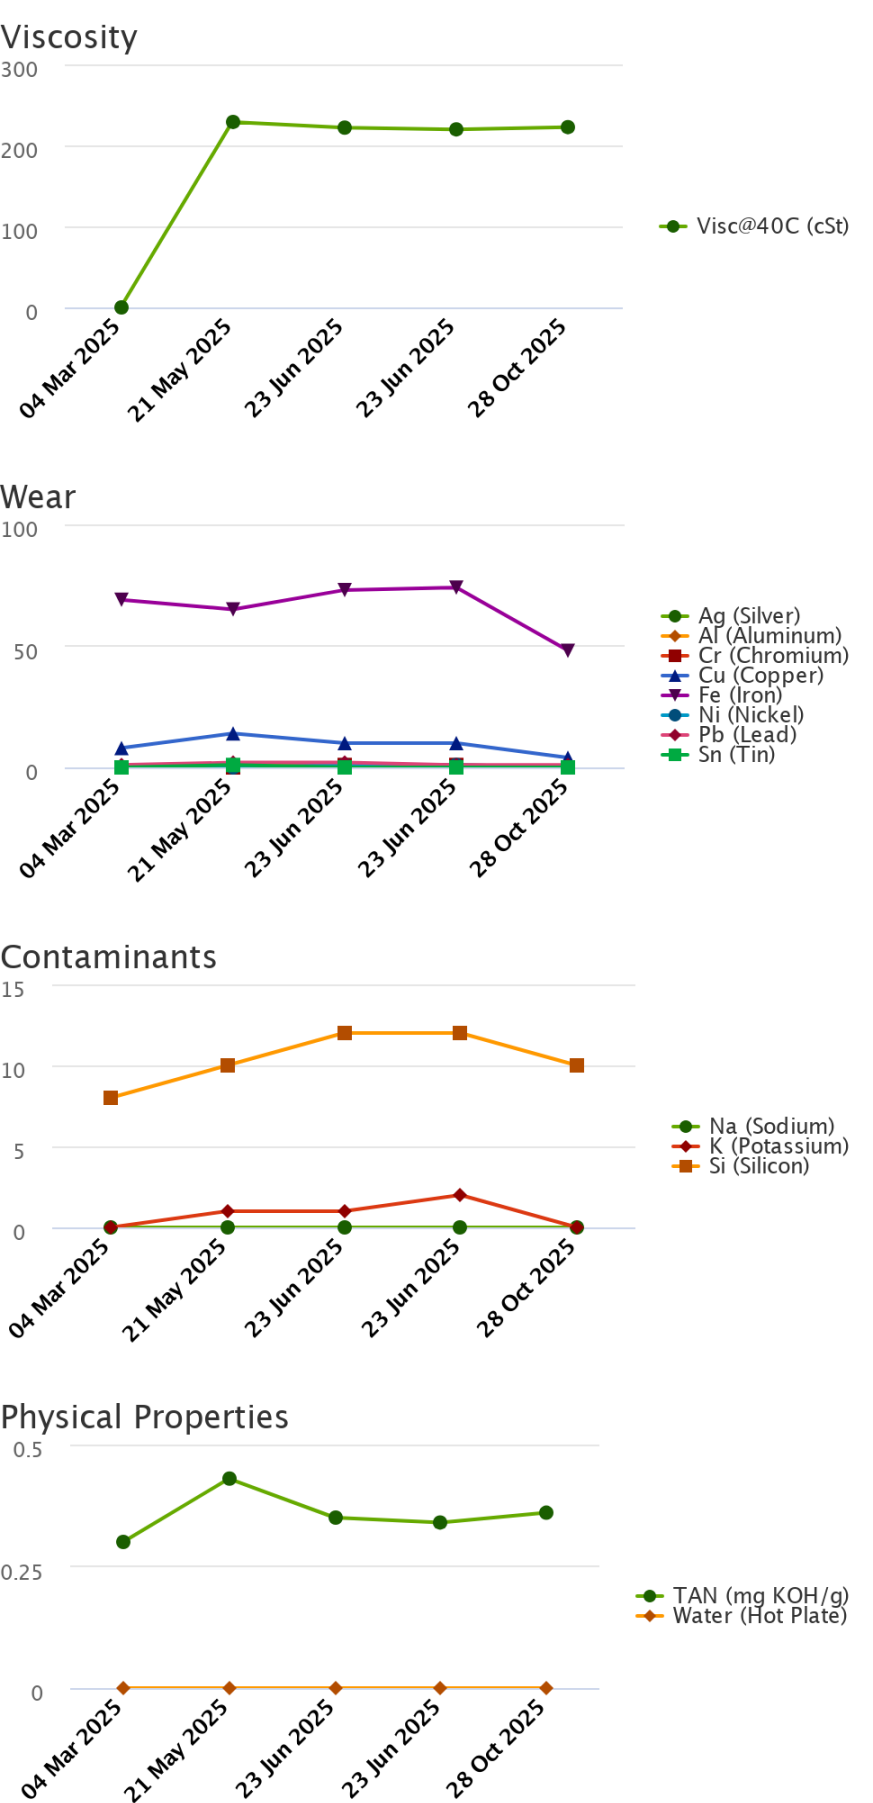

		Alert	
		Unit ID: 2-VS-1 Upper	Asset ID: 50254146
		Description: 2-VS-1 upper	
Account Information		Sample Information	Equipment Information
ID: 402009		Sample ID: 25308253043	Asset Class: Circulating System
Name: Greer Lime		Service Level: Essential	Manufacturer:
Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US		Bottle ID: a037063066	Model:
Parent Account: MATTHEWS LUBRICANTS, INC.		Tested Lubricant: MOBIL SHC 629	Lubricant: MOBIL SHC 629
Continued			
Recommendation/Comments			

ACTION REQUIRED - ELEVATED IRON LEVEL. Determine source of Iron (Fe) and take corrective action. If the iron level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Possible sources of iron include: a. Machinery component wear; b. Metal-to-metal contact; c. Corrosion; d. Abrasive dirt contamination. The oil may be unfit for continued use and should be closely monitored for further condition regressions. Inspect the equipment for signs of damage. Change the oil after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - ELEVATED OIL VISCOSITY. Determine cause of elevated oil viscosity and take corrective action. Elevated viscosities can interfere with the cooling process of components and restrict oil flow causing oil starvation and component wear. Possible causes of elevated viscosity include: a. Contact with oil that has a higher viscosity; b. High rates of oxidation and oil degradation; c. Excessive sediment; d. Coolant contamination. A partial drain and refill with fresh oil may rejuvenate the oil condition. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 28 Oct 2025 9:49 PM UTC - Brad Roy - In Service Oil Sample Comments: Photo: