

Mobil™

Alert

Unit ID: 7-BL-1 Non-drive

Asset ID: 50142889

Description: 7-BL-1 Blower

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25308253044

Service Level: Essential

Bottle ID: a003622867

Tested Lubricant: MOBIL SHC 629

Asset Class: Compressor





Manufacturer:

Model:

Lubricant: MOBIL SHC 629

Sample Data & Trends

|                   |                      |               |               |               |               |               |
|-------------------|----------------------|---------------|---------------|---------------|---------------|---------------|
| Sample Info       | Report Status        | Normal        | Alert         | Alert         | Caution       | Alert         |
|                   | Sample ID            | 17303475059   | 18137162011   | 18348235035   | 23321203010   | 25308253044   |
|                   | Service Level        | Essential     | Essential     | Essential     | Essential     | Essential     |
|                   | Bottle ID            | a004697642    | a003968504    | a004701879    | a026529531    | a003622867    |
|                   | Tested Lubricant     | MOBIL SHC 629 | MOBIL SHC 629 | MOBIL SHC 629 | MOBIL SHC 629 | MOBIL SHC 629 |
|                   | Sampled              | 24 Oct 2017   | 23 Apr 2018   | 11 Dec 2018   | 09 Nov 2023   | 22 Oct 2025   |
|                   | Reported             | 01 Nov 2017   | 19 May 2018   | 18 Dec 2018   | 22 Nov 2023   | 06 Nov 2025   |
|                   | Equipment Age        |               |               |               |               |               |
|                   | Oil Age              |               |               |               |               |               |
|                   | Make-up Volume       |               |               |               |               |               |
|                   | Oil Changed          |               |               |               |               |               |
|                   | Filter Changed       |               |               |               |               |               |
| Lubricant         | Contamination Rating | Normal        | Normal        | Alert         | Normal        | Normal        |
|                   | Equipment Rating     | Normal        | Normal        | Normal        | Normal        | Caution       |
|                   | Lubricant Rating     | Normal        | Alert         | Alert         | Caution       | Alert         |
|                   | Visc@40C (cSt)       | 151.4         | 205.8         | 187.8         |               | 260.3         |
|                   | TAN (mg KOH/g)       | 0.40          | 0.61          | 0.52          |               | 0.94          |
|                   | Water (Hot Plate)    | NotDetected   | NotDetected   | NotDetected   | NotDetected   | NotDetected   |
|                   | Coolant Indicator    | NotDetected   | NotDetected   | NotDetected   | NotDetected   | NotDetected   |
| Wear (ppm)        | Ag (Silver)          |               |               |               | 0             | 0             |
|                   | Al (Aluminum)        | 0             | 0             | 0             | 2             | 2             |
|                   | Cr (Chromium)        | 0             | 0             | 0             | 0             | 0             |
|                   | Cu (Copper)          | 0             | 2             | 0             | 2             | 2             |
|                   | Fe (Iron)            | 0             | 38            | 34            | 28            | 45            |
|                   | Mo (Molybdenum)      | 0             | 0             | 0             | 0             | 0             |
|                   | Ni (Nickel)          | 0             | 0             | 0             | 0             | 0             |
|                   | Pb (Lead)            | 0             | 0             | 1             | 1             | 0             |
|                   | Sn (Tin)             | 0             | 0             | 0             | 0             | 0             |
| Contaminant (ppm) | K (Potassium)        | 0             | 1             | 0             | 1             | 1             |
|                   | Na (Sodium)          | 0             | 0             | 1             | 4             | 4             |
|                   | Si (Silicon)         | 10            | 14            | 47            | 10            | 9             |
| Additive (ppm)    | B (Boron)            | 0             | 10            | 8             | 5             | 5             |
|                   | Ba (Barium)          | 0             | 0             | 0             | 3             | 4             |
|                   | Ca (Calcium)         | 1             | 8             | 25            | 6             | 6             |
|                   | Mg (Magnesium)       | 0             | 1             | 1             | 4             | 4             |
|                   | P (Phosphorus)       | 1599          | 311           | 708           | 575           | 581           |
|                   | Zn (Zinc)            | 0             | 15            | 10            | 9             | 9             |

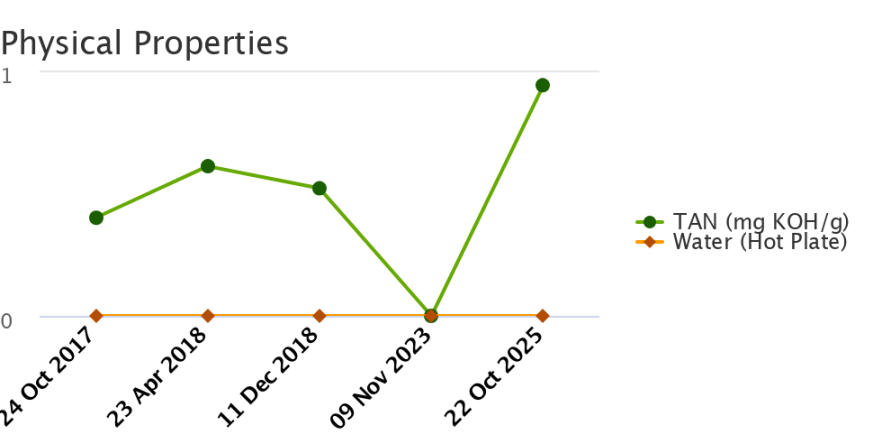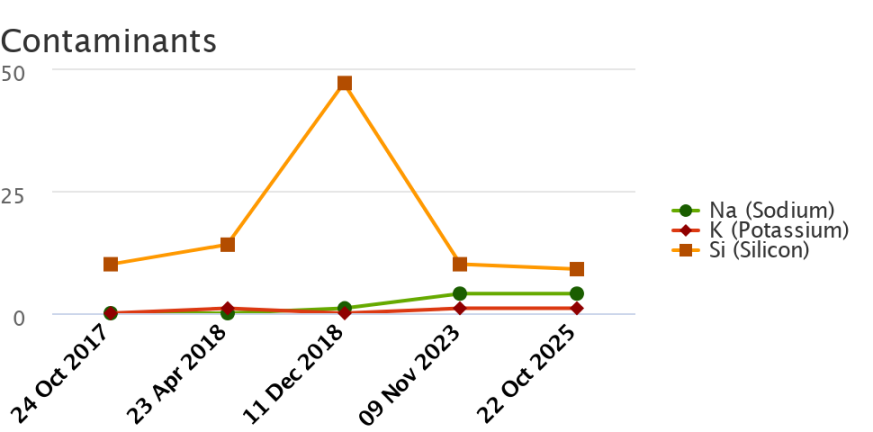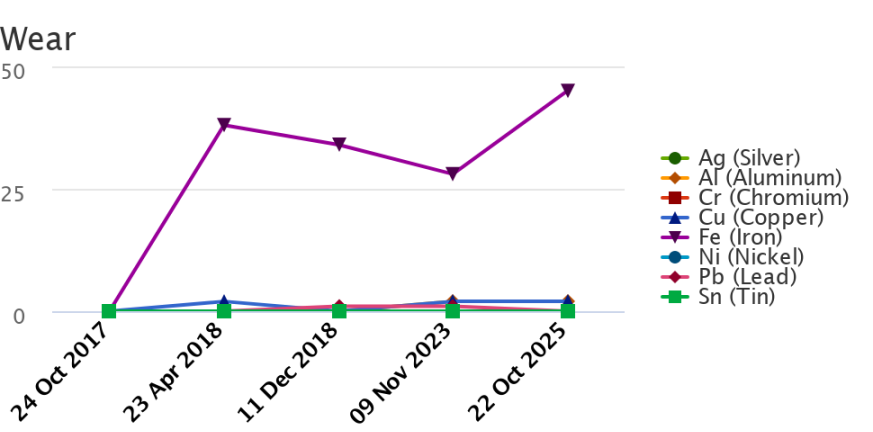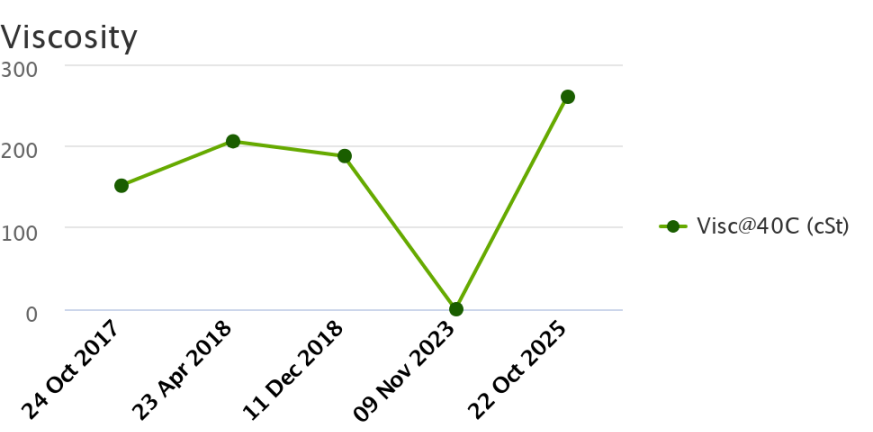



Alert

Unit ID: 7-BL-1 Non-driveAsset ID: 50142889

Description: 7-BL-1 Blower

| Account Information                                                                                                                                    | Sample Information                                                                                             | Equipment Information                                                          |
|--------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------|
| ID: 402009<br>Name: Greer Lime<br>Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US<br>Parent Account: MATTHEWS LUBRICANTS, INC. | Sample ID: 25308253044<br>Service Level: Essential<br>Bottle ID: a003622867<br>Tested Lubricant: MOBIL SHC 629 | Asset Class: Compressor<br>Manufacturer:<br>Model:<br>Lubricant: MOBIL SHC 629 |

Continued

Recommendation/Comments

CAUTION - BORDERLINE OIL CONDITION. Test results indicate that the condition of this oil sample is borderline with respect to test limits. If the levels are borderline for the first time with no trend history, then resample immediately to confirm condition. Closely monitor the oil for further condition regressions. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - ELEVATED OIL VISCOSITY. Determine cause of elevated oil viscosity and take corrective action. Elevated viscosities can interfere with the cooling process of components and restrict oil flow causing oil starvation and component wear. Possible causes of elevated viscosity include: a. Contact with oil that has a higher viscosity; b. High rates of oxidation and oil degradation; c. Excessive sediment; d. Coolant contamination. A partial drain and refill with fresh oil may rejuvenate the oil condition. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

ACTION REQUIRED - UNSATISFACTORY OIL CONDITION. Test results indicate that the condition of this oil sample is unsatisfactory. The oil may be unfit for continued use and should be closely monitored further condition regressions. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 22 Oct 2025 9:27 PM UTC - Brad Roy - In Service Oil Sample    Comments: Photo: