

Mobil<sup>TM</sup>

Alert

Unit ID: 7-BL-20Asset ID: 50142890

Description: 7-BL-20 Blower

Account Information

Sample Information

Equipment Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25308280030

Service Level: Essential

Bottle ID: a003622468

Tested Lubricant: MOBIL SHC 630

Asset Class: Compressor





Manufacturer:

Model:

Lubricant: MOBIL SHC 630

Sample Data & Trends

|                   |                      |               |               |               |               |               |
|-------------------|----------------------|---------------|---------------|---------------|---------------|---------------|
| Sample Info       | Report Status        | Alert         | Caution       | Normal        | Normal        | Alert         |
|                   | Sample ID            | 18348230034   | 23321341010   | 24068404074   | 25112454007   | 25308280030   |
|                   | Service Level        | Essential     | Essential     | Essential     | Essential     | Essential     |
|                   | Bottle ID            | a004759793    | a026563462    | a030135877    | a003618741    | a003622468    |
|                   | Tested Lubricant     | MOBIL SHC 630 | MOBIL SHC 630 | MOBIL SHC 630 | MOBIL SHC 630 | MOBIL SHC 630 |
|                   | Sampled              | 11 Dec 2018   | 09 Nov 2023   | 28 Feb 2024   | 24 Mar 2025   | 22 Oct 2025   |
|                   | Reported             | 19 Dec 2018   | 21 Nov 2023   | 15 Mar 2024   | 24 Apr 2025   | 06 Nov 2025   |
|                   | Equipment Age        |               |               |               |               |               |
|                   | Oil Age              |               |               |               |               |               |
|                   | Make-up Volume       |               |               |               |               |               |
|                   | Oil Changed          |               |               |               |               |               |
|                   | Filter Changed       |               |               |               |               |               |
| Lubricant         | Contamination Rating | Normal        | Normal        | Normal        | Normal        | Alert         |
|                   | Equipment Rating     | Caution       | Caution       | Normal        | Normal        | Normal        |
|                   | Lubricant Rating     | Alert         | Normal        | Normal        | Normal        | Normal        |
|                   | Visc@40C (cSt)       | 256.1         | 216.7         | 227.2         | 227.5         | 226.8         |
|                   | TAN (mg KOH/g)       | 0.53          | 1.10          | 0.35          | 0.25          | 0.43          |
|                   | Water (Hot Plate)    | NotDetected   | NotDetected   | NotDetected   | NotDetected   | Detected      |
|                   | Coolant Indicator    | NotDetected   | NotDetected   | NotDetected   | NotDetected   | NotDetected   |
| Wear (ppm)        | Ag (Silver)          |               | 0             | 0             | 0             | 0             |
|                   | Al (Aluminum)        | 2             | 7             | 2             | 1             | 0             |
|                   | Cr (Chromium)        | 0             | 0             | 0             | 0             | 0             |
|                   | Cu (Copper)          | 0             | 1             | 0             | 1             | 0             |
|                   | Fe (Iron)            | 41            | 48            | 9             | 5             | 2             |
|                   | Mo (Molybdenum)      | 0             | 0             | 0             | 0             | 0             |
|                   | Ni (Nickel)          | 0             | 0             | 0             | 0             | 0             |
|                   | Pb (Lead)            | 0             | 0             | 0             | 0             | 0             |
|                   | Sn (Tin)             | 0             | 0             | 0             | 0             | 2             |
| Contaminant (ppm) | K (Potassium)        | 0             | 0             | 2             | 1             | 0             |
|                   | Na (Sodium)          | 1             | 1             | 0             | 1             | 1             |
|                   | Si (Silicon)         | 7             | 11            | 1             | 2             | 1             |
| Additive (ppm)    | B (Boron)            | 11            | 14            | 3             | 1             | 2             |
|                   | Ba (Barium)          | 0             | 1             | 1             | 0             | 0             |
|                   | Ca (Calcium)         | 51            | 16            | 6             | 4             | 7             |
|                   | Mg (Magnesium)       | 30            | 14            | 53            | 17            | 44            |
|                   | P (Phosphorus)       | 494           | 546           | 108           | 77            | 24            |
|                   | Zn (Zinc)            | 16            | 23            | 5             | 2             | 10            |

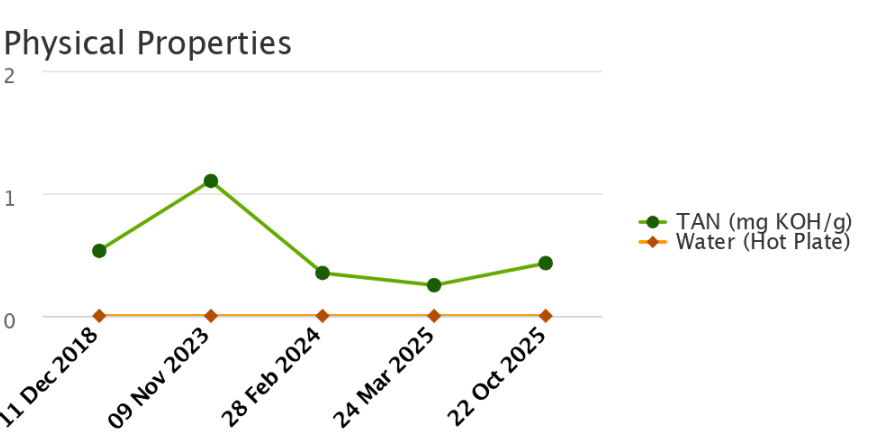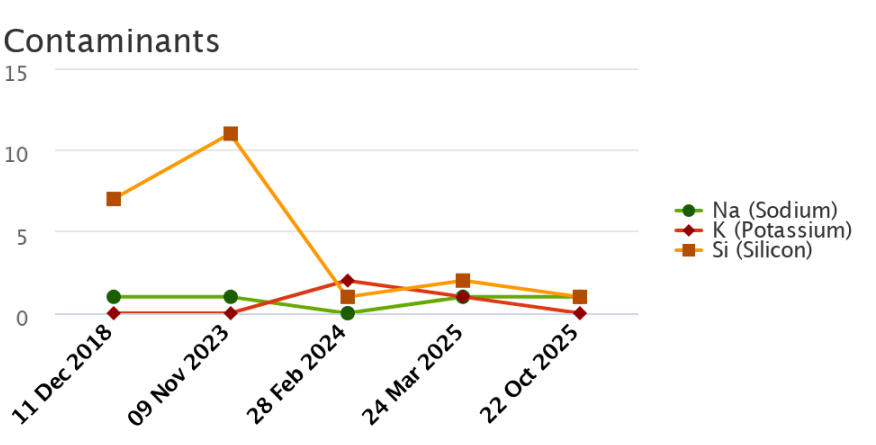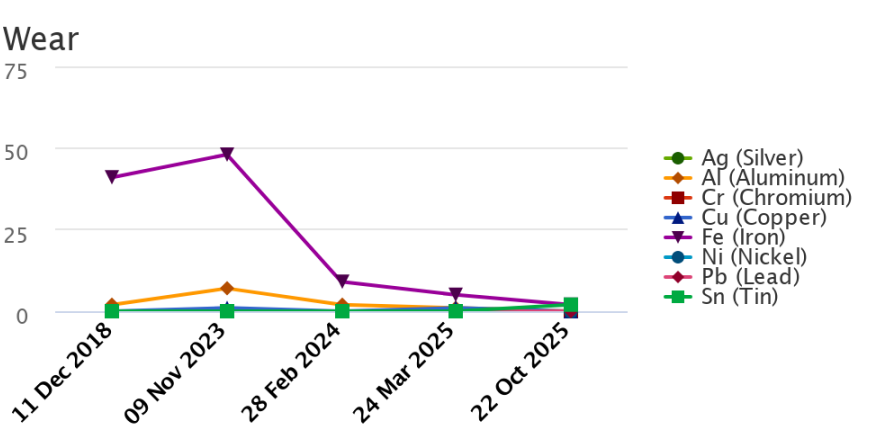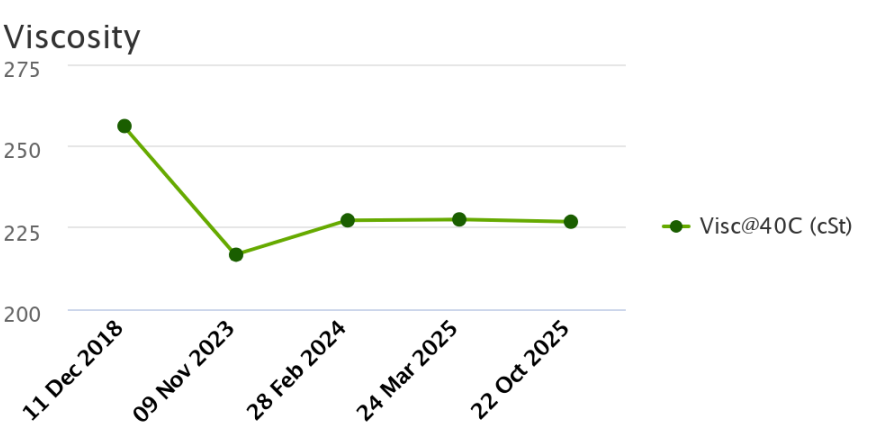

|  | Alert                                            |                          |
|---------------------------------------------------------------------------------|--------------------------------------------------|--------------------------|
|                                                                                 | Unit ID: 7-BL-20 <span>Asset ID: 50142890</span> |                          |
|                                                                                 | Description: 7-BL-20 Blower                      |                          |
| Account Information                                                             | Sample Information                               | Equipment Information    |
| ID: 402009                                                                      | Sample ID: 25308280030                           | Asset Class: Compressor  |
| Name: Greer Lime                                                                | Service Level: Essential                         | Manufacturer:            |
| Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US         | Bottle ID: a003622468                            | Model:                   |
| Parent Account: MATTHEWS LUBRICANTS, INC.                                       | Tested Lubricant: MOBIL SHC 630                  | Lubricant: MOBIL SHC 630 |
| Continued                                                                       |                                                  |                          |
| Recommendation/Comments                                                         |                                                  |                          |

ACTION REQUIRED - EXCESSIVE WATER CONTAMINATION. Determine source of water and take corrective action. Analyze the oil with an on-site water test if accessible. Possible sources of water include: a. Leaking seals; b. Condensation resulting from low operating temperatures or prolonged shutdowns; c. Compromised oil cooler; d. Direct exposure to atmosphere as a result of compromises to system components (i.e. improperly sealed tank fill access point). Remove water from oil using centrifuges or dehydration units, or drain the oil and recharge the system with new oil. Resample the system after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 22 Oct 2025 9:27 PM UTC - Brad Roy - In Service Oil Sample    Comments:    Photo: