

# Intelligent Infrared Carbon Dioxide Module (Model: MH-Z14)

User's Manual

Zhengzhou Winsen Electronics Technology CO., LTD.

# **Statement**

The copyright of this manual belongs to Zhengzhou Winsen Electronics Technology Co., LTD. Without the written permission, any part of this manual shall not be copied, translated, stored in database or retrieval system, also can't spread through electronic, copying, record ways.

Thanks for purchasing our product. In order to enable customers to better use the product and reduce the faults caused by misuse, please read the manual carefully and operate it correctly in accordance with the instructions. If users disobey the terms or remove, disassemble, change the components inside of the sensor, we shall not be responsible for the loss.

The specific such as color, appearance, sizes ...etc., please in kind prevail.


We are devoting ourselves to products development and technical innovation, so we reserve the right to improve the products without notice. Please confirm it is the valid version before using this manual. At the same time, users' comments on optimized using way are welcome.

Please keep the manual properly, in order to get help if you have questions during the usage in the future.

Zhengzhou Winsen Electronics Technology CO., LTD

# MH-Z14 NDIR CO2 Module

### 1. Profile

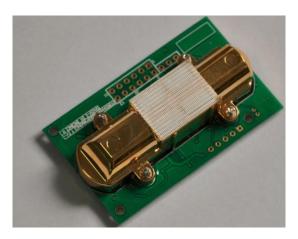

MH-Z14 NDIR Infrared gas module is a common type, small size sensor, using non-dispersive infrared (NDIR) principle to detect the existence of  $CO_2$  in the air, with good selectivity, non-oxygen dependent and long life. Built-in temperature sensor can do temperature compensation; and it has digital output and analog voltage output. This commons type infrared gas sensor is developed by the tight integration of mature infrared absorbing gas detection technology, Precision optical circuit design and superior circuit design.

Its design, production and inspection adhere to below: GB/T13384-92

# 2. Applications:

MH-Z14 NDIR Infrared gas module is applied in the HVAC, indoor air quality monitoring, industrial process, safety and protection monitoring, agriculture and animal husbandry production process monitoring.

# 3. Main functions and features:

- High sensitivity, High resolution
- Low power consumption
- Output modes: UART, analog voltage signal, PWM wave
- Quick response
- Temperature compensation, excellent linear output
- Good stability
- Long lifespan
- Anti-water vapor interference
- No poisoning




# 4. Main technical parameters

| Working voltage     | 4.5 V ~ 5.5V DC       |  |  |  |  |
|---------------------|-----------------------|--|--|--|--|
| Average current     | < 85 mA               |  |  |  |  |
| Interface level     | 3.3 V                 |  |  |  |  |
| Measuring range     | 0~5%VOL optional      |  |  |  |  |
|                     | PWM                   |  |  |  |  |
| Output signal       | UART                  |  |  |  |  |
|                     | 0.4-2V DC             |  |  |  |  |
| Preheat time        | 3min                  |  |  |  |  |
| Response Time       | T <sub>90</sub> < 90s |  |  |  |  |
| Working temperature | 0℃~50℃                |  |  |  |  |
| Working humidity    | 0~95%RH               |  |  |  |  |
| Weight              | 15 g                  |  |  |  |  |
| Lifespan            | >5 year               |  |  |  |  |
| Dimension           | 57.5×34.7×16mm(L×W×H) |  |  |  |  |

| Target Gas     | Measuring Range | Accuracy   | Mark         |
|----------------|-----------------|------------|--------------|
| Carbon Dioxide | 0~2000ppm       |            | Temperature  |
|                | υ 2000μμπ       |            | compensation |
|                | 0~5000ppm       |            | Temperature  |
|                | о зооорріїї     | ±(50ppm    | compensation |
|                | 0∼1%VOL         | +5%reading | Temperature  |
| (CO2)          | U 1%VOL         | value)     | compensation |
|                | 0~3%VOL         |            | Temperature  |
|                | U 3%VOL         |            | compensation |
|                | 0~5%VOL         |            | Temperature  |
|                | U 5%VUL         |            | compensation |


# 5. Structure

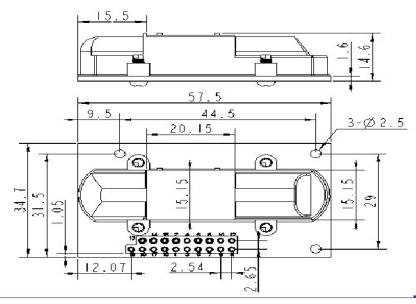

Tel: 86-371-67169097/67169670 Fax: 86-371-60932988 Email: <a href="mailto:sales@winsensor.com">sales@winsensor.com</a>





# 6. Definition for pins

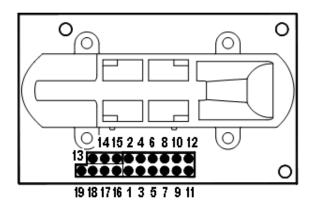

| PIN                    | Description                            |  |  |  |
|------------------------|--|--|--|--|
| Pad1/Pad15/Pad17       | Vin(input voltage 4.5V∼5.5V)           |  |  |  |
| Pad2/Pad3/ Pad12/Pad16 | GND                                    |  |  |  |
| Pad4                   | Vout2 (0.4∼2V)                         |  |  |  |
| Pad5                   | Vout1 (0∼2.5V)                         |  |  |  |
| Pad6                   | PWM                                    |  |  |  |
| Pad8                   | HD                                     |  |  |  |
| Pad7/Pad9              | NC                                     |  |  |  |
| Pad11/Pad14/Pad18      | UART (RXD) $0\sim3.3$ V input digital  |  |  |  |
| Pad10/Pad13/Pad19      | UART (TXD) $0\sim$ 3.3V output digital |  |  |  |

# 7. Circuit

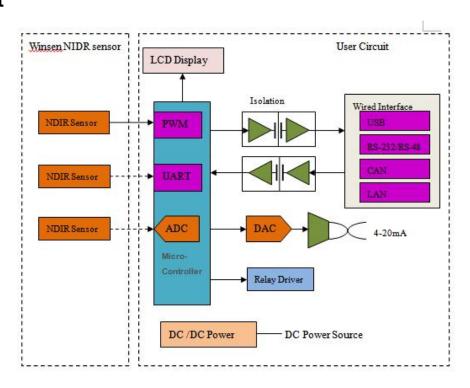

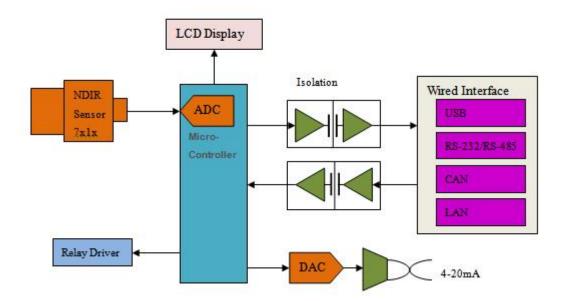

# 8. Operating instruction

### 8.1 Analog output connections

The output value of Vout1 is 0-2.5V, which stands for 0 to full range.


The output value of Vout2 is 0.4-2V, which stands for 0 to full range.

Vin -5V

**GND-Power Ground** 

Vout2-ADC input

After preheating, the value of output voltage from Vout2 represents gas concentration.

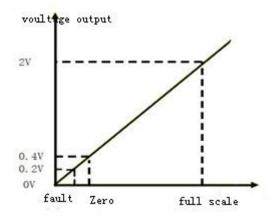

# 8.2 PWM output (taking PWM output from 2000ppm as example):

CO2 output range: 0ppm-2000ppm Cycle:  $1004ms \pm 5\%$  High level output for beginning: 2ms (in name) Middle of cycle:  $1000ms \pm 5\%$ 

Tel: 86-371-67169097/67169670 Fax: 86-371-60932988 Email: <u>sales@winsensor.com</u>



Low level output for ending:

2ms (in name)

Account formula for CO2 concentration which gets through PWM:


$$C_{ppm} = 2000 \times (T_H - 2ms)/(T_H + T_L - 4ms)$$

Among:

 $C_{\it ppm}$  is calculated CO2 concentration, unit is ppm;

 $T_{\!\scriptscriptstyle H}$  is time for high level during an output cycle;

 $T_{\scriptscriptstyle L}$  is time for low level during an output cycle.

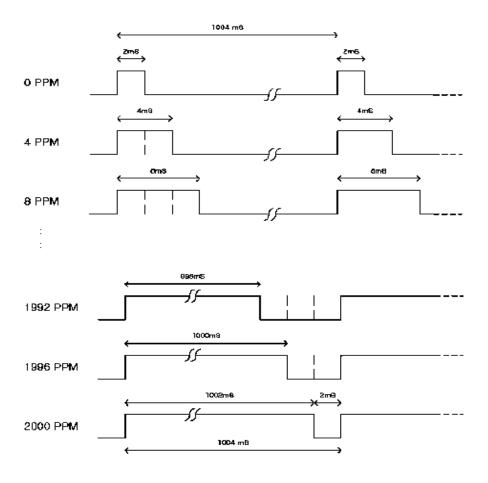

# 8.3 Digital connects:

Vin-5V power

**GND-Power Ground** 

RXD connect sensor TXD

TXD connect sensor RXD

You can read gas concentration via Uart, no need to calculate.



# **8.3.1 Communication protocol**

# 1. General Settings

| Baud rate      | 9600   |
|----------------|--------|
| Date byte      | 8 byte |
| Stop byte      | 1byte  |
| Calibrate byte | no     |

### 2. Command

Each command or return:

Contains 9 bytes (byte 0 ~ 8)

Starting byte fixed 0 XFF

Command contains sensor number (factory default to 0 x01) to check and end

### **Command List:**

| 0x86 | Gas concentration           |
|------|-----------------------------|
| 0x87 | Calibrate zero point (ZERO) |
| 0x88 | Calibrate span point (SPAN) |

### Read gas concentration

| a Bas co | TICCIICI GC  | 011    |       |       |       |       |       |       |  |
|----------|--------------|--------|-------|-------|-------|-------|-------|-------|--|
|          | Send command |        |       |       |       |       |       |       |  |
| Byte0    | Byte1        | Byte2  | Byte3 | Byte4 | Byte5 | Byte6 | Byte7 | Byte8 |  |
| Startin  | Sensor       | comman | -     | -     | -     | -     | -     | Check |  |
| g byte   | No.          | d      |       |       |       |       |       | value |  |
|          |              |        |       |       |       |       |       |       |  |
| OXFF     | 0x01         | 0x86   | 0x00  | 0x00  | 0x00  | 0x00  | 0x00  | 0x79  |  |

### **Return value**

|        | Return |            |           |       |       |       |       |       |
|--------|--------|------------|-----------|-------|-------|-------|-------|-------|
| Byte0  | Byte1  | Byte2      | Byte3     | Byte4 | Byte5 | Byte6 | Byte7 | Byte8 |
| Starti | comman | High level | Low level | -     | -     | -     | -     | Chec  |
| ng     | d      | concentra  | concentra |       |       |       |       | k     |
| byte   |        | tion       | tion      |       |       |       |       | value |
| 0XFF   | 0x86   | 0x02       | 0x60      | 0x47  | 0x00  | 0x00  | 0x00  | 0xD1  |

# Gas concentration= high level \*256+low level

### Calibrate zero point

|        | Send command |        |       |       |       |       |       |       |  |  |
|--------|--------------|--------|-------|-------|-------|-------|-------|-------|--|--|
| Byte0  | Byte1        | Byte2  | Byte3 | Byte4 | Byte5 | Byte6 | Byte7 | Byte8 |  |  |
| Starti | Sensor       | comman | -     | -     | -     | -     | -     | Check |  |  |
| ng     | No.          | d      |       |       |       |       |       | value |  |  |
| byte   |              |        |       |       |       |       |       |       |  |  |
| 0XFF   | 0x01         | 0x87   | 0x00  | 0x00  | 0x00  | 0x00  | 0x00  | 0x78  |  |  |

Tel: 86-371-67169097/67169670 Fax: 86-371-60932988 Email: sales@winsensor.com



### No return value

# Calibrate span point

|        | Send command |        |            |           |       |       |       |       |  |
|--------|--------------|--------|------------|-----------|-------|-------|-------|-------|--|
| Byte0  | Byte1        | Byte2  | Byte3      | Byte4     | Byte5 | Byte6 | Byte7 | Byte8 |  |
| Starti | Sensor       | comman | High level | Low level | -     | -     | -     | Check |  |
| ng     | No.          | d      | span       | span      |       |       |       | value |  |
| byte   |              |        | point      | point     |       |       |       |       |  |
| 0XFF   | 0x01         | 0x88   | 0x07       | 0xD0      | 0x00  | 0x00  | 0x00  | 0xA0  |  |

### No return value

### 3. Calibration and calculation

The checksum = (invert (byte 1 + ... + 7)) + 1

### Reading gas concentration:

| <u> </u> |              |        |       |       |       |       |       |       |  |  |
|----------|--------------|--------|-------|-------|-------|-------|-------|-------|--|--|
|          | Send command |        |       |       |       |       |       |       |  |  |
| Byte0    | Byte1        | Byte2  | Byte3 | Byte4 | Byte5 | Byte6 | Byte7 | Byte8 |  |  |
| Starti   | Sensor       | comman | -     | -     | -     | -     | -     | Check |  |  |
| ng       | No.          | d      |       |       |       |       |       | value |  |  |
| byte     |              |        |       |       |       |       |       |       |  |  |
| 0XFF     | 0x01         | 0x86   | 0x00  | 0x00  | 0x00  | 0x00  | 0x00  | 0x79  |  |  |

# Except byte 0, add the other bytes together

```
0x1 + 0x86 + 0 + 0 + 0 + 0 + 0 = 0x87
```

Get the value from the first step, and then invert it.

0xff - 0x87 = 0x78

### The second value plus one

0x78 + 0x01 = 0x79

# Program: Clanguage

```
char getCheckSum(char *packet)
{
    char i, checksum;
    for( i = 1; i < 8; i++)
    {
        checksum += packet[i];
    }
    checksum = 0xff - checksum;
    checksum += 1;
    return checksum;
}</pre>
```

# 9. Notes for maintenance

- 9.1 The sensor should be calibrated regularly. The cycle time is better to be no more than 6 months.
- 9.2 Do not use the sensor in the high dusty environment for long time.
- 9.3 Please use the sensor with correct power supply.
- 9.4 Forbidden to cut the sensor pin.

Zhengzhou Winsen Electronics Technology Co., Ltd

Add: No.299, Jinsuo Road, National Hi-Tech Zone,

Zhengzhou 450001 China **Tel:** +86-371-67169097/67169670

**Fax:** +86-371-60932988

E-mail: sales@winsensor.com
Website: www.winsen-sensor.com