


Mounting Hardware³

SVA05 SERIES ISOLATION VALVE ASSEMBLY FOR INSERTION METERS⁴

(for Low Pressure SVA05 see page 39)

Used for pressures to 650 psig¹ (shown for use with ½" diameter insertion meters). 150# or 300# flanged mounting is optionally available. Available sizes are ½" x ¾" NPT (SVA05 shown), and ¾" x 1" NPT for use with ¾" diameter insertion meters (SVA07).

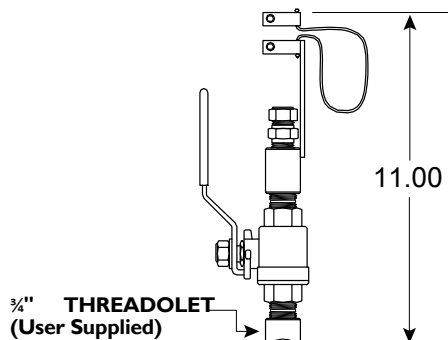


NOTE: User needs to weld a 3/4" female threadolet (of appropriate radius) to mate with existing pipe after a 3/4" hole has been drilled in pipe. The 3/4" Male Coupling of the SMC Isolation Valve Assembly will thread into the user's 3/4" threadolet.

PROBE LENGTH (with sensor)	SAFETY CHAIN LENGTH ²
12"	8.25"
15"	11.25"
18"	14.25"
24"	20.25"

STCF SERIES TEFLON FERRULE COMPRESSION FITTING

½" tube x ½" pipe fitting (shown, not to scale), is used for low pressure insertion applications to 125 psig (Stainless Steel Ferrule optional for higher pressure applications - up to 225 psig). Also available in ¾" tube x ¾" pipe size.

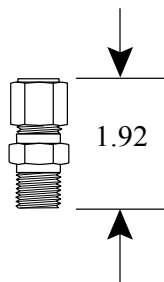

¹ At 650 psig, force exerted on 1/2" diameter probe is approx. 125 lbs

² Safety chain is designed to prevent probe from accidentally escaping from assembly during removal from pressurized pipe

³ Insertion meters can have optional flanged mounting (generally used for high pressure or very hot gases). This adaptation is not shown. Consult factory for details.


⁴ Maximum gas temperature, 200 °F, unless high temperature models ordered.

⁵ Hot Tapping is feasible by removing Weldment (upper portion of assembly temporarily removed)


⁶ See page 46. SVA05 can be utilized for Sensor Functionality and Zero Self Check.

SVA05 SERIES ISOLATION VALVE ASSEMBLY DETAIL^{5,6}


Cut away view of probe inserted through isolation ball valve assembly.

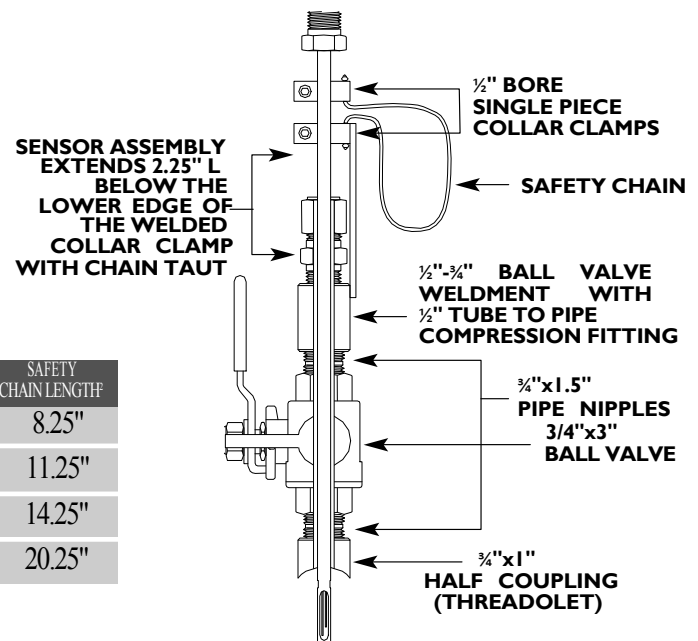

MOUNTING PLATE FOR THIN WALLED DUCTS (INCLUDES STCF05 COMPRESSION FITTING)

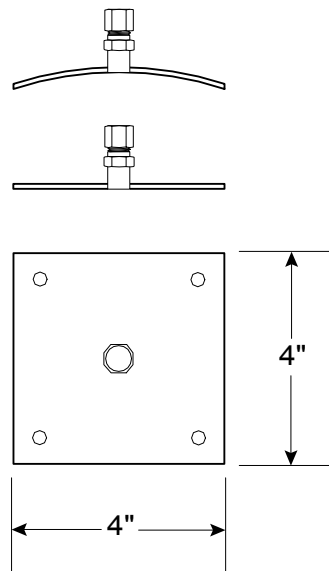


SVA05LP Low Pressure Isolation Valve Assembly

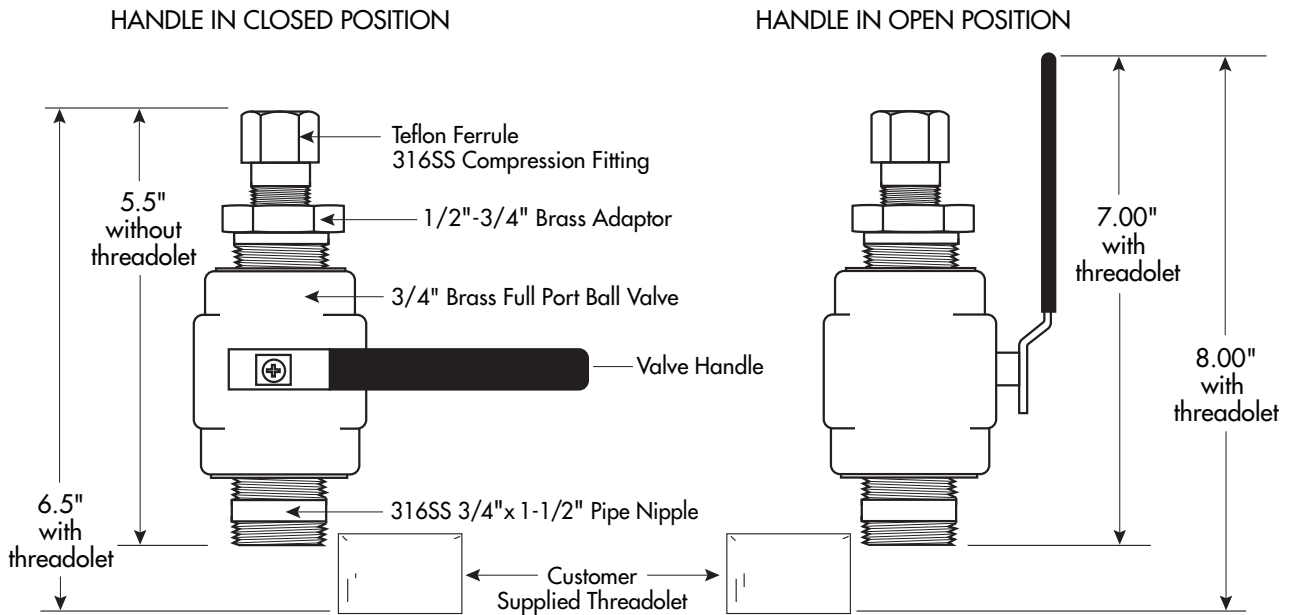


NOTES AND CAUTIONS

- Suitable for low pressure Air or Natural Gas applications (maximum 50 PSIG)
- Assumes 1/2" Insertion Probe inserted to center of a Pipe (see Sage Probe Insertion Guidelines)
- Teflon Ferrule permits ease of Probe insertion or removal
- Exercise caution when loosening Ferrule nut during insertion and removal of Probe, since this model has no Safety Chain
- Note, maximum upward force is 20% of pipe pressure (i.e., 10 Lbs with 50 PSIG)
- The Assembly will be shipped with a plastic sleeve that protects the 3/4" pipe nipple
- It is the Customer's responsibility to weld a Female Threadolet with correct diameter to pipe

Flanged Ends for In-Line Meter (OPTIONAL)

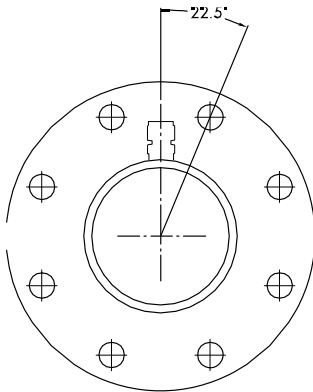

Flanges for 3½" pipe sizes and up,
have 8 bolt holes

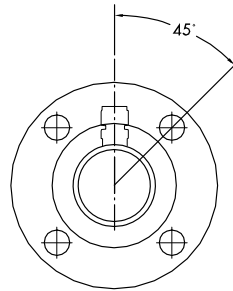

Flanges for 3" pipe sizes and
smaller have 4 bolt holes

Flanged Mounting for Insertion Meter (OPTIONAL)

