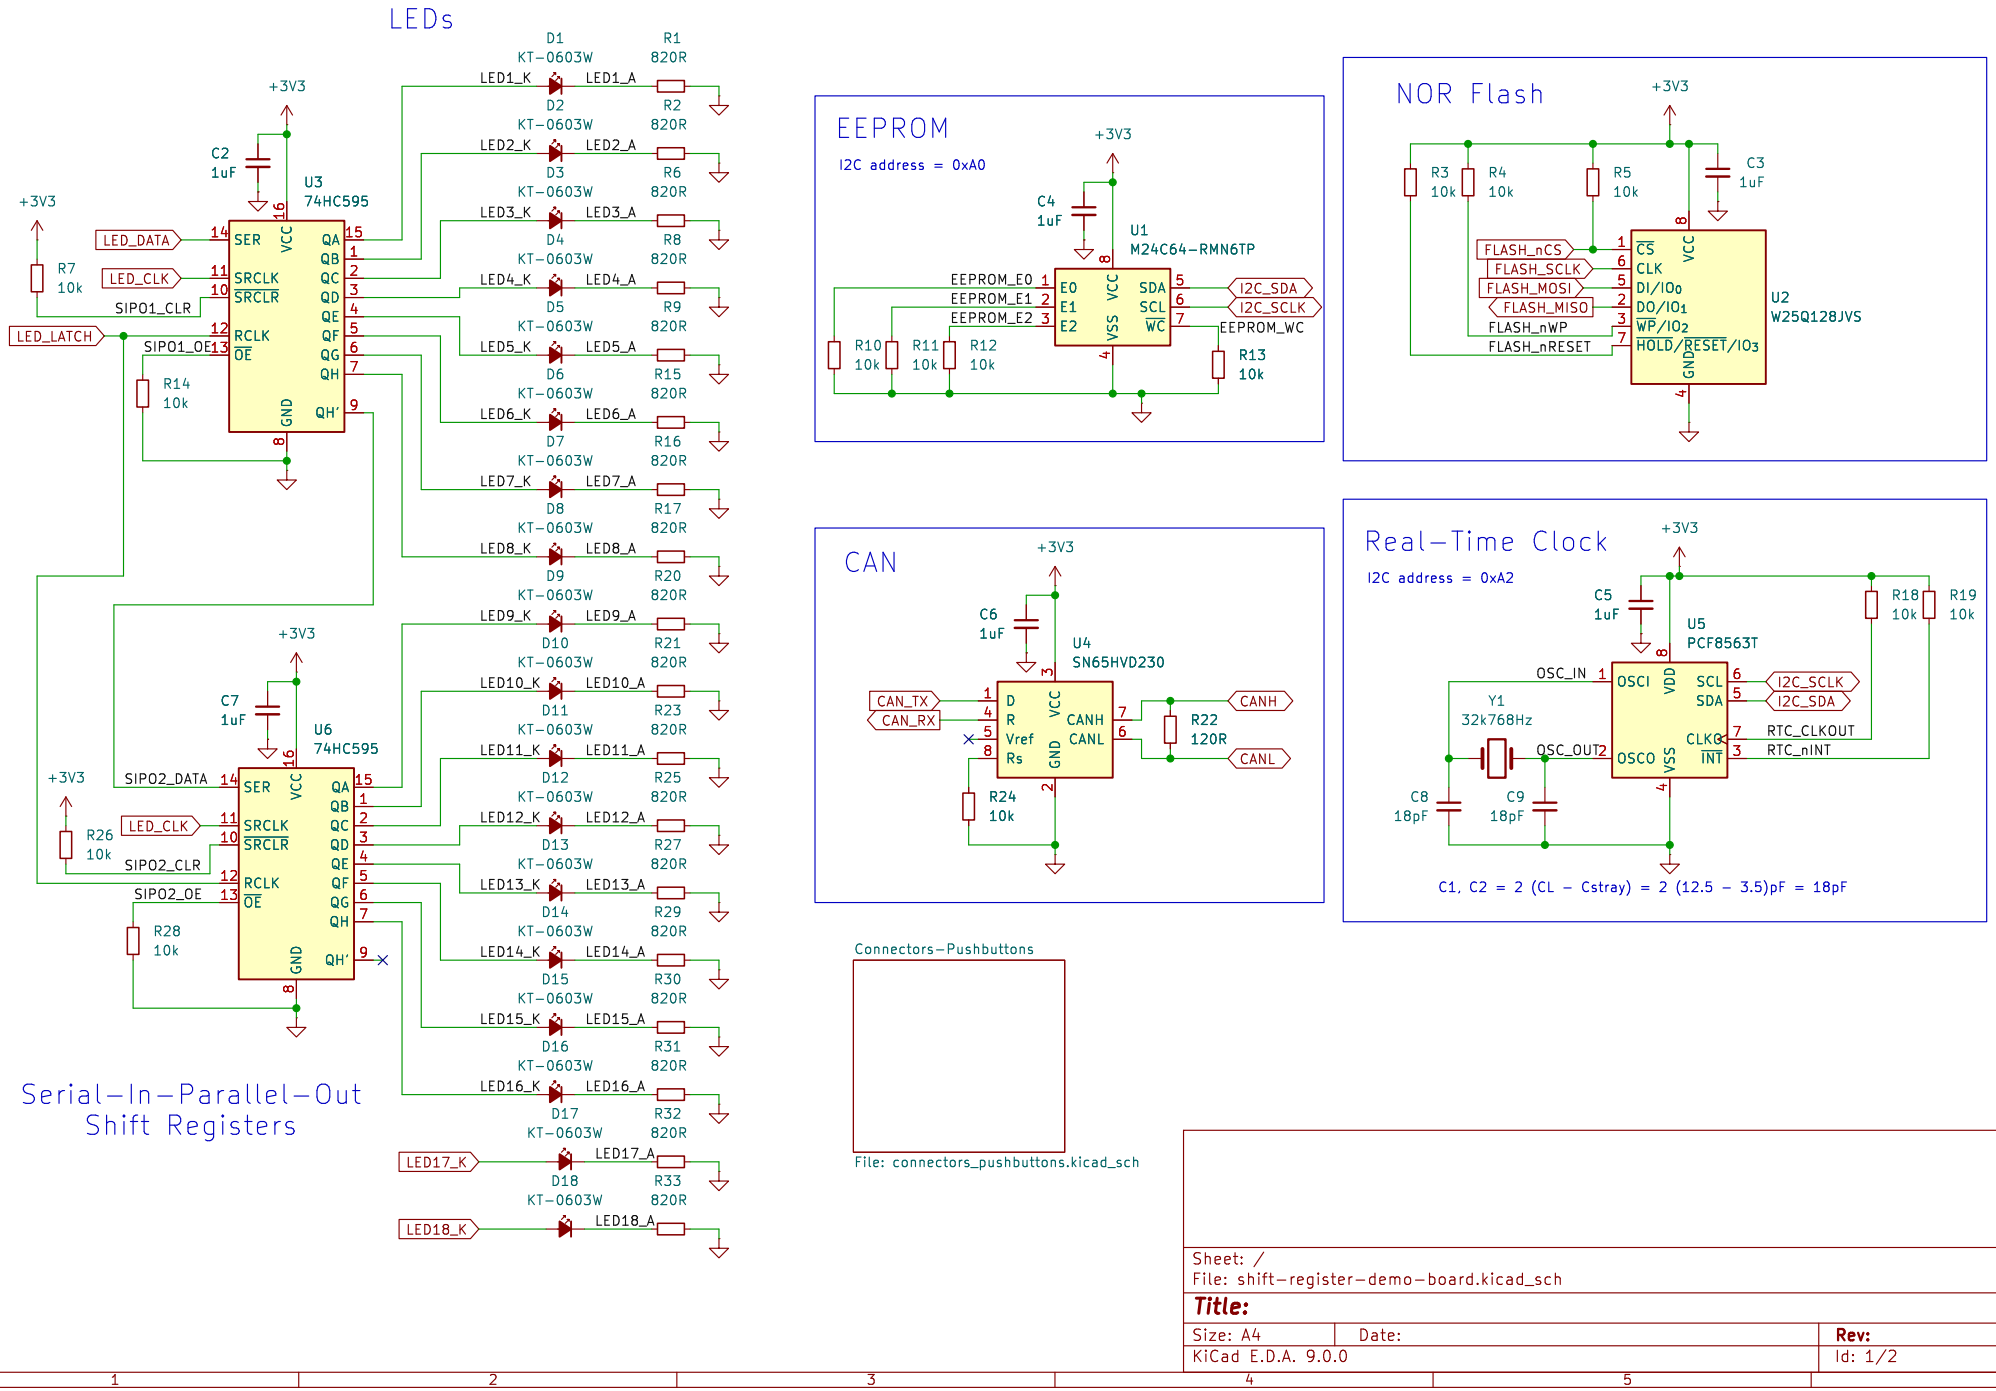
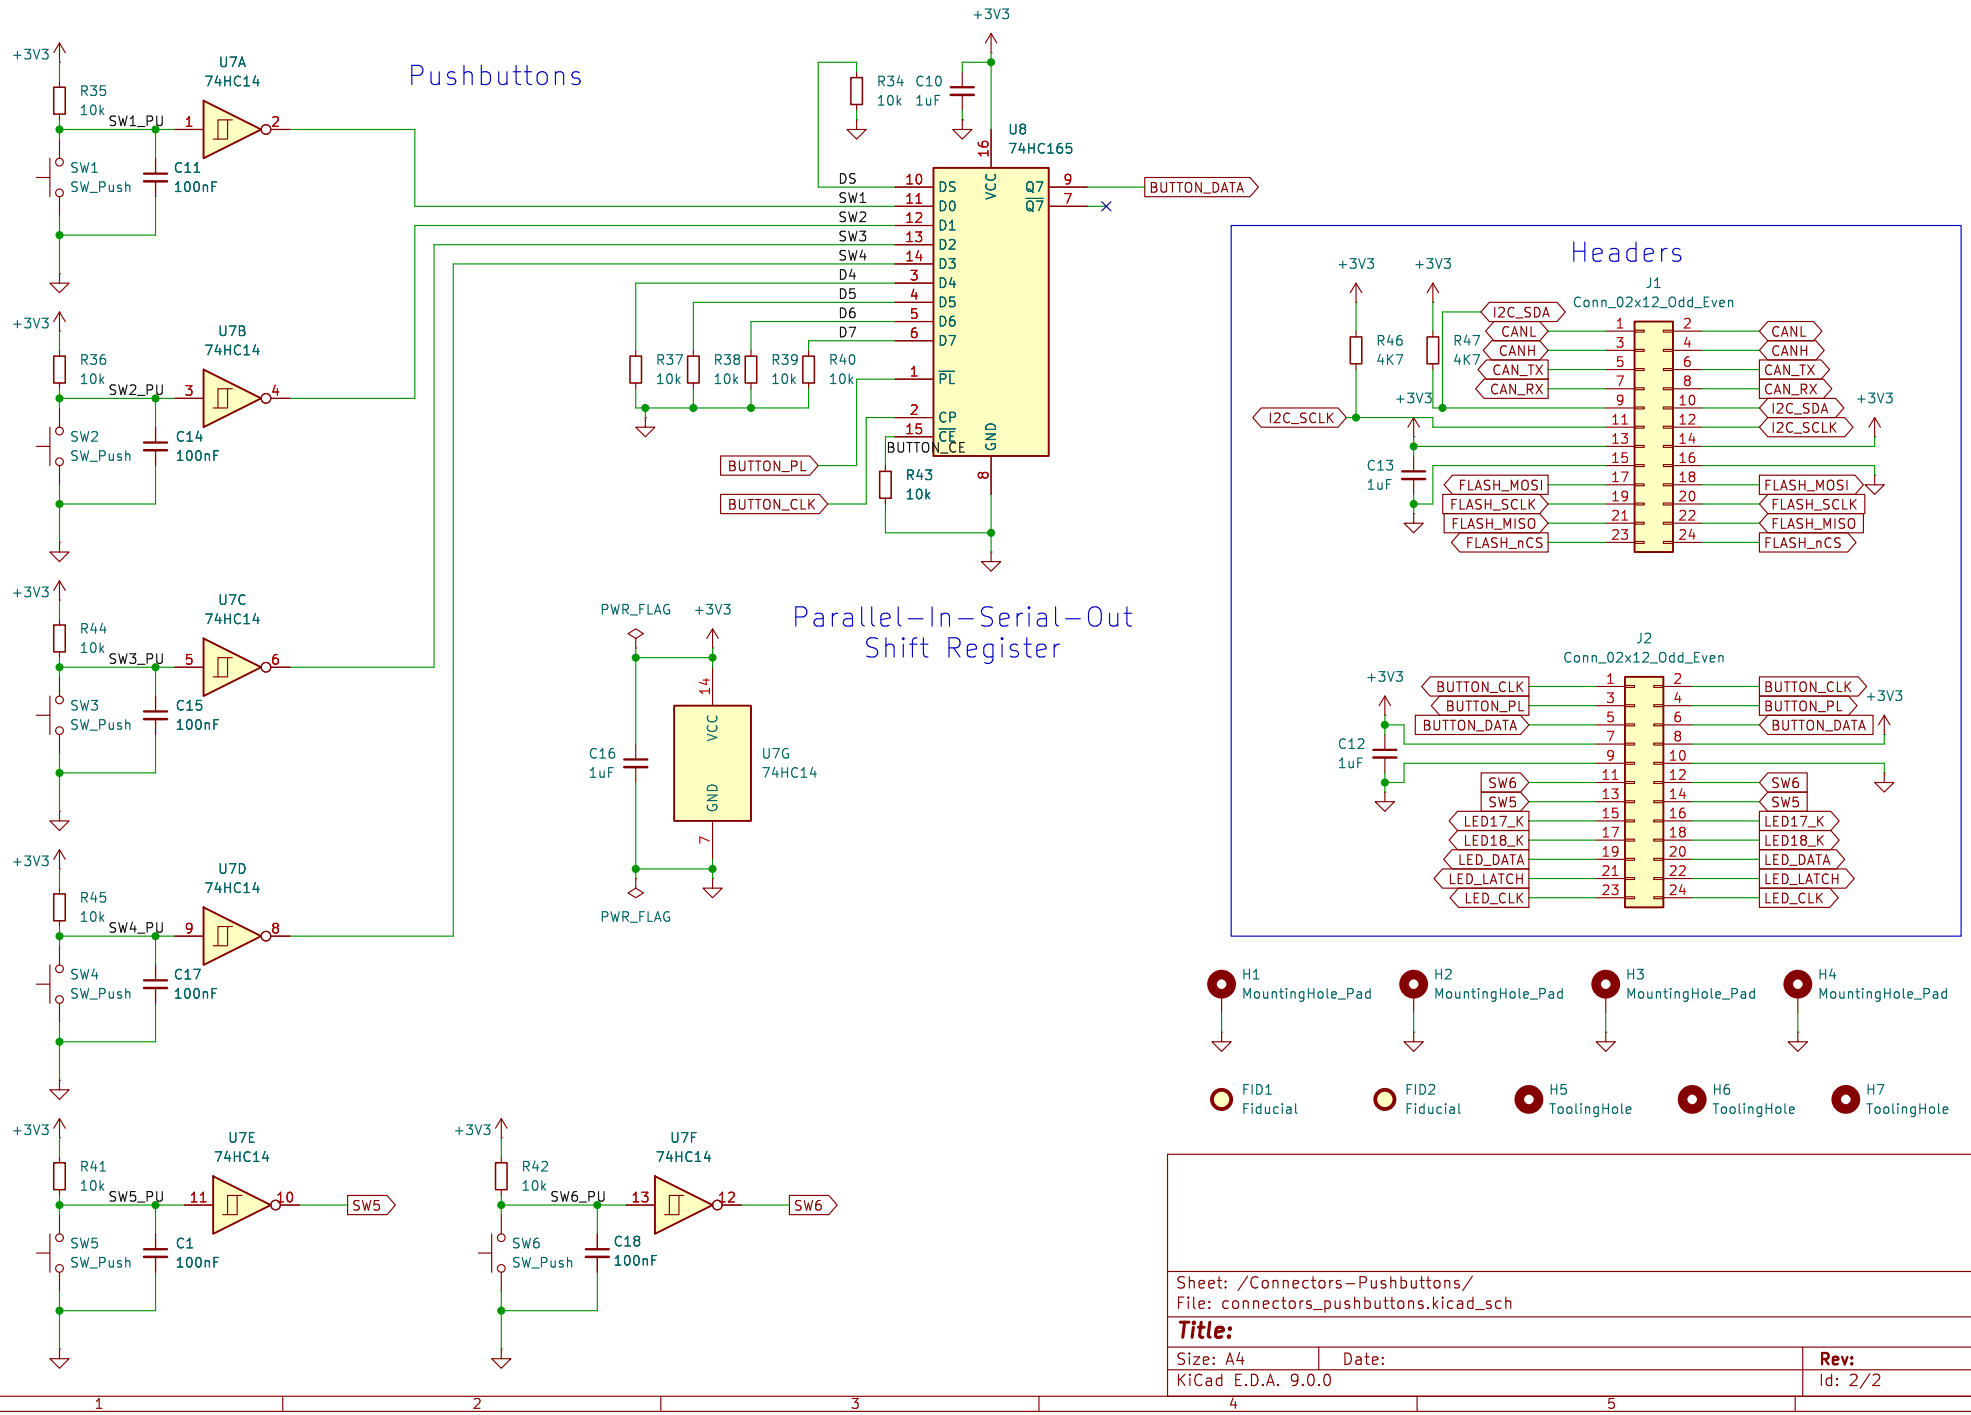

LEDs
Serial–In–Parallel–Out
Shift Registers
EEPROM
I2C address = 0xA0
NOR Flash
CAN
Real–Time Clock
I2C address = 0xA2
C1, C2 = 2 (CL – Cstray) = 2 (12.5 – 3.5)pF = 18pF
Connectors–Pushbuttons
File: connectors_pushbuttons.kicad_sch
Sheet: /
File: shift–register–demo–board.kicad_sch
Title:
Size: A4
Date:
Rev:
KiCad E.D.A. 9.0.0
Id: 1/2


Pushbuttons
U7A
74HC14
R35
10k
SW1_PU
SW1
SW_Push
C11
100nF
U7B
74HC14
R36
10k
SW2_PU
SW2
SW_Push
C14
100nF
U7C
74HC14
R44
10k
SW3_PU
SW3
SW_Push
C15
100nF
U7D
74HC14
R45
10k
SW4_PU
SW4
SW_Push
C17
100nF
U7E
74HC14
R41
10k
SW5_PU
SW5
SW_Push
C1
100nF
SW5
U7F
74HC14
R42
10k
SW6_PU
SW6
SW_Push
C18
100nF
SW6
+3V3
R34 10k
C10 1uF
U8
74HC165
DS
SW1
SW2
SW3
SW4
D4
D5
D6
D7
BUTTON_DATA
R37 10k
R38 10k
R39 10k
R40 10k
BUTTON_PL
BUTTON_CLK
R43
10k
Parallel–In–Serial–Out
Shift Register
PWR_FLAG
C16
1uF
U7G
74HC14
Headers
J1
Conn_02x12_Odd_Even
I2C_SDA
CANL
CANH
CAN_TX
CAN_RX
I2C_SCLK
R46
4K7
R47
4K7
C13
1uF
FLASH_MOSI
FLASH_SCLK
FLASH_MISO
FLASH_nCS
J2
Conn_02x12_Odd_Even
BUTTON_CLK
BUTTON_PL
BUTTON_DATA
C12
1uF
SW6
SW5
LED17_K
LED18_K
LED_DATA
LED_LATCH
LED_CLK
H1
MountingHole_Pad
H2
MountingHole_Pad
H3
MountingHole_Pad
H4
MountingHole_Pad
FID1
Fiducial
FID2
Fiducial
H5
ToolingHole
H6
ToolingHole
H7
ToolingHole
Sheet: /Connectors–Pushbuttons/
File: connectors_pushbuttons.kicad_sch
Title:
Size: A4
Date:
Rev:
KiCad E.D.A. 9.0.0
Id: 2/2