Revisions

Rev.	Date	Author	Description
A	21/01/2018	Florent de Labarre	1028
B	21/01/2018	Florent de Labarre	1025
C	10/04/2018	Florent de Labarre	

Main_MC42

Cavity	To	Conductor	Color	Gauge	From Contact PN	Length
1	CanBus_Main_to_MC4_10.B	W22.White		0,75 mm²		≥ 0,5 m
2	CanBus_ElectricDrive.B	W23.White		0,75 mm²		≥ 1,5 m
3	Can_Aux.B	W57.White		0,75 mm²		≥ 0,5 m
4	IDTAG_1T.2	W50.White		0,75 mm²		≥ 0,1 m
7	Vref_Plus	W59.White		0,75 mm²		
8	R2.2	W16.White		0,75 mm²		
9	Pressure_block.2	W17.White		0,75 mm²		
10	Pressure_tracks.2	W19.White		0,75 mm²		
11	Ladder_hal_captor.C	W55.White		0,75 mm²		≥ 0,5 m
12	Ladder_hal_captor.D	W61.White		0,75 mm²		≥ 0,5 m
14	PWM_tension_tracks.1	W12.White		0,75 mm²		
17	CanBus_Main_to_MC4_10.A	W21.White		0,75 mm²		≥ 0,5 m
18	CanBus_ElectricDrive.A	W24.White		0,75 mm²		≥ 1,5 m
19	Can_Aux.A	W56.White		0,75 mm²		≥ 0,5 m
20	IDTAG_1T.1	W49.White		0,75 mm²		≥ 0,1 m
23	Vref_Minus	W60.White		0,75 mm²		
24	R4.2	W18.White		0,75 mm²		
25	R5.2	W73.White		1 mm²		
26	Accelerometre.D	W46.White		0,75 mm²		≥ 2 m
28	Remote_Power_Box.A	W25.White		0,75 mm²		≥ 1 m
29	Remote_Power_Box.B	W45.White		0,75 mm²		≥ 1 m
36	Accelerometre.E	W47.White		0,75 mm²		≥ 2 m
39	PWM_tension_tracks.2	W13.White		0,75 mm²		
41	ByPass.2	W1.White		0,75 mm²		
42	Landing_DOWN.2	W3.White		0,75 mm²		
43	Landing_Unblock.2	W5.White		0,75 mm²		
44	Electric_Drive_FuseBox_B1.A	W53.White		0,75 mm²		≥ 0,5 m
45	Seat_Control.B	W52.White		0,75 mm²		≥ 0,3 m
46	Splice_C1_46	W14.White		0,75 mm²		
47	Splice_C1_47	W15.White		0,75 mm²		
48	Seat_Control.A	W51.White		0,75 mm²		≥ 0,3 m
52	Accelerometre.F	W48.White		0,75 mm²		≥ 2 m
57	Landing_UP.2	W2.White		0,75 mm²		
58	Track_Tension.2	W4.White		0,75 mm²		
59	Landing_Block.2	W6.White		0,75 mm²		
60	Electric_Drive_FuseBox_B1.C	W54.White		0,75 mm²		≥ 0,5 m
65	12V	W43.Red		2,5 mm²		
66	Supply.B	W44.Black		2,5 mm²		≥ 2 m

R6

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_Bilge_Level	W75.Red		1 mm²	
2	Vref_Plus	W76.Red		1 mm²	

R5

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_Bilge_Level	W68.Red		1 mm²	
2	Main_MC42.25	W73.White		1 mm²	

Supply

Cavity	To	Conductor	Color	Gauge	From Contact PN
A	12V	W58.Red		2,5 mm²	
B	Main_MC42.66	W44.Black		2,5 mm²	

Accelerometre

Cavity	To	Conductor	Color	Gauge	From Contact PN
A	12V	W42.Red		1 mm²	
B	Vref_Minus	W30.Black		1 mm²	
D	Main_MC42.26	W46.White		0,75 mm²	
E	Main_MC42.36	W47.White		0,75 mm²	
F	Main_MC42.52	W48.White		0,75 mm²	

Remote_Power_Box

Cavity	To	Conductor	Color	Gauge	From Contact PN	Notes
A	Main_MC42.28	W25.White		0,75 mm²		Remote A
B	Main_MC42.29	W45.White		0,75 mm²		Remote B

CanBus_Main_to_MC4_10

Cavity	To	Conductor	Color	Gauge	From Contact PN
A	Main_MC42.17	W21.White		0,75 mm²	
B	Main_MC42.1	W22.White		0,75 mm²	

CanBus_ElectricDrive

Cavity	To	Conductor	Color	Gauge	From Contact PN
A	Main_MC42.18	W24.White		0,75 mm²	
B	Main_MC42.2	W23.White		0,75 mm²	

Can_Aux

Cavity	To	Conductor	Color	Gauge	From Contact PN
A	Main_MC42.19	W56.White		0,75 mm²	
B	Main_MC42.3	W57.White		0,75 mm²	

Splice_C1_47

From	To	Conductor	Color	Gauge
Splice_C1_47	Electric_Drive_FuseBox_B1.B	W66.Black		1 mm²
Splice_C1_47	Electric_Drive_FuseBox_B1.D	W67.Black		1 mm²
Splice_C1_47	Main_MC42.47	W15.White		0,75 mm²
Splice_C1_47	Splice_C1_47_Distributeur	W83.Orange		1 mm²

Ladder_hal_captor

Cavity	To	Conductor	Color	Gauge	From Contact PN	Notes
A	Vref_Plus	W65.Red		1 mm²		Wire_Red
B	Vref_Minus	W69.Black		1 mm²		Wire_Black
C	Main_MC42.11	W55.White		0,75 mm²		Hall_A_Yellow
D	Main_MC42.12	W61.White		0,75 mm²		Hall_B_Orange

Electric_Drive_FuseBox_B1

Cavity	To	Conductor	Color	Gauge	Notes
A	Main_MC42.44	W53.White		0,75 mm²	Battery Power
B	Splice_C1_47	W66.Black		1 mm²	
C	Main_MC42.60	W54.White		0,75 mm²	Variator Cmd
D	Splice_C1_47	W67.Black		1 mm²	

Vref_Minus, Vref_Plus

From	To	Conductor	Color	Gauge
Vref_Minus	Accelerometre.B	W30.Black		1 mm²
Vref_Minus	Bilge_Captor.B	W31.Black		1 mm²
Vref_Minus	Ladder_hal_captor.B	W69.Black		1 mm²
Vref_Minus	Main_MC42.23	W60.White		0,75 mm²
Vref_Minus	Oil_Level.B	W28.Black		1 mm²
Vref_Minus	Vref_Minus_Distributor	W79.Black		1 mm²
Vref_Minus	Water_Level.B	W29.Black		1 mm²
Vref_Plus	Ladder_hal_captor.A	W65.Red		1 mm²
Vref_Plus	Main_MC42.7	W59.White		0,75 mm²
Vref_Plus	R1.1	W34.Red		1 mm²
Vref_Plus	R3.2	W39.Red		1 mm²
Vref_Plus	R6.2	W76.Red		1 mm²
Vref_Plus	Vref_Plus_Distributor	W77.Red		1 mm²

Supply = alimentation
Water = eau
Level = niveau
Splice = épissure
Seat = fauteil
hal captor = capteur de vitesse
Ladder = echelle
Oil = huile
Track = chenille
Pressure = pression

12V

From	To	Conductor	Color	Gauge
12V	Accelerometre.A	W42.Red		1 mm²
12V	Main_MC42.65	W43.Red		2,5 mm²
12V	Supply.A	W58.Red		2,5 mm²

R1

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Vref_Plus	W34.Red		1 mm²	
2	Splice_Oil_level	W35.Red		1 mm²	

R2

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_Oil_level	W37.Red		1 mm²	
2	Main_MC42.8	W16.White		0,75 mm²	

R3

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_Water_level1	W41.Red		1 mm²	
2	Vref_Plus	W39.Red		1 mm²	

R4

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_Water_level1	W40.Red		1 mm²	
2	Main_MC42.24	W18.White		0,75 mm²	

Splice_Oil_level

From	To	Conductor	Color	Gauge
Splice_Oil_level	Oil_Level.A	W36.Red		1 mm²
Splice_Oil_level	R1.2	W35.Red		1 mm²
Splice_Oil_level	R2.1	W37.Red		1 mm²

Splice_Water_level1

From	To	Conductor	Color	Gauge
Splice_Water_level1	R3.1	W41.Red		1 mm²
Splice_Water_level1	R4.1	W40.Red		1 mm²
Splice_Water_level1	Water_Level.A	W38.Red		1 mm²

Splice_Bilge_Level

From	To	Conductor	Color	Gauge
Splice_Bilge_Level	Bilge_Captor.A	W74.Red		1 mm²
Splice_Bilge_Level	R5.1	W68.Red		1 mm²
Splice_Bilge_Level	R6.1	W75.Red		1 mm²

Bilge_Captor

Cavity	To	Conductor	Color	Gauge	From Contact PN
A	Splice_Bilge_Level	W74.Red		1 mm²	
B	Vref_Minus	W31.Black		1 mm²	

Oil_Level

Cavity	To	Conductor	Color	Gauge	From Contact PN
A	Splice_Oil_level	W36.Red		1 mm²	
B	Vref_Minus	W28.Black		1 mm²	

Water_Level

Cavity	To	Conductor	Color	Gauge	From Contact PN
A	Splice_Water_level1	W38.Red		1 mm²	
B	Vref_Minus	W29.Black		1 mm²	

Pressure_tracks

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Vref_Minus_Distributor	W27.Black		1 mm²	
2	Main_MC42.10	W19.White		0,75 mm²	
3	Vref_Plus_Distributor	W33.Red		1 mm²	

Pressure_block

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Vref_Minus_Distributor	W26.Black		1 mm²	
2	Main_MC42.9	W17.White		0,75 mm²	
3	Vref_Plus_Distributor	W32.Red		1 mm²	

PWM_tension_tracks

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Main_MC42.14	W12.White		0,75 mm²	
2	Main_MC42.39	W13.White		0,75 mm²	

ByPass

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_C1_46	W9.White		0,75 mm²	
2	Main_MC42.41	W1.White		0,75 mm²	

Landing_UP

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_C1_46	W11.White		0,75 mm²	
2	Main_MC42.57	W2.White		0,75 mm²	

Landing_DOWN

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_C1_46	W10.White		0,75 mm²	
2	Main_MC42.42	W3.White		0,75 mm²	

Track_Tension

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_C1_46	W20.White		0,75 mm²	
2	Main_MC42.58	W4.White		0,75 mm²	

Landing_Block

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_C1_47_Distributeur	W7.White		0,75 mm²	
2	Main_MC42.59	W6.White		0,75 mm²	

Landing_Unblock

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Splice_C1_47_Distributeur	W8.White		0,75 mm²	
2	Main_MC42.43	W5.White		0,75 mm²	

Seat_Control

Cavity	To	Conductor	Color	Gauge	From Contact PN
A	Main_MC42.48	W51.White		0,75 mm²	
B	Main_MC42.45	W52.White		0,75 mm²	

IDTAG_1T

Cavity	To	Conductor	Color	Gauge	From Contact PN
1	Main_MC42.20	W49.White		0,75 mm²	
2	Main_MC42.4	W50.White		0,75 mm²	

Vref_Plus_Distributor, Vref_Minus_Distributor

From	To	Conductor	Color	Gauge
Vref_Minus_Distributor	Pressure_block.1	W26.Black		1 mm²
Vref_Minus_Distributor	Pressure_tracks.1	W27.Black		1 mm²
Vref_Minus_Distributor	Vref_Minus	W79.Black		1 mm²
Vref_Plus_Distributor	Pressure_block.3	W32.Red		1 mm²
Vref_Plus_Distributor	Pressure_tracks.3	W33.Red		1 mm²
Vref_Plus_Distributor	Vref_Plus	W77.Red		1 mm²

Splice_C1_46


From	To	Conductor	Color	Gauge
Splice_C1_46	ByPass.1	W9.White		0,75 mm²
Splice_C1_46	Landing_DOWN.1	W10.White		0,75 mm²
Splice_C1_46	Landing_UP.1	W11.White		0,75 mm²
Splice_C1_46	Main_MC42.46	W14.White		0,75 mm²
Splice_C1_46	Track_Tension.1	W20.White		0,75 mm²

Splice_C1_47_Distributeur

From	To	Conductor	Color	Gauge
Splice_C1_47_Distributeur	Landing_Block.1	W7.White		0,75 mm²
Splice_C1_47_Distributeur	Landing_Unblock.1	W8.White		0,75 mm²
Splice_C1_47_Distributeur	Splice_C1_47	W83.Orange		1 mm²

Bill of Materials


Id	Type	Manufacturer	Part Number	Quantity	Description
1	Connector		#11434 - Parker_IDTAG_1	1	5 030 071
2	Connector		#15960 - Delphi_150_6_way_female	1	829-12052848
3	Connector		#20694 - Phoenix_valve_2_way	6	651-1410723
4	Connector		#23554 - Phoenix_3_way_female	1	651-1402983
5	Connector		#24679 - Parker_C1_66_way	1	
6	Connector		Resistor_240 Ohm	6	
7	Connector	Delphi	#15215 - Delphi_150_2_way_male	5	829-12162000
8	Connector	Delphi	#17183 - Delphi_480_2_way_male	1	829-12065863
9	Connector	Delphi	#17351 - Delphi_280_2_way_female	3	829-15300027
10	Connector	Delphi	#28050 - Delphi_150_4_way_female	2	829-12160482-B
11	Connector	TE	#12189 - Te_Timer_3_way_female	2	571-2821911
12	Splice		Generic Splice	11	Generic Splice
13	Wire		1mm² Black	≥ 5,1 m	
14	Wire		1mm² Red	≥ 4,1 m	
15	Wire		2.5mm² - Black	≥ 2 m	
16	Wire		2.5mm² - Red	≥ 2 m	
17	Wire		C1_Wire	≥ 15,8 m	
18	Wire		1mm² - White	≥ 0 in	
19	Label		Generic White Label	24	Generic Label
20	Wire		1 mm² - Orange		

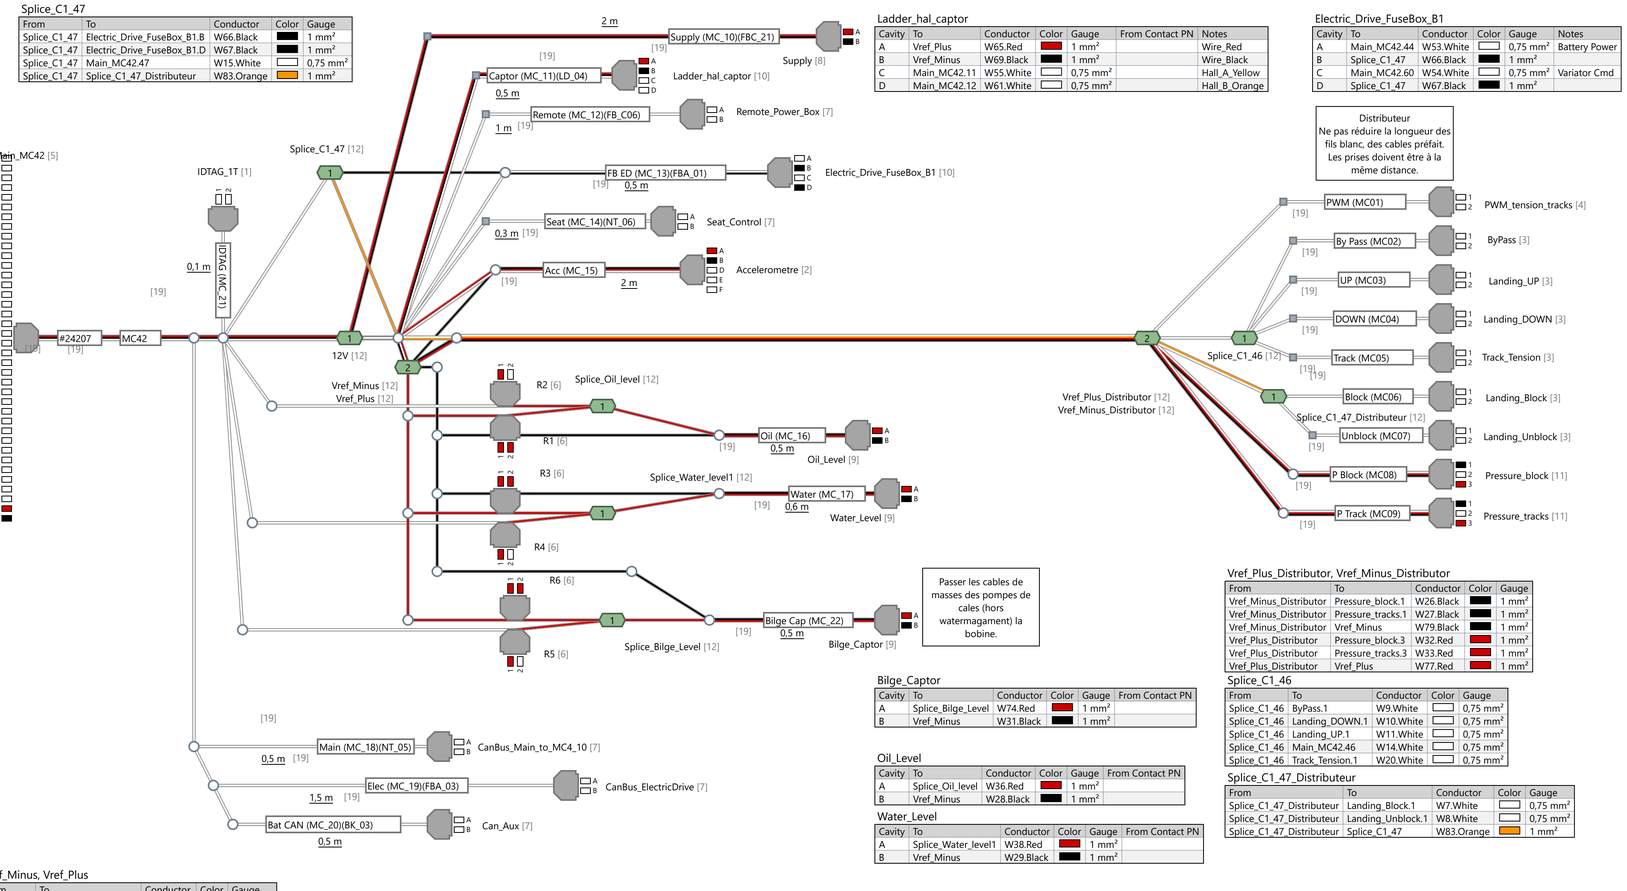

Distributeur
Ne pas réduire la longueur des fils blanc, des cables préfait. Les prises doivent être à la même distance.

Passer les cables de masses des pompes de cales (hors watermagament) la bobine.


Wiring diagram

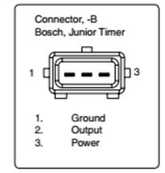


Mating connector: 5031086



Mating connector view

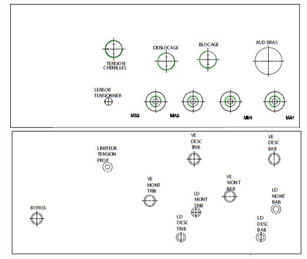

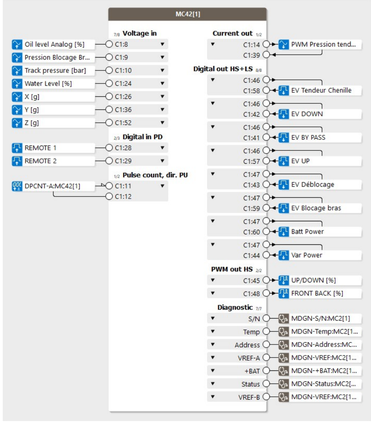

	Name	Date
Drawn By	----	----
Eng Approved	----	----
Mfg Approved	----	----
QA	----	----

Title: #24207 - MC42_CAB (MC)
Description:
Revision: ----

This document contains confidential and proprietary information that cannot be reproduced or divulged, in whole or in part, without written authorization.