



J101
Conn_01x08

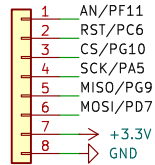


J102
Conn_01x08

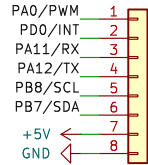


- AN connected to ADC1_INP2, WKUP1
- PWM connected to TIM2_CH1
- Connected to (dedicated) SPI1
- Uses hardware CS (SPI1_NSS)
- RX/TX connected to FDCAN1
- All sockets share I2C1

J105
Conn_01x08

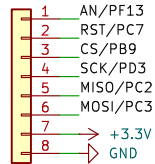


J106
Conn_01x08

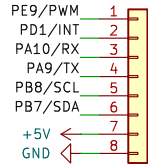


- AN connected to ADC2_INP2
- PWM connected to TIM1_CH1
- Connected to SPI2
- Uses hardware CS (SPI2_NSS)
- RX/TX connected to USART1 (LIN capable)
- All sockets share I2C1

J107
Conn_01x08

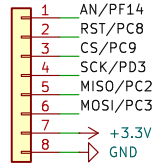


J108
Conn_01x08

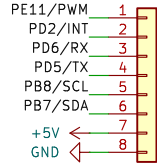


- AN connected to ADC2_INP6
- PWM connected to TIM1_CH2
- Connected to SPI2
- RX/TX connected to USART2 (LIN capable)
- All sockets share I2C1

J109
Conn_01x08

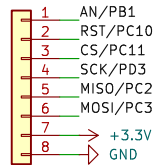

J110
Conn_01x08

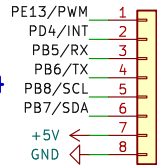


- AN connected to ADC12_INP5
- PWM connected to TIM1_CH3
- Connected to SPI2
- RX/TX connected to FDCAN2
- All sockets share I2C1

+3.3V ← ◇ PWR_FLAG
+5V ← ◇ PWR_FLAG
GND ← ◇ PWR_FLAG


Note: Should not use the following pads since they are used by NUCLE0144 board

- PC13 is connected to B1 user button
- PB0 connected to LD1
- PE1 connected to LD2
- PB14 connected to LD3
- PD8/PD9 (USART3) connected to virtual COM port
- PA1, PA2, PA7, PB13, PC1, PC4, PC5, PG11, PG13 connected to Ethernet RMII
- PA13, PA14 connected to SWD

J103
Conn_02x35_Odd_Even

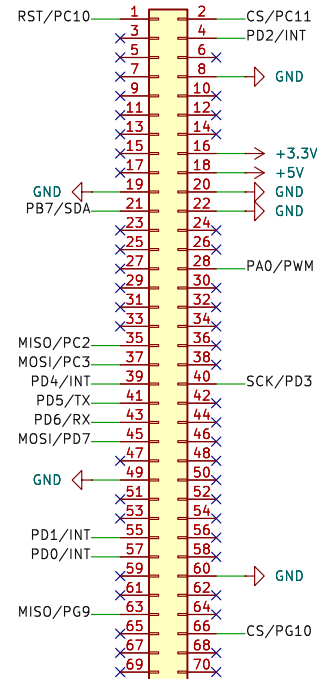

J104
Conn_02x35_Odd_Even

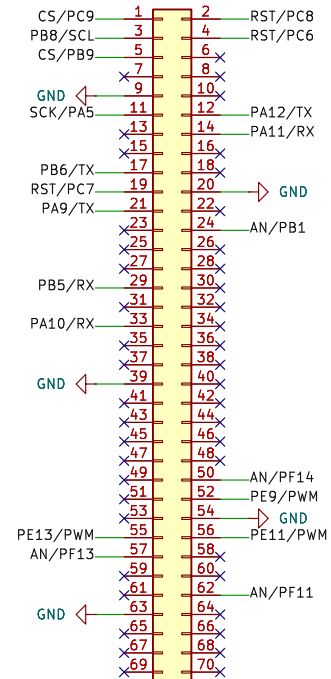

Sheet: /
File: stm144_click_shield.kicad_sch

Title: STM144 Click Shield

Size: A4 Date: 2026/07/02

KiCad E.D.A. 9.0.1

Rev: v1.1

Id: 1/1