Inspection Report: CCR-1 Regeneration Cycle 18

Report No: IR-CCR1-2026-018 | Unit: CCR-1 (Continuous Catalytic Reformer) | Inspection Date: 2026-08-11

1. Summary of Findings

Regeneration Cycle 18 completed in 34 hours, exceeding the normal target of 28 hours by 6 hours. This is the second consecutive cycle showing extended duration (Cycle 17: 31 hours, Cycle 18: 34 hours), following three cycles within normal range. Preliminary root cause: reduced chlorination efficiency attributed to moisture ingress in the regeneration gas circuit, under investigation by the Process Engineering team.

2. Cycle Duration Trend

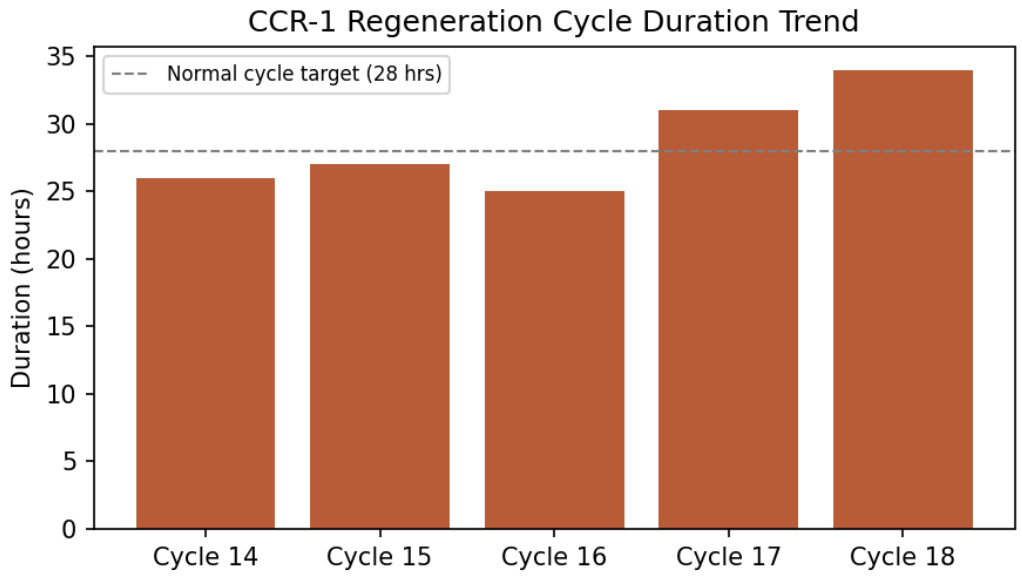

3. Key Parameters at Cycle Completion

Parameter	Cycle 17	Cycle 18	Normal Range
Coke Burn Rate (kg/hr)	142	128	135 - 155
Regeneration Gas O2 (%)	0.6	0.5	0.5 - 1.0
Chlorination Efficiency (%)	91	84	90 - 96
Catalyst Chloride Retention (%)	0.92	0.85	0.9 - 1.1
Bed Outlet Temp (°C)	482	478	470 - 490

4. Recommendations

- Inspect regeneration gas dryer (D-102) desiccant bed condition before Cycle 19.
- Verify moisture analyzer AI-4471 calibration - last calibrated 2026-02-10 (over 6 months).
- If Cycle 19 duration again exceeds 30 hours, escalate to a full chlorination system review per SOP-140.

This is a synthetic, illustrative document generated for RAG/retrieval testing purposes. It does not represent an actual MRPL internal document.