3141 THRU 3144 SENSITIVE HALL-EFFECT SWITCHES FOR HIGH-TEMP. OPERATION

PACKAGE DESIGNATOR 'UA'


Dimensions in Inches (controlling dimensions)

0.159 0.062 0.058 0.122 0.031-0.085 MAX 0.0173 0.640 0.600 0.0138 SEE NOTE 0.0189 0.0142 BSC Dwg. MH-014E in


NOTES: 1. Tolerances on package height and width represent allowable mold offsets. Dimensions given are measured at the widest point (parting line).

- 2. Exact body and lead configuration at vendor's option within limits shown.
- 3. Height does not include mold gate flash.
- Recommended minimum PWB hole diameter to clear transition area is 0.035" (0.89 mm).
- 5. Where no tolerance is specified, dimension is nominal.
- 6. Supplied in bulk pack (500 pieces per bag).

Dimensions in Millimeters (for reference only)

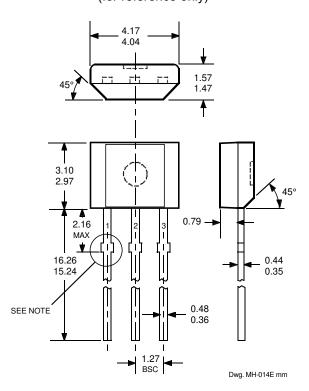

Radial Lead Form (order A314xxUA-LC)

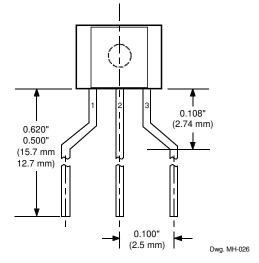

NOTE: Lead-form dimensions are the nominals produced on the forming equipment. No dimensional tolerance is implied or guaranteed for bulk packaging (500 pieces per bag).

