9. Wiring to the connector, X7

Monitor output

The connector X7 of the front panel is for monitor output.

Analogue output : 2 systems

Digital output : 1 systems

In both cases, it is possible to switch the output signal by setting parameters.

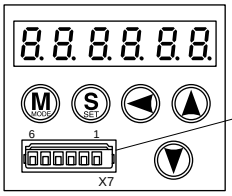

Connector X7
Manufacturer's part No.: 530140610
Manufacturer: Japan Molex Inc.

Application	Symbol	Connector Pin No.	Contents
Analogue monitor output 1	AM1	1	Output the analogue signal for monitor.
Analogue monitor output 2	AM2	2	
Signal ground	GND	3	Connected to ground of control circuit.
Digital monitor output	DM	4	Output the digital signal for monitor.
NC	–	5	Do not connect.
NC	–	6	Do not connect.

• Parameter rerated to monitor output.

Parametr No.		Title	Function
Class	No.		
4	16	Type of analog monitor 1	Select the type of monitor for analog monitor 1.
4	17	Analog monitor 1 output gain	Set up the output gain of analog monitor 1.
4	18	Type of analog monitor 2	Select the type of monitor for analog monitor 2.
4	19	Analog monitor 2 output gain	Set up the output gain of analog monitor 2.
4	20	Type of digital monitor	Select type of the digital monitor.
4	21	Analog monitor output setup	Select output format of the analog monitor.

Note For details of parameters, refer to P.4-35 "Details of parameter".