


00


00



Bend Diameter/2 + Bar Diameter/2


02

L1 = Start Tangent Hook Length - Bend Diameter / 2 - Bar Diameter
 L2 = $\pi(\text{Bend Diameter} \cdot 0.5 + 0.5 \cdot \text{Bar Diameter})$
 L3 = B - Bend Diameter - 2 * Bar Diameter

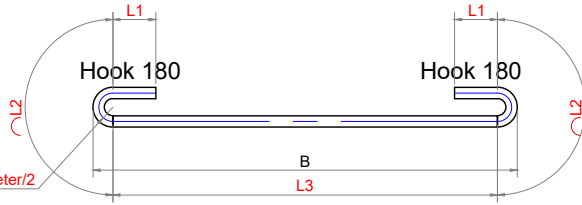


03

L1 = Start Tangent Hook Length - Bar Diameter - Bend Diameter * 0.5
 L2 = $\pi(\text{Bend Diameter} / 2 + \text{Bar Diameter} / 2) / 2$
 L3 = B - Bar Diameter - (Bend Diameter + Bar Diameter)

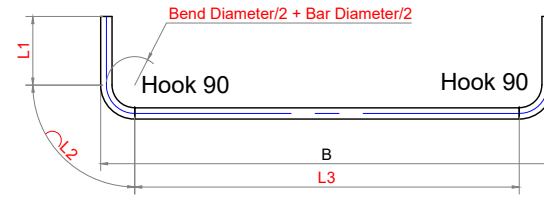


11

L1 = A - Bar Diameter / 2
 L2 = B - Bar Diameter / 2

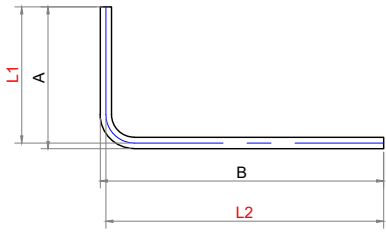


12

L1 = A - R - Bar Diameter / 2
 L2 = $(2 \cdot \pi(\text{R} + 0.5 \cdot \text{Bar Diameter})) / 4$
 L2 = B - R - Bar Diameter / 2

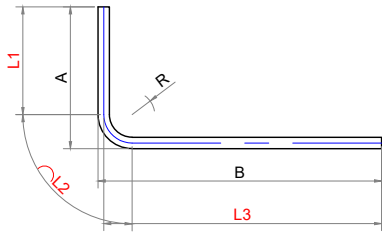


13

L1 = A - Bar Diameter / 2
 L2 = $\pi(\text{R} + \text{Bar Diameter} / 2)$
 L3 = C - Bar Diameter / 2

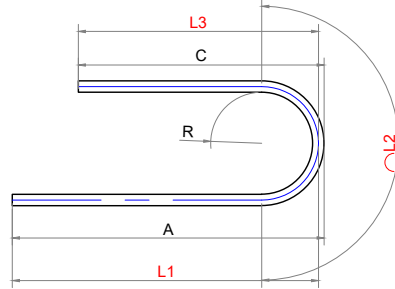

14


L1 = C + [y - (Bend Diameter / 2 + Bar Diameter)]
 L2 = A + [y - (Bend Diameter / 2 + Bar Diameter)]

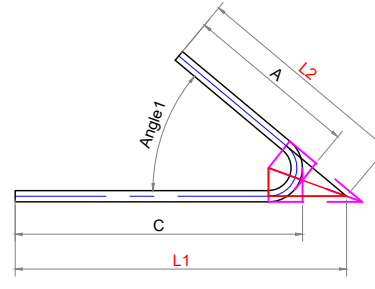

x = Bend Diameter / 2 + Bar Diameter / 2
 y = x / tan((Angle1) / 2)


15

a = Bar Diameter / 2
 $\tan(k) = a / x$
 $x = a / \tan(k)$
 $x = (\text{Bar Diameter} / 2) / \tan((180 - \text{Angle1}) / 2)$
 L1 = C - (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L2 = A - (Bar Diameter / 2) / tan((180 - Angle1) / 2)

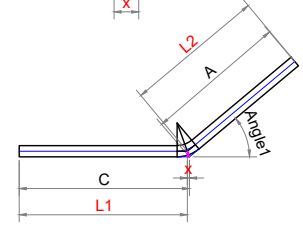


21

L1 = A - Bar Diameter / 2
 L2 = B - Bar Diameter / 2
 L3 = C - Bar Diameter / 2

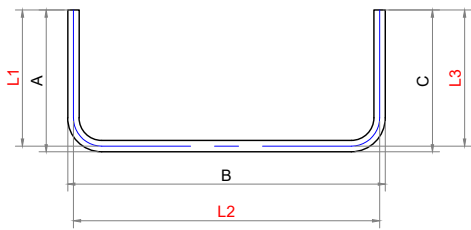


22

L1 = A - Bar Diameter / 2
 L2 = B - Bar Diameter / 2
 L3 = $\pi(\text{R} + \text{Bar Diameter} / 2)$
 L3 = D - Bar Diameter / 2

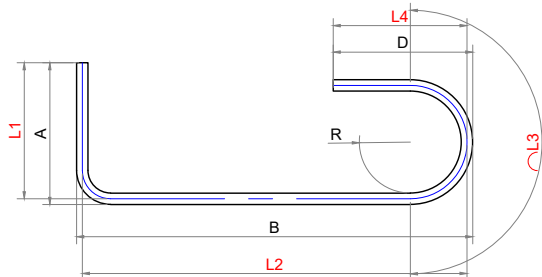

23


L1 = A - Bar Diameter / 2
 L2 = B - Bar Diameter / 2
 L3 = C - Bar Diameter / 2

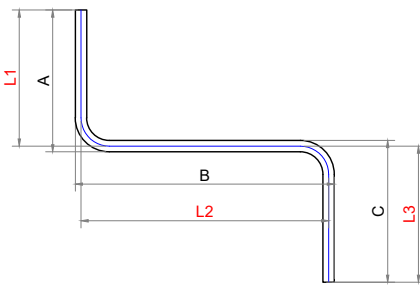

L2 = B - (Bar Diameter / 2) / tan((180 - Angle1) / 2) - (Bar Diameter / 2) / tan((180 - (90 - Angle1)) / 2)


L1 = A - (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L3 = C - (Bar Diameter / 2) / tan((180 - (90 - Angle1)) / 2)

24

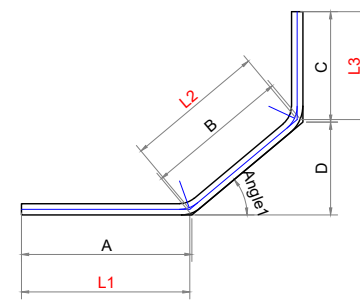


25

a = Bar Diameter / 2
 $\tan(k) = a / x$
 $x = a / \tan(k)$
 $x = (\text{Bar Diameter} / 2) / \tan((180 - \text{Angle1}) / 2)$
 L1 = A - (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L1 = E - (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 - (Bar Diameter / 2) / tan((180 - Angle2) / 2)
 L3 = B - (Bar Diameter / 2) / tan((180 - Angle1) / 2)

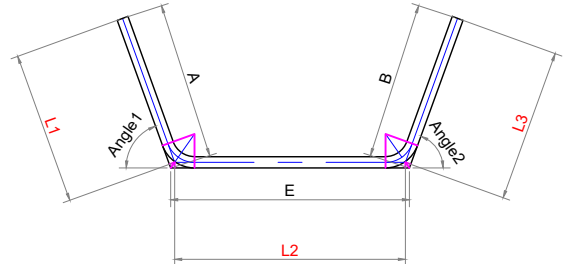


26

L1 = A - (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L2 = B - 2 * (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L3 = C - (Bar Diameter / 2) / tan((180 - Angle1) / 2)

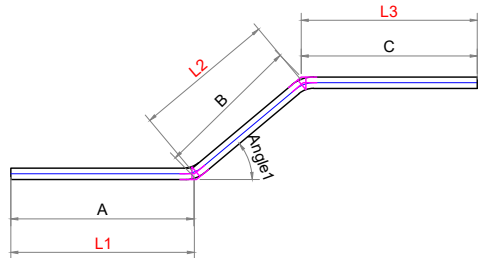


27

L1 = A - Bar Diameter / 2
 L2 = B - Bar Diameter / 2 - (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L3 = C - (Bar Diameter / 2) / tan((180 - Angle1) / 2)

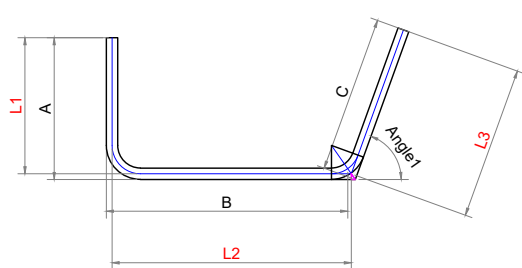


28

L1 = C - Bar Diameter / 2
 L2 = B - (Bar Diameter / 2) / tan((180 - Angle1) / 2) - Bar Diameter / 2
 L3 = A - (Bar Diameter / 2) / tan((180 - Angle1) / 2)

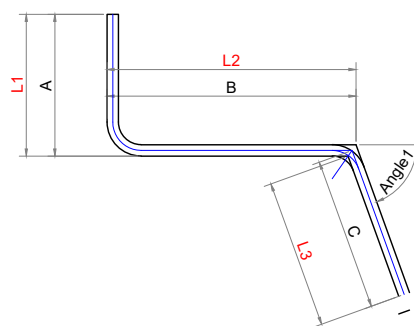


L1 = A + ((Bend Diameter / 2 + Bar Diameter / 2) / tan(Angle1 / 2)) - (Bend Diameter / 2 + Bar Diameter / 2) / tan(Angle1 / 2)
 L2 = B + ((Bend Diameter / 2 + Bar Diameter / 2) / tan(Angle1 / 2)) - (Bend Diameter / 2 + Bar Diameter / 2) / tan(Angle1 / 2)
 L3 = C - (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L3 = C - (Bar Diameter / 2) / tan((180 - Angle1) / 2)

29

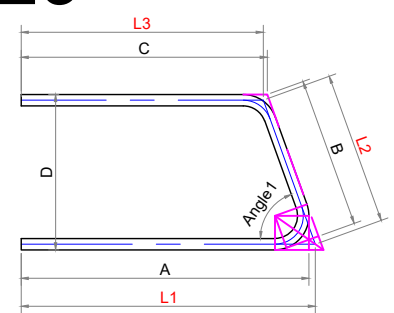


31

L1 = A - Bar Diameter / 2
 L2 = B - Bar Diameter
 L3 = C - Bar Diameter
 L4 = D - Bar Diameter / 2

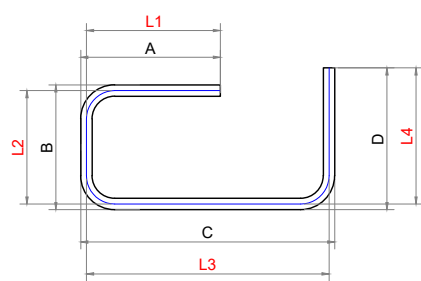


32

L1 = A - Bar Diameter / 2
 L2 = B - Bar Diameter
 L3 = C - Bar Diameter
 L4 = D - Bar Diameter / 2

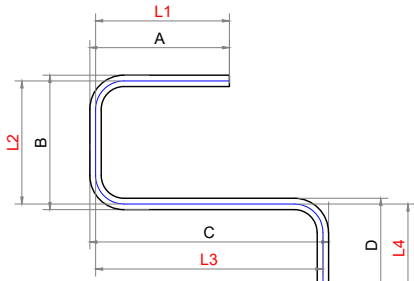


34

L1 = A - (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L2 = B - 2 * (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L3 = C - (Bar Diameter / 2) / tan((180 - Angle1) / 2) - Bar Diameter / 2
 L4 = E - (Bar Diameter / 2)

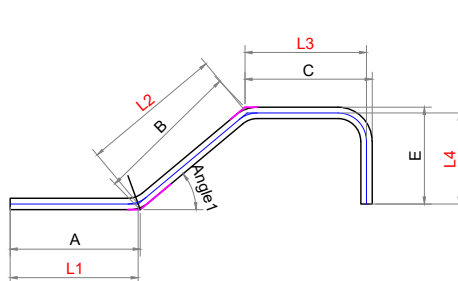


35

L1 = A - (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L2 = B - 2 * (Bar Diameter / 2) / tan((180 - Angle1) / 2)
 L3 = C - (Bar Diameter / 2) / tan((180 - Angle1) / 2) - Bar Diameter / 2
 L4 = E - Bar Diameter / 2

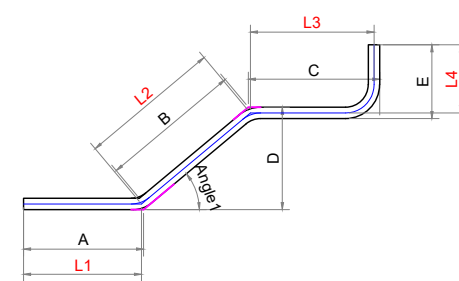

36


L1 = A - Bar Diameter / 2
 L2 = B - Bar Diameter
 L3 = C - (Bar Diameter / 2) / tan((180 - Angle1) / 2) - Bar Diameter / 2
 L4 = D - (Bar Diameter / 2) / tan((180 - Angle1) / 2)

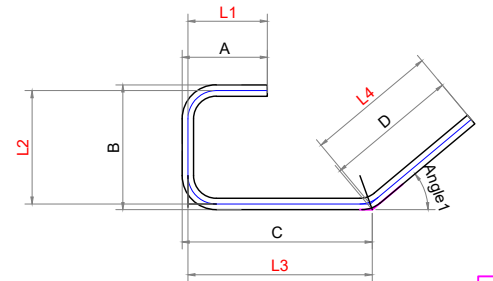

30


04

L1 = Start Tangent Hook Length - Bar Diameter - Bend Diameter * 0.5
L2 = pi() * (Bend Diameter / 2 + Bar Diameter / 2)/2
L3 = B - Bar Diameter-(Bend Diameter + Bar Diameter)
L4 = pi() * (Bend Diameter * 0.5 + 0.5 * Bar Diameter)
L5 = End Tangent Hook Length - Bend Diameter / 2 - Bar Diameter

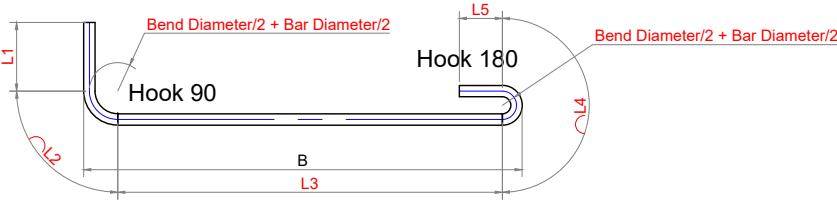


05

L1 = B - Bar Diameter/2-(Bend Diameter + Bar Diameter) /2
L2 = pi() * (Bend Diameter / 2 + Bar Diameter / 2)/2
L3 = End Tangent Hook Length - Bar Diameter - Bend Diameter * 0.5

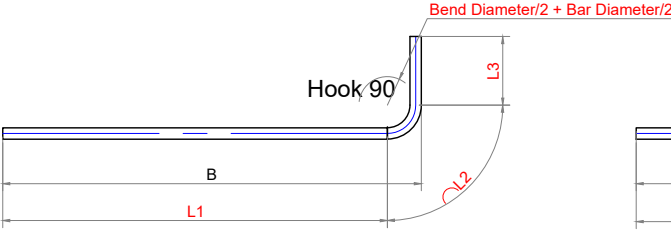


06

L1 = B - Bend Diameter / 2 - Bar Diameter
L2 = pi()*(Bend Diameter*0.5+0.5*Bar Diameter)
L3 = Start Tangent Hook Length - Bend Diameter / 2 - Bar Diameter

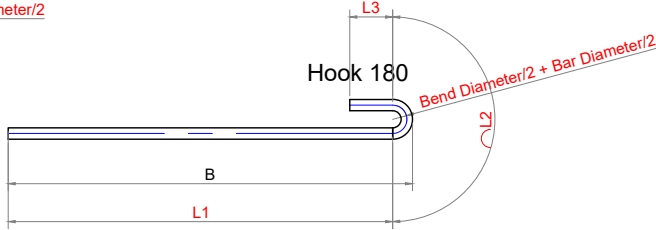


07

L1 = Start Tangent Hook Length - Bend Diameter * 0.5 - Bar Diameter
L2 = 0.75 * pi() * (Bend Diameter * 0.5 + 0.5 * Bar Diameter)
L3 = B - Bend Diameter - Bar Diameter * 2

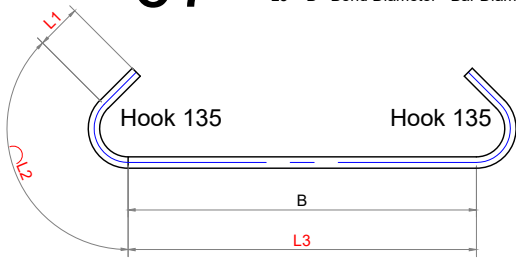


16

L1= A-R-Bar Diameter
L2 = (2*pi()*(R+0.5*Bar Diameter))/4
L3= B-Bend Diameter/2-R-Bar Diameter
L4=pi() * (Bend Diameter * 0.5 + 0.5 * Bar Diameter)
L5 = End Tangent Hook Length - Bend Diameter / 2 - Bar Diameter

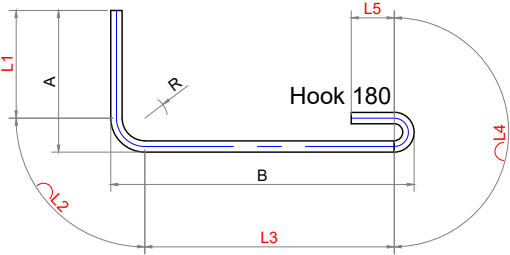


20

L1 = A - R - Bar Diameter
L2 = (2 * pi() * (R + 0.5 * Bar Diameter)) / 4
L3 = B - 2 * Bar Diameter - R * 2
L4 = (2 * pi() * (R + 0.5 * Bar Diameter)) / 4
L5 = C - R - Bar Diameter



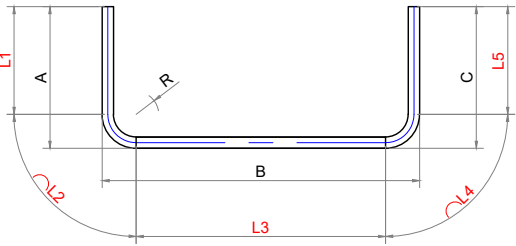


38


L1 = A - Bar Diameter / 2
L2 = B - (Bar Diameter / 2) / tan((180° - Angle1) / 2) - Bar Diameter / 2
L3 = C - (Bar Diameter / 2) / tan((180° - Angle1) / 2) - (Bar Diameter / 2) / tan((180° - (90° - Angle1)) / 2)
L4 = E - (Bar Diameter / 2) / tan((180° - (90° - Angle1)) / 2)

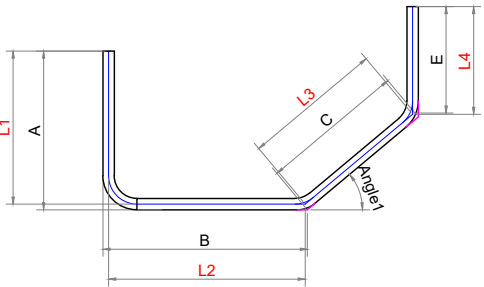




40

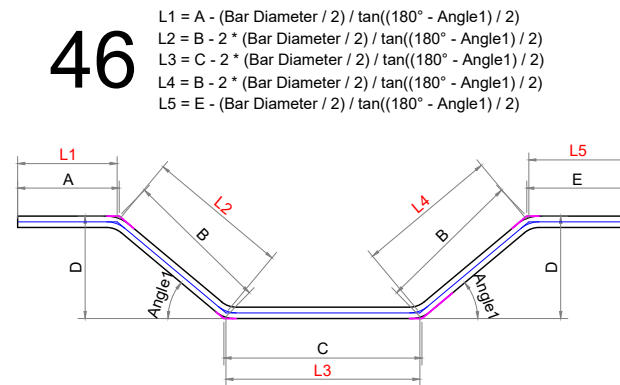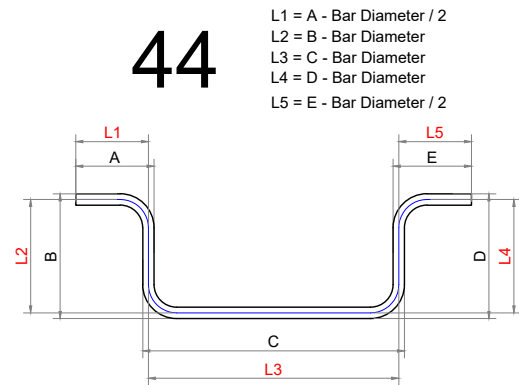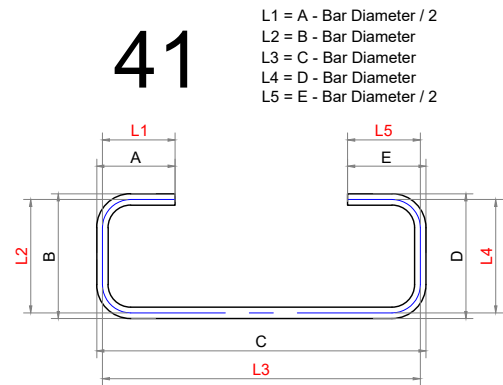


50

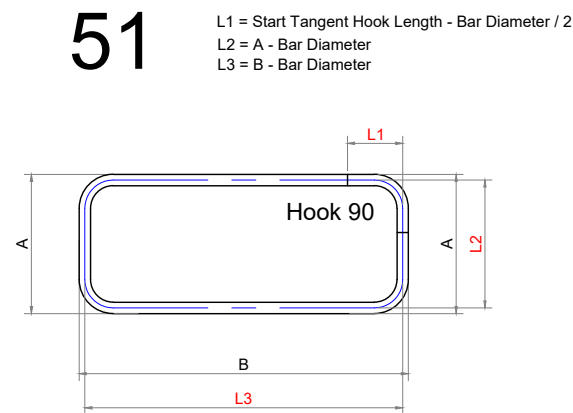


60

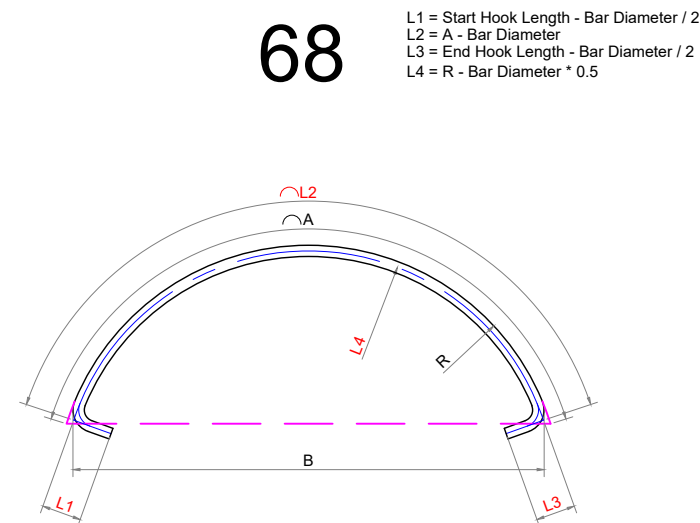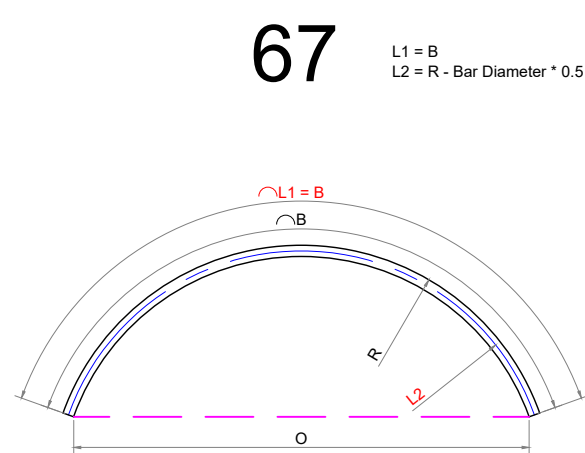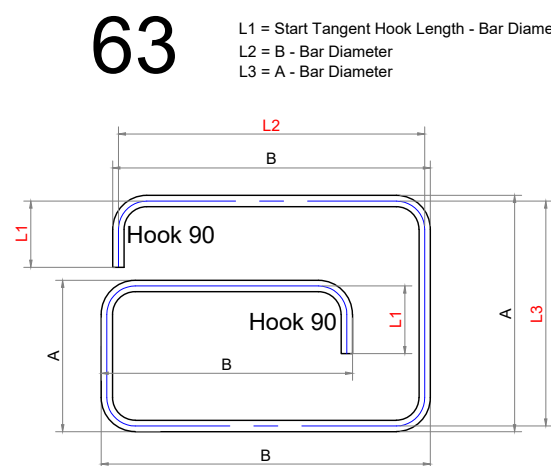

70

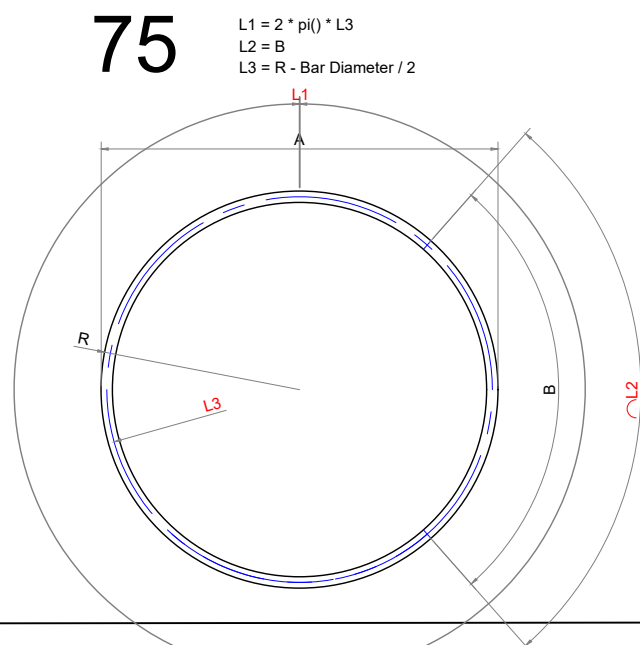


47

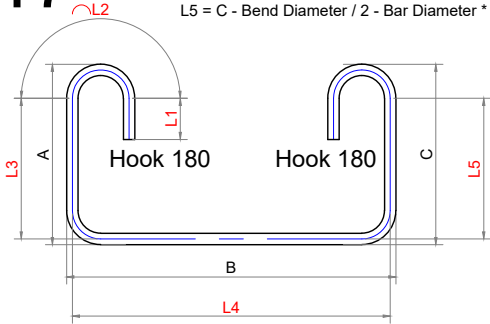


L1=End Tangent Hook Length - Bend Diameter / 2 - Bar Diameter
L2=(2 * pi() * (Bend Diameter / 2 + Bar Diameter / 2)) / 2
L3=A - Bend Diameter / 2 - Bar Diameter * 1.5
L4=B - Bar Diameter
L5 = C - Bend Diameter / 2 - Bar Diameter * 1.5

48

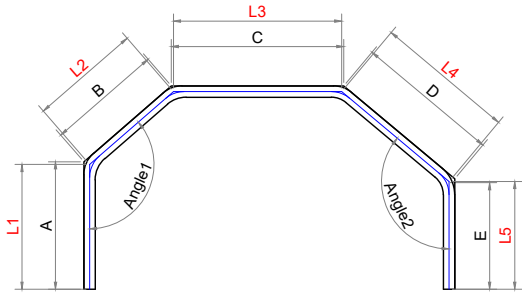

L1 = A - (Bar Diameter / 2) / tan((Angle1) / 2)
L2 = B - (Bar Diameter / 2) / tan((Angle1) / 2) - (Bar Diameter / 2) / tan((270° - Angle1) / 2)
L3 = C - (Bar Diameter / 2) / tan((270° - Angle1) / 2) - (Bar Diameter / 2) / tan((270° - Angle2) / 2)
L4 = D - (Bar Diameter / 2) / tan((Angle2) / 2) - (Bar Diameter / 2) / tan((270° - Angle2) / 2)
L5 = E - (Bar Diameter / 2) / tan((Angle2) / 2)

49

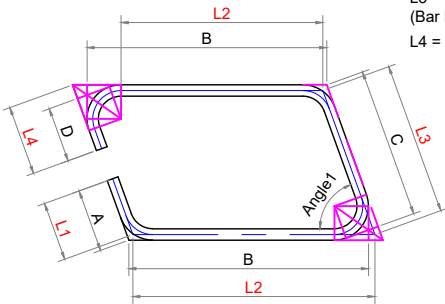

L1 = A - (Bar Diameter / 2) / tan((180° - Angle1) / 2)
L2 = B + ((Bend Diameter / 2 + Bar Diameter / 2) / (tan(Angle1 / 2)) - (Bend Diameter / 2 + Bar Diameter)) - (Bar Diameter / 2) / tan((180° - Angle1) / 2)
L3 = C + ((Bend Diameter / 2 + Bar Diameter / 2) / (tan(Angle1 / 2)) - (Bend Diameter / 2 + Bar Diameter)) - (Bar Diameter / 2) / tan((180° - Angle1) / 2)
L4 = D + ((Bend Diameter / 2 + Bar Diameter / 2) / (tan(Angle1 / 2)) - (Bend Diameter / 2 + Bar Diameter))