UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

z

Customer:	Hilton Heathwood	**Date:**	11/09/2025
Site Address:	22 Seena Pl. Heathwood Qld 4110	**Site Contact:**	Diego
		Phone:	
Customer PO #:		**Internal Job #:**	5701

Subject Line 4 PLC Issues

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 1400 XW	A-18-A11897	Line 4

Equipment condition:

Work Performed:

- Travel to site.
- Engage client to find what the issues were how if they knew how they had been addressed by maintenance staff.
- Initial fault was “PLC IP ADDRESS NOT FOUND”.
- Source spare PLC from spares.
- Whilst replacing the PLC it appeared the old PLC was not seated correctly creating a connection issue between the PLC and first card.

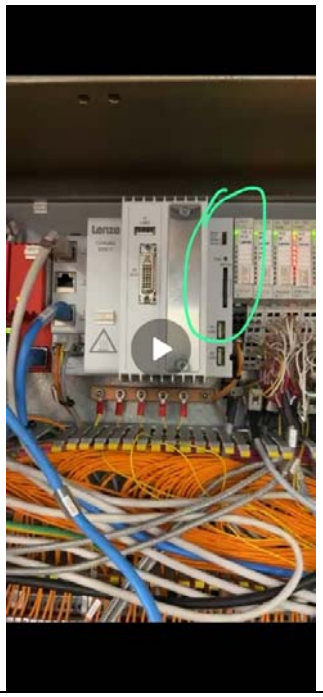

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

- Changed PLC ensuring it was installed correctly lining the slots to inter-lock the cards and PLC to create a positive connection.
- The machine was then rebooted the IP address was reached but the fault now was "ETHERCAT GATEWAY FAULT"
- We then Traced the ethernet cables and returned to the drawing specifications, in doing this we found 2 cables on unit 314 in the incorrect position, we remedied this, and the machine booted correctly.

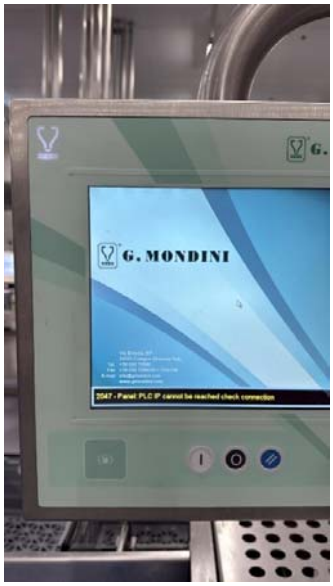

- After all faults were cleared we threaded the web finding an issue with the clamp and were able to adjust to an operational condition.

- Machine returned to production.

SPARE PARTS USED

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Part Number:	Description:	Qty:	Chargeable?	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☒	No☐
Comments: Good		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments: Clamp need to be assessed and repaired.

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

TECHNICIAN HOURS	Scott Brown	
Time	**Start**	**Finish**
Travel To Site:	7:30	8:30
Onsite:	8:30	13:00
Travel From Site:	1300	14:00
Remote assistance:	0	
Report writing:	30	
Overnight stay	☐	
Overnight stay with flights	☐	

TECHNICIAN HOURS	Jacques Jordaan	
Time	**Start**	**Finish**
Travel To Site:	7:30	8:30
Onsite:	8:30 11:30	10:00 13:00
Travel From Site:	13:00	14:00
Remote assistance:	0	
Report writing:	0	

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

Overnight stay	☐
Overnight stay with flights	☐

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Diego	X	11/9/2025
Technician:	Scott and Jacques		