UptimeEquip
Flexible Innovative Packaging Systems

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Bindaree Beef	**Date:**	19/03/2024
Site Address:	6 Taree st Burliegh heads	**Site Contact:**	Joey Brown
		Phone:	0497622424
Customer PO #:		**Internal Job #:**	4439

Subject: Film Break issue Large tool

Equipment Type:	**Serial Number:**	**Customer Line # (if applicable):**
Trave 590 XL	A/21/A-12629	Line 2
Equipment condition:	Good	

Work Performed: film breaking repair

Travelled to site for film break issue

- Arrived on site line running small tool no film issues
- Waited for large tool change over 10am
- Film is curling badly and is old and water loged

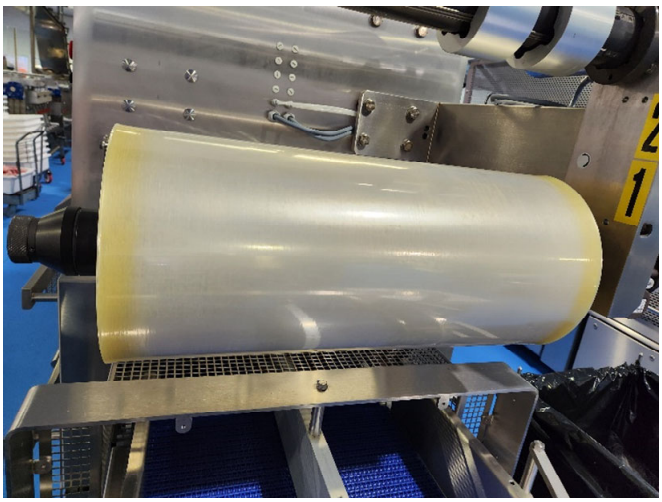

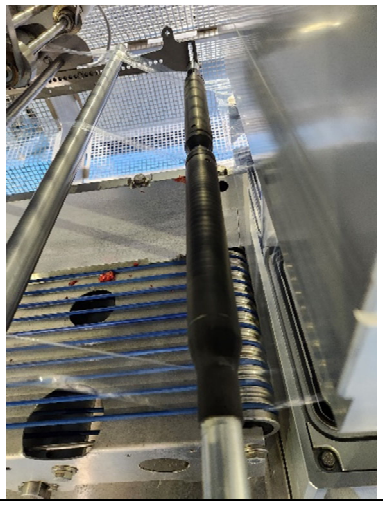

- Exit film roller lowered to separate film from tool better
- Aligned and reset cone and spacers as film due to curl was rolling up in gaps and causing film to break or fold and cut badly
- After

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

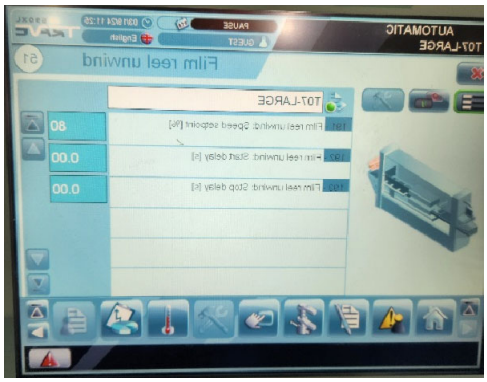

- after slowing down film unroll film settled down and worked correctly
- Left site as film and been running for 20minuites well

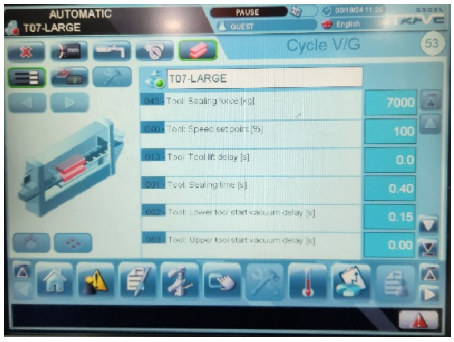

- Returned to site as film was now breaking in the centre of tool during cycle
- Film was removed due to also being corrogated

- To get film working I had to lower the gas set point from 1080 to 1040 causing tray bubble to lower
- We have to compenstate for the fact that meat is at least 5 mm hihger than tray
- Adjusted lower tool vacuum delay from .15 to .05 to allow film to hold to top tool
- Adjusted top air pressure to accommodate lower gas pressure to even out gas in tray and allow an even bubble

5 mm ocord needs to be replaced as soon as it is ordered and received

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

UptimeEquip
Flexible Innovative Packaging Systems

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

STATUS		
Machine Tested?	Yes☐	No☐
Comments:		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**
28ORCORD5	5mm o cord	20m

TECHNICIAN HOURS					
Time	**Start**	**Finish**		**Start**	**Finish**
Travel To Site:	06:30	07:30			
Onsite:	07:30	17:30			
Travel From Site:	17:30	18:30			
Report time	Hours				
	0.5 hours				

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Joey Brown	X _____	19/03/2024
Technician:	Paul Short		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au