UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Hilton Food Australia	**Date:**	23/09/2025
Site Address:	22 Seeana place Heathwood QLD 4110	**Site Contact:**	Niyomy Rasanayagam
		Phone:	0425400020
Customer PO #:		**Internal Job #:**	5710

Subject: Line 2 – Supporting sealedAir/Hilton with the testing of the VST 211 film issue

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 590 XL	A18-A11895	Line 2

Equipment condition:

Work Performed:

- Last day onsite for SealedAir at the Hilton site.
- Matteo Mapelli from SealedAir arrived in the morning with three new film reels, specifically organised for additional checks and confirmation of the film materials supplied.
- Upon arriving at the site, since the line 2 was only available from 11:00, I assisted the maintenance team in rebuilding the shuttle for line 1.
- Several damaged parts were identified, including a shuttle plate holding block, a worn plate hole thread, a broken plate pin and a broken PT100 probe. All were replaced using a spare shuttle from line 19 and a spare probe from the Modula.

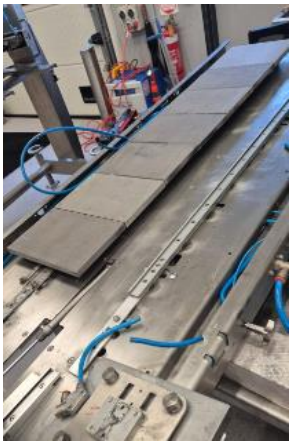
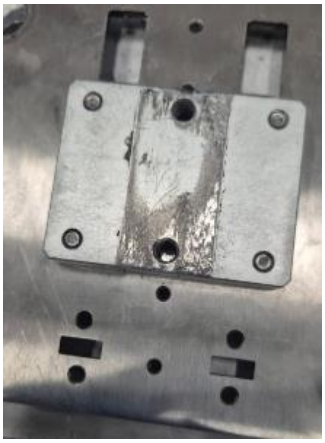

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

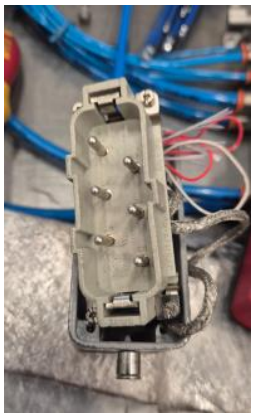

- Once the rebuild was completed, the shuttle was successfully tested in production
- With line 2 available, we began testing the three reels delivered earlier in the morning.
- The results confirmed the trays were sticking to the top tool, providing SealedAir with a clear indication of which production line the materials originated from.
- Additional testing was carried out to assess whether the Mondini machine could be adjusted to handle these materials.
- Several adjustments were attempted, including adding extra vacuum during the lowering of the tool and applying additional air pressure to the sealing bar domes. Unfortunately, all this did not deliver the expected results.

- SealedAir will conduct extra testing at Hilton Truganina in the next couple days

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

STATUS		
Machine Tested?	Yes☒	No☐
Comments: Good		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:

RECOMMENDED SPARE PARTS		
Part Number:	**Description:**	**Qty:**

TECHNICIAN HOURS	Paolo	
Time	**Start**	**Finish**
Travel To Site:	09:30	10:30
Onsite:	10:30	16:30
Travel From Site:	16:30	17:30
Remote assistance:	0	
Report writing:	30 Min	
Overnight stay	☐	
Overnight stay with flights	☐	

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**
Customer:	Niyomy Rasanayagam	X _____	23/09/2025
Technician:	Gianpaolo Orisio		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au