COPYRIGHT © 1993 by BOMARC SERVICES P.O. BOX 1113 CASPER, WYOMING 82602

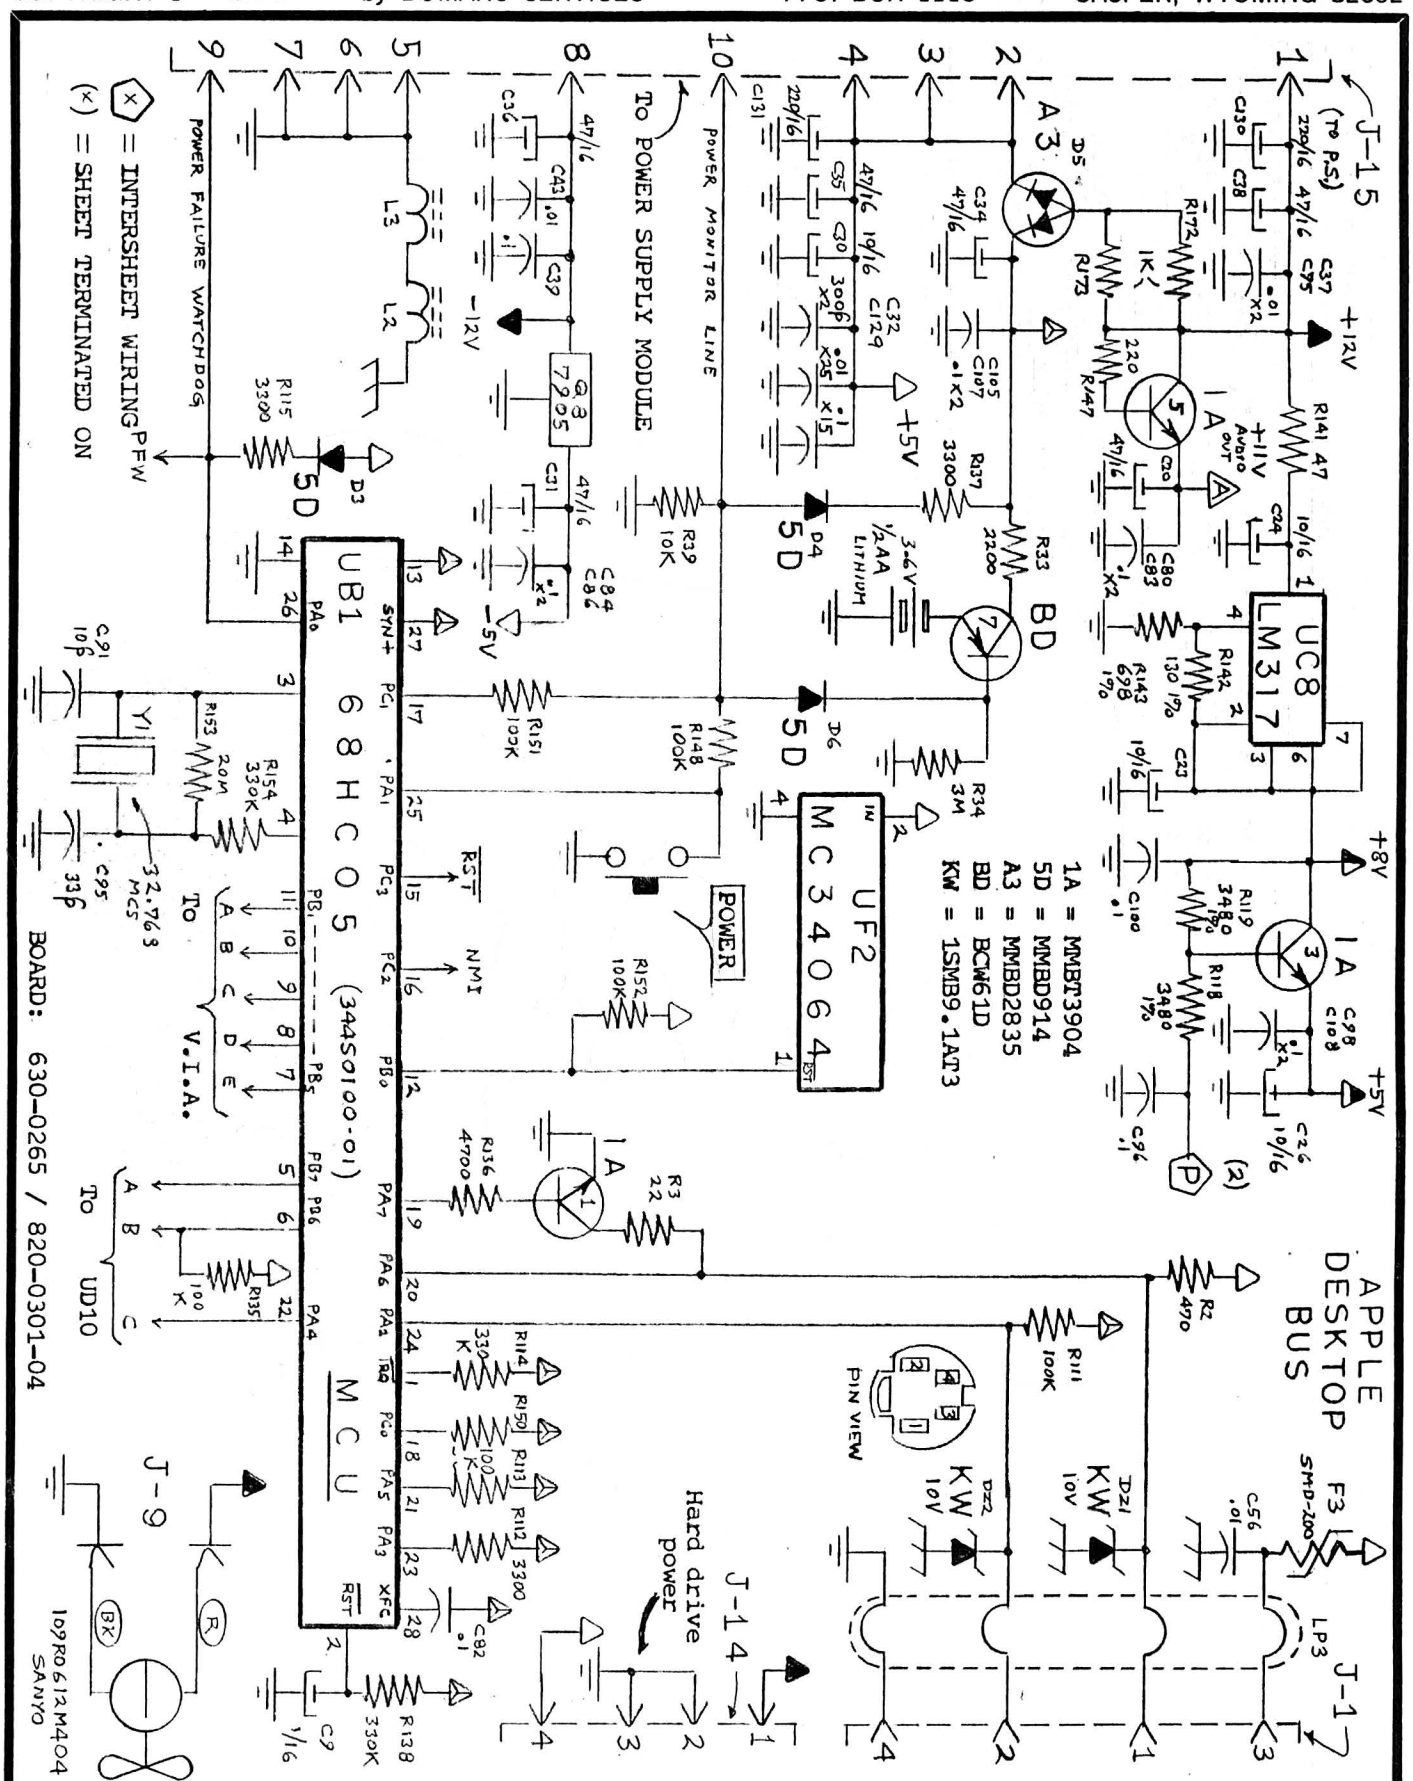

POWER SUPPLY SECTION / A.D.B. PORT		sheet 1 of 6	
A P P L E	"MacINTOSH IIsi"	COMPUTER LOGIC BOARD)820-0301-04(	1/26/93-

UNIT DRAWN PROVIDED COURTESY OF "ON-TIME MAC SERVICE"

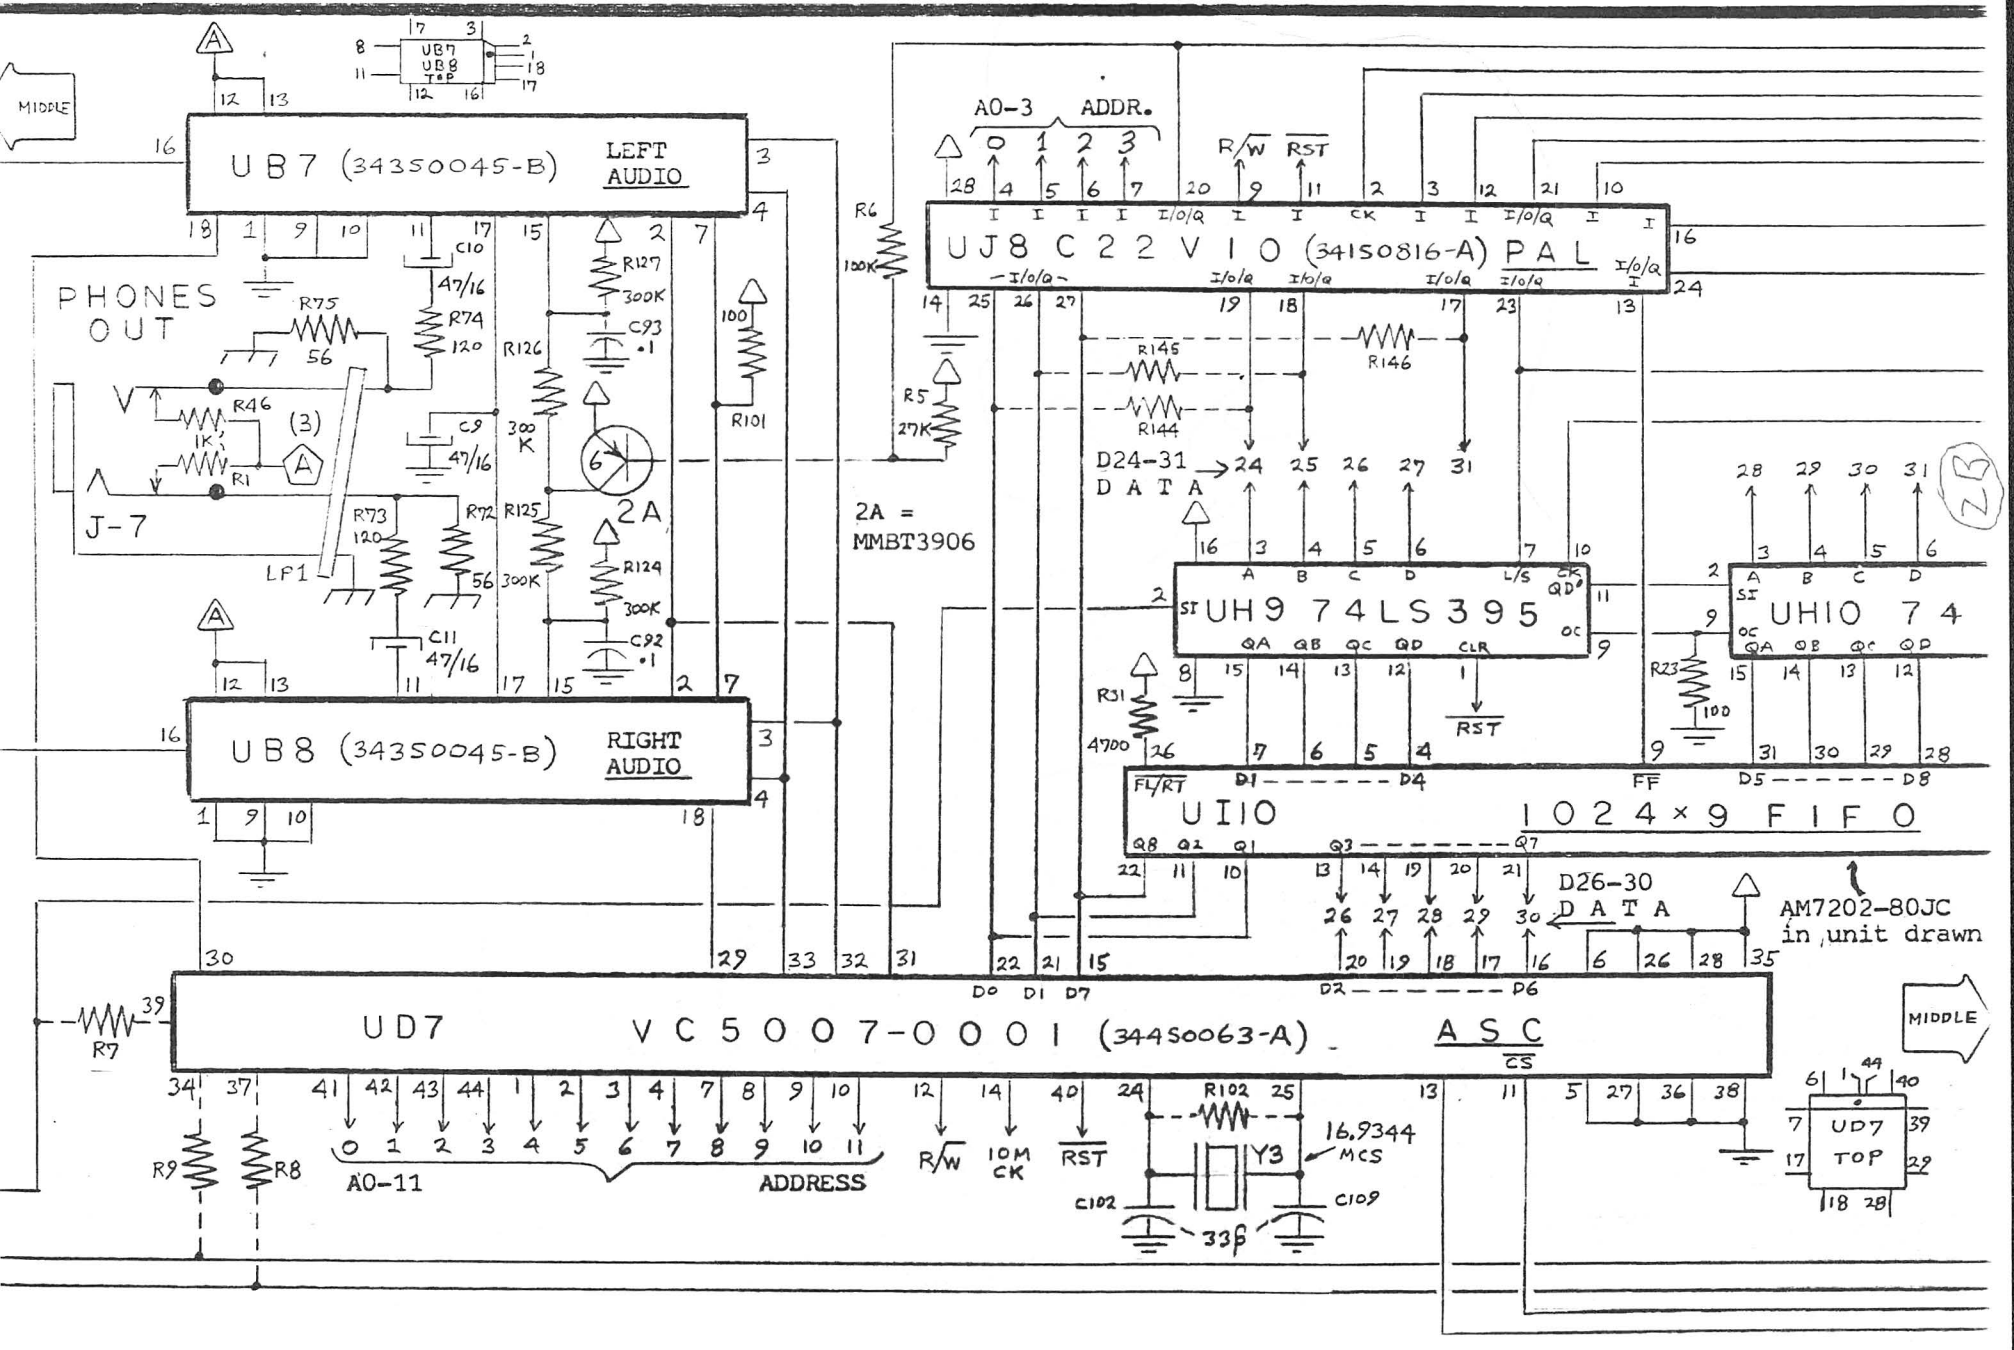
UB7 (34350045-B) LEFT AUDIO
UB8 (34350045-B) RIGHT AUDIO
UB7 UB8 TOP
PHONES OUT
J-7
LF1
R75 56
R74 120
R46 1K
R1
C10 47/16
C9 47/16
C11 47/16
R73 120
R72 56
R126 300K
R125 300K
R124 300K
R127 300K
C93 .1
C92 .1
R101 100
2A
2A = MMBT3906
R6 100K
R5 27K
UJ8 C22V10 (34150816-A) PAL
A0-3 ADDR.
R/W RST
R145
R144
R146
D24-31 DATA
UH9 74LS395
UH10 74
R31 4700
R23 100
RST
FL/RT
UI10 1024×9 FIFO
D0-D8
D26-30 DATA
AM7202-80JC in unit drawn
UD7 VC5007-0001 (34450063-A) ASC
R7
R9
R8
A0-11 ADDRESS
R/W
10M CK
RST
R102
Y3 16.9344 MCS
C102 33p
C109
UD7 TOP
MIDDLE
MIDDLE
2B

I.C.	TYPE	△	⏚
UG9	74 LS 393	14	7

R164 22

20M CK

A4 A5 A10 A11 R/W

SEL ASC (6)

UJIO 16R4 (34150815-A) PAL

R155

R32 100

10 7 16 CK L/S S395 CLR 1 8 RST

23 18 32 XO/HF R RS 25

W 2 D9 3 XT 8 16

UG9

RIGHT

UI10 TOP

10M CK

UE9 C22V10 (34150817-A) PAL

R20 47

R18 100

SEL ASC

(6)

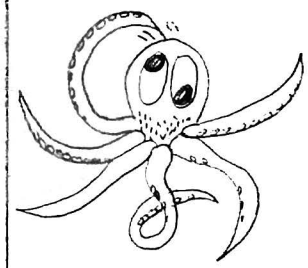

AUDIO SIGNAL PROCESSING SECTION | sheet 2 of 6 | COMPUTER LOGIC BOARD 820-0301-04(| 1/29/93- | APPLE "MacINTOSH IIsi"

COPYRIGHT © 1993 by BOMARC SERVICES P.O. BOX 1113 CASPER, WYOMING 82602

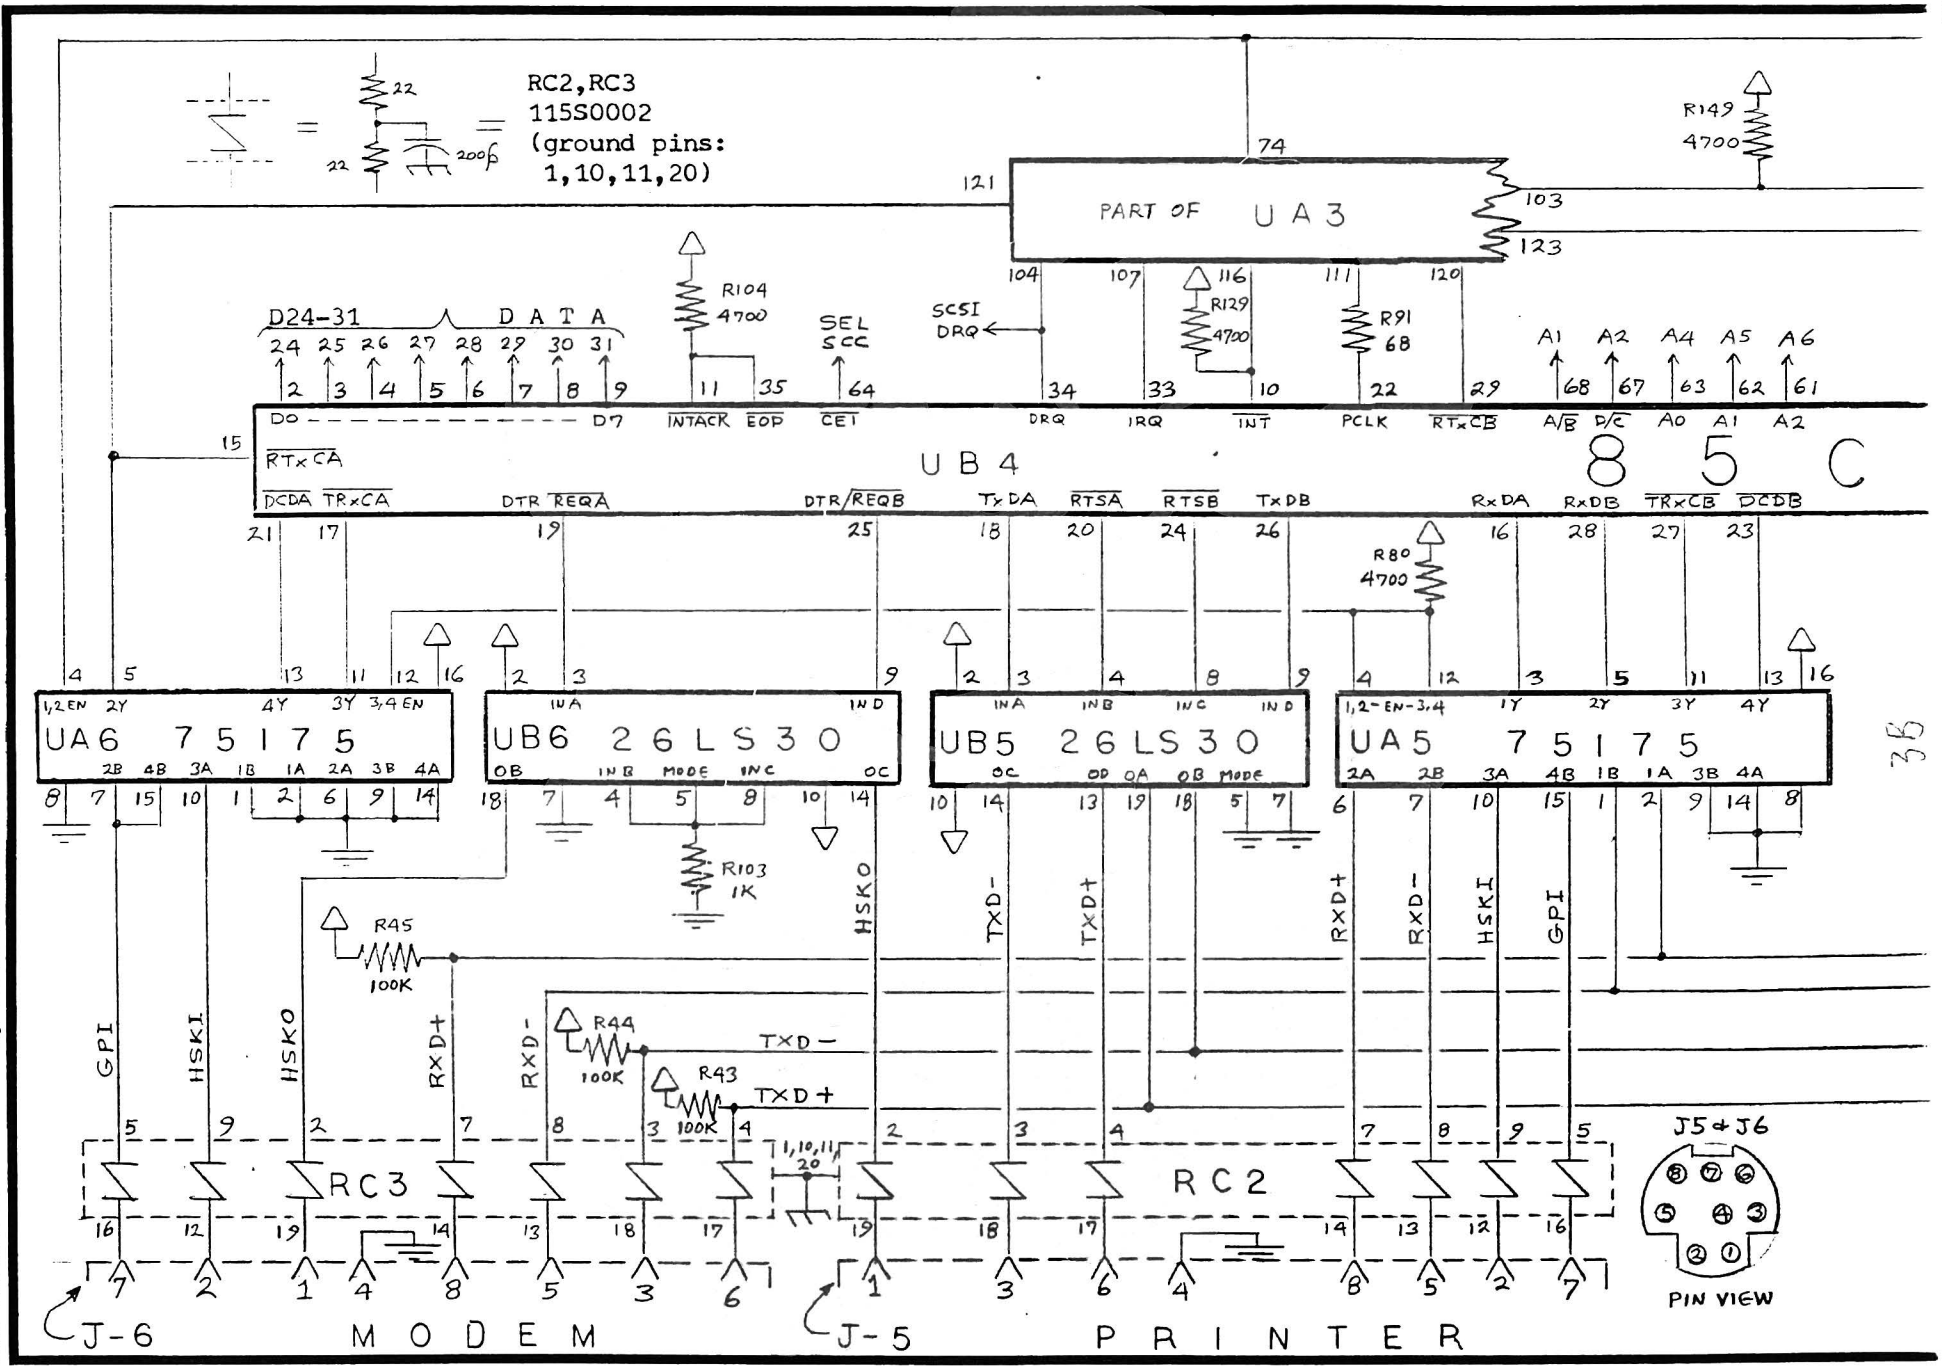

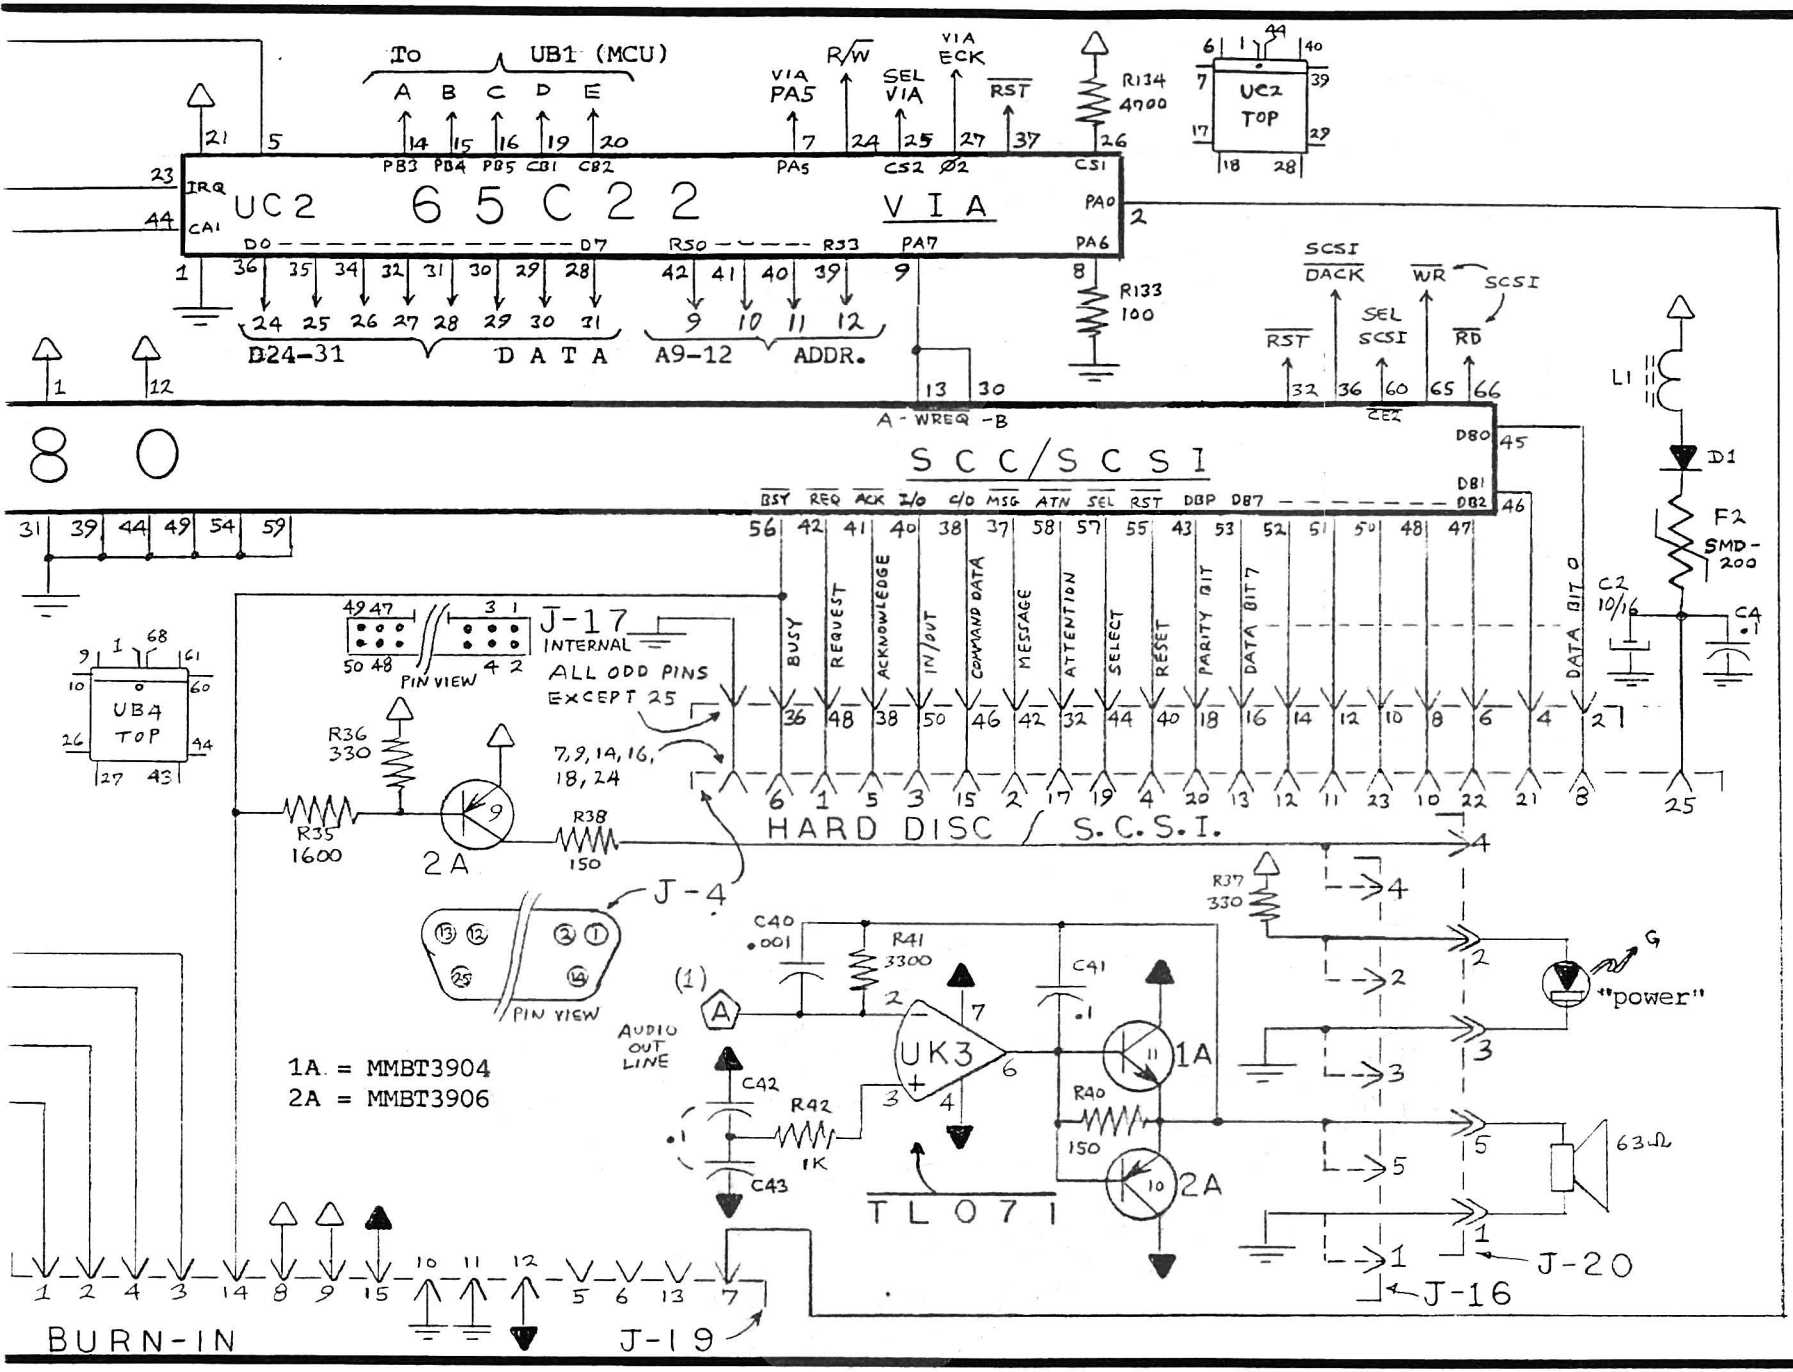

APPLE | "MacINTOSH IIsi" | COMPUTER LOGIC BOARD 820-0301-04(| sheet 3 of 6 | MODEM, PRINTER, S.C.S.I. PORTS CONTROL / AUDIO OUTPUT | 1/24/93-

34

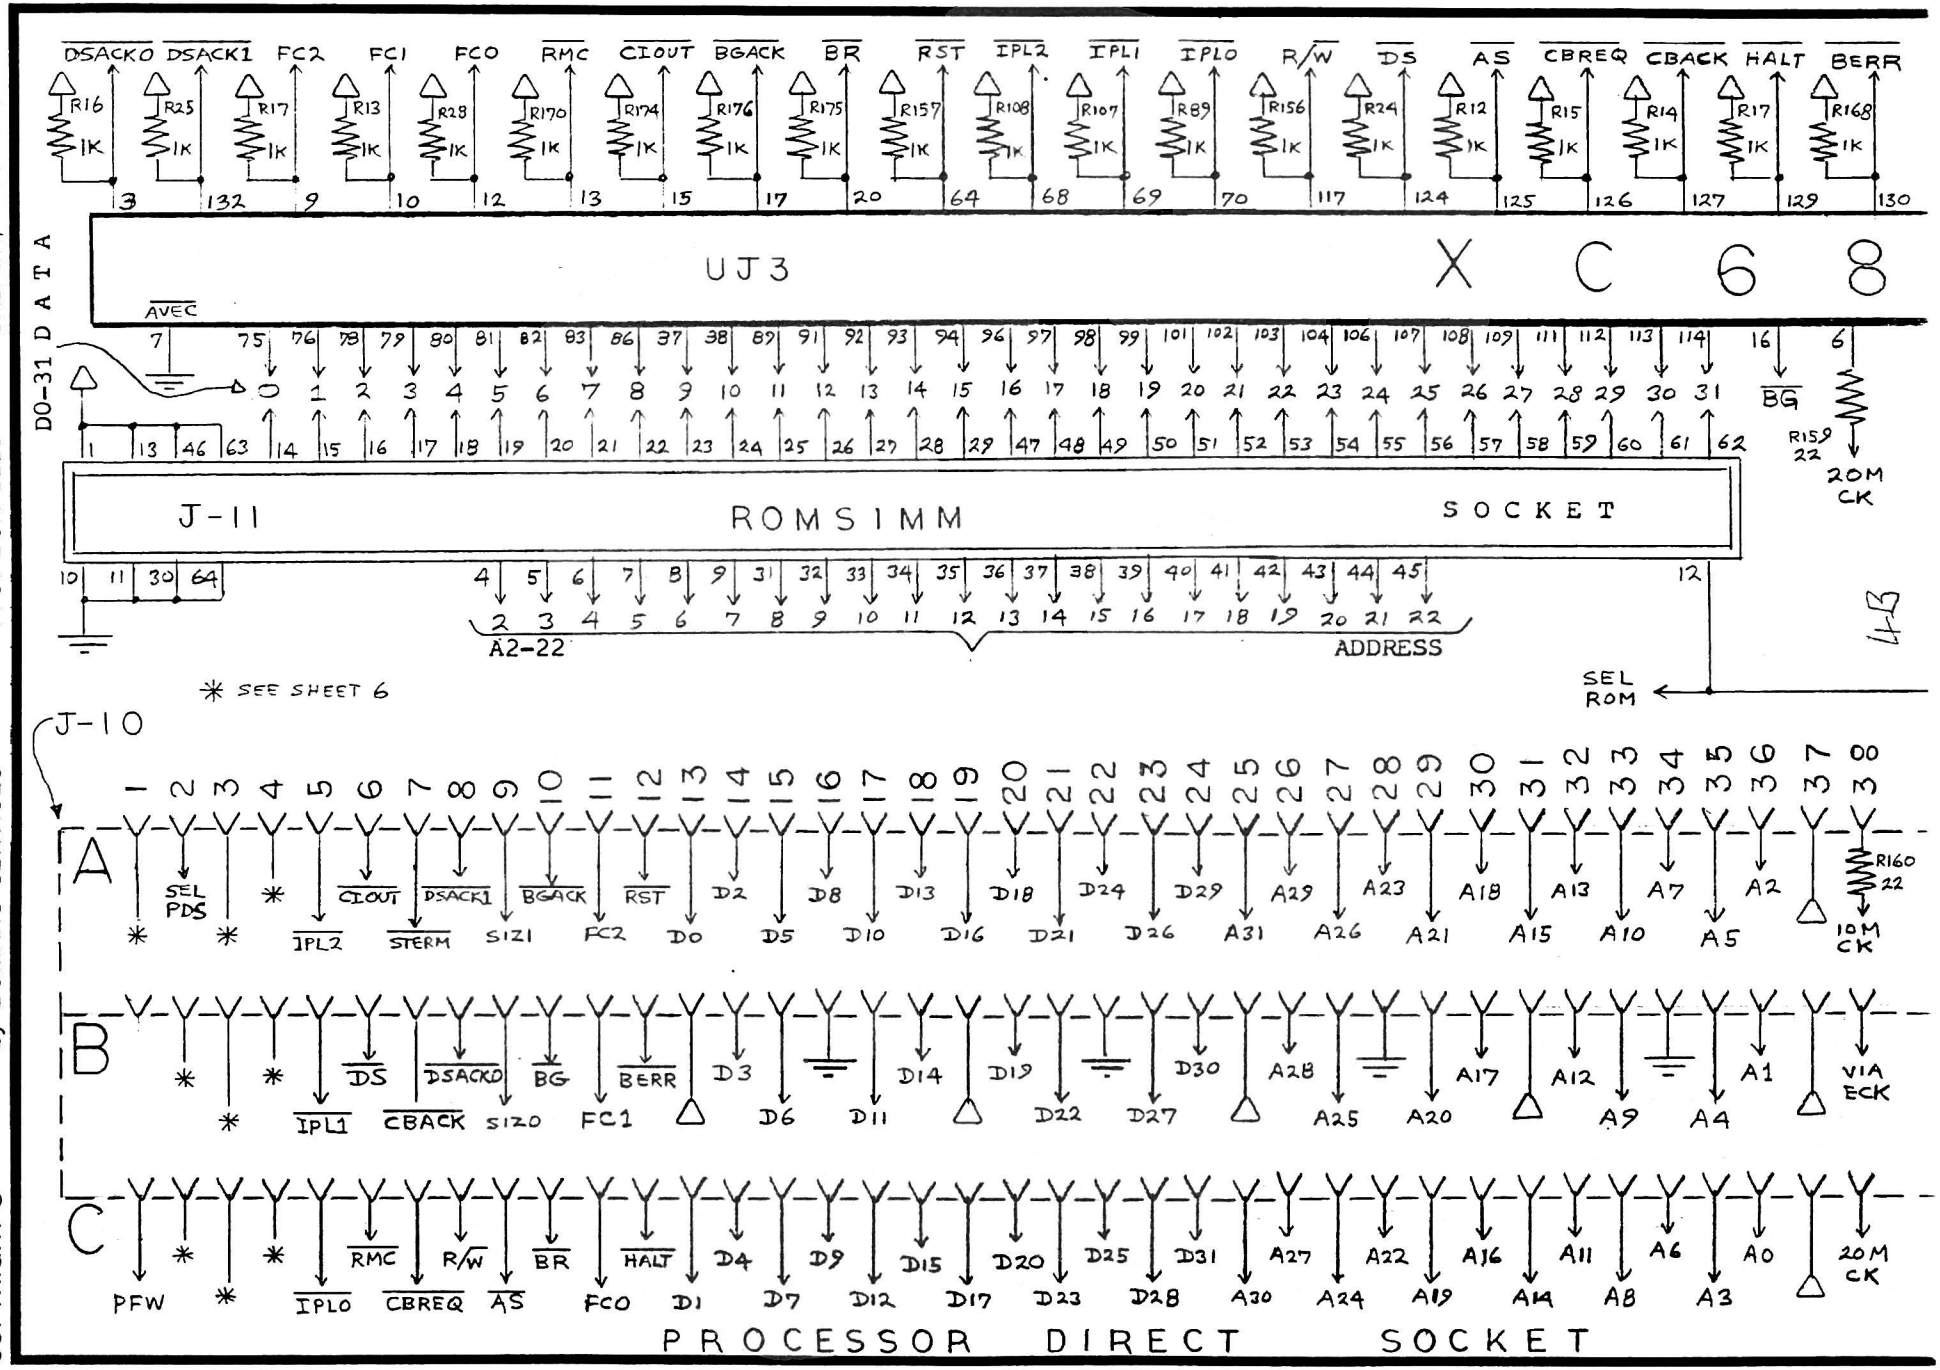

COPYRIGHT © 1993 by BOMARC SERVICES P.O. BOX 1113 CASPER, WYOMING 82602

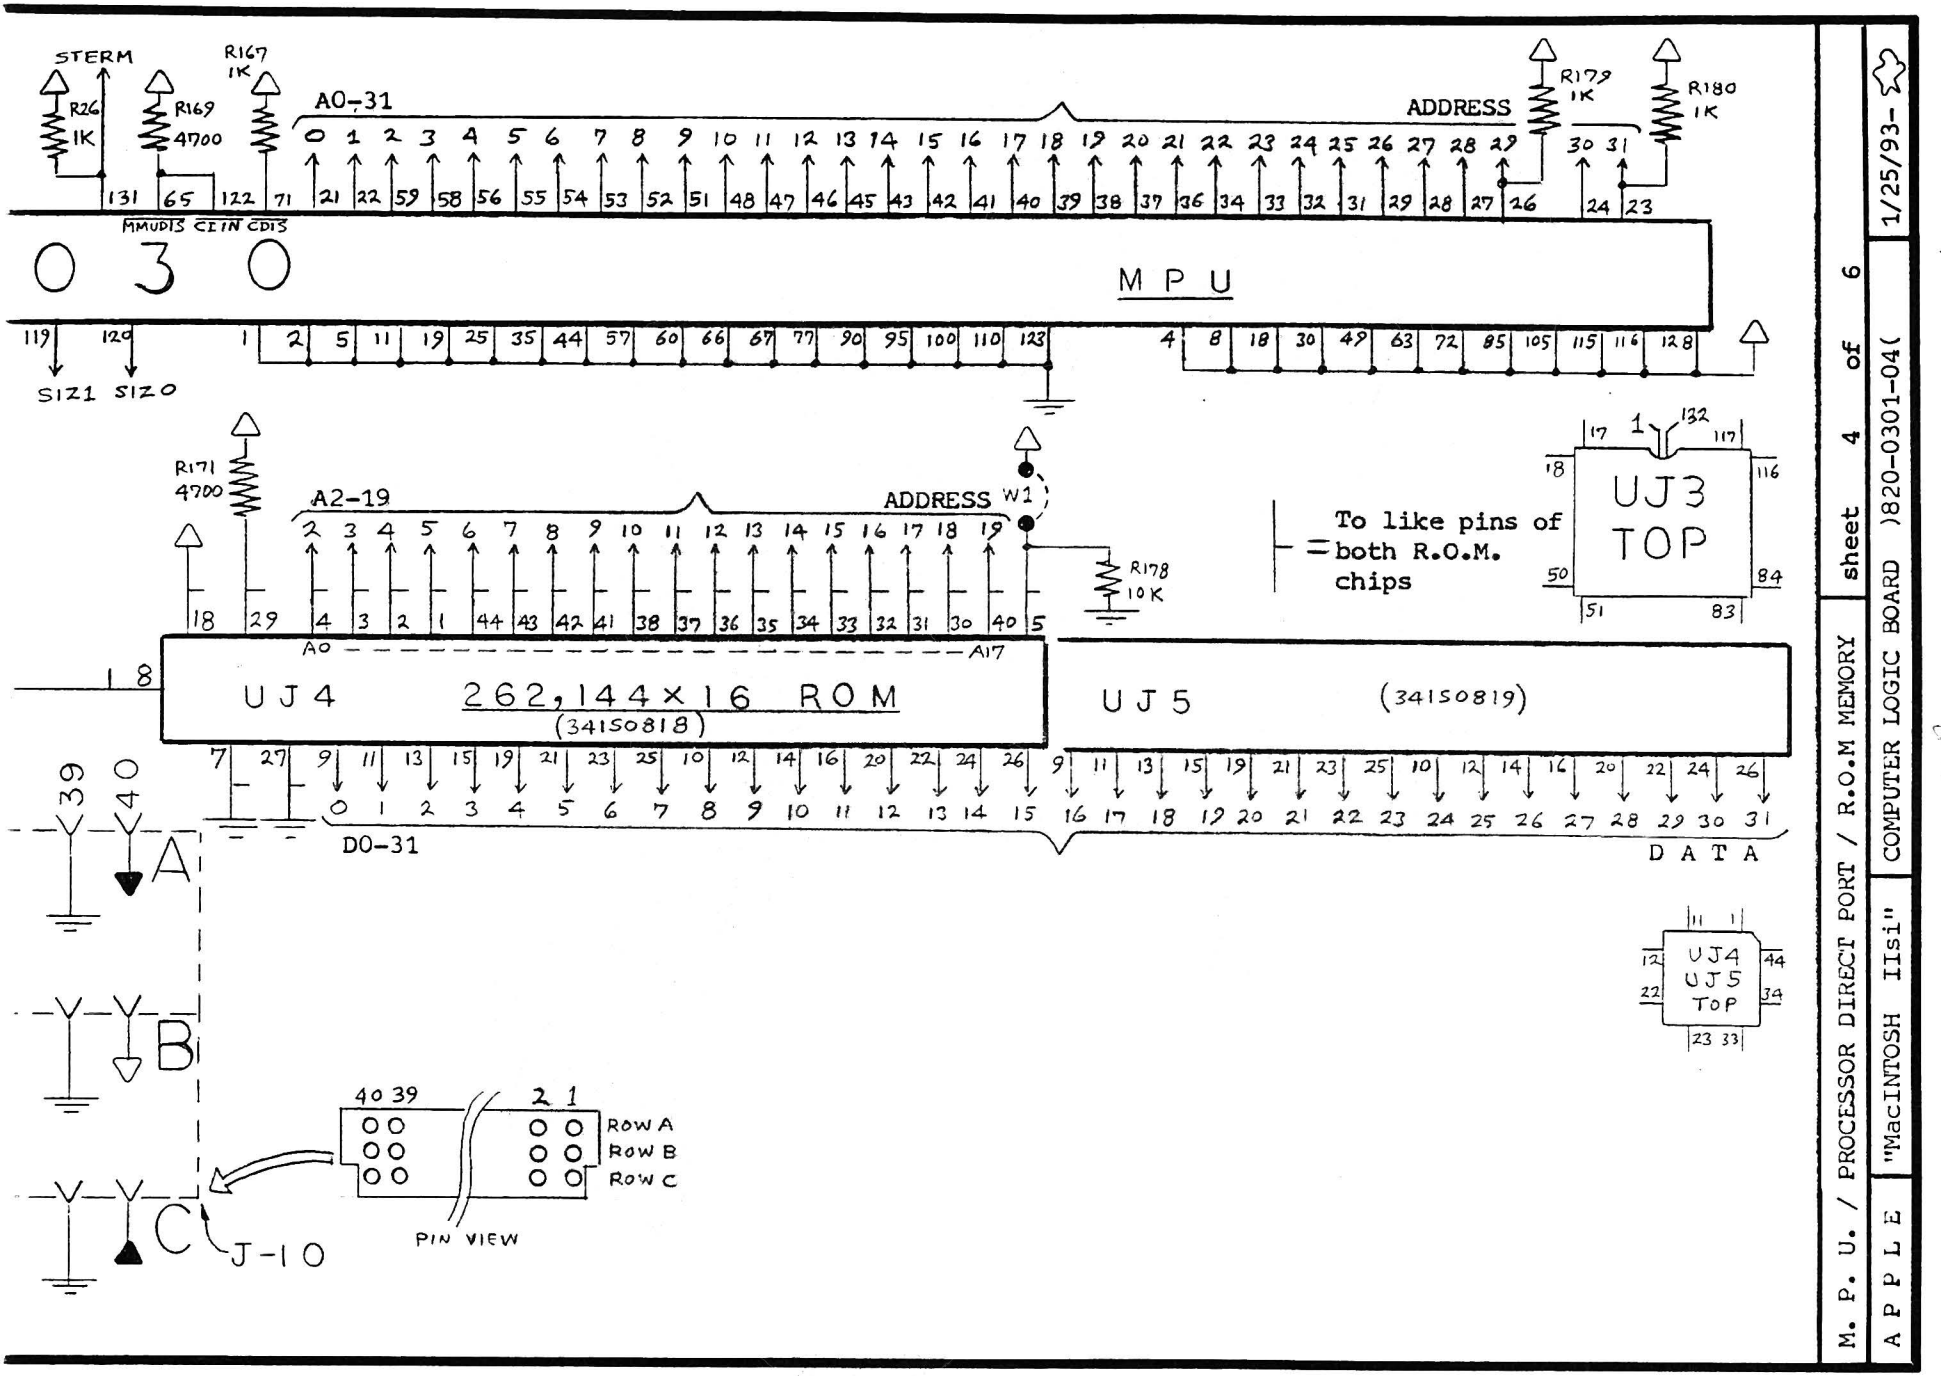

M. P. U. / PROCESSOR DIRECT PORT / R.O.M MEMORY

APPLE "MacINTOSH IIsi" COMPUTER LOGIC BOARD 820-0301-04(sheet 4 of 6 1/25/93-

4

COPYRIGHT © 1993 by BOMARC SERVICES P.O. BOX 1113 CASPER, WYOMING 82602

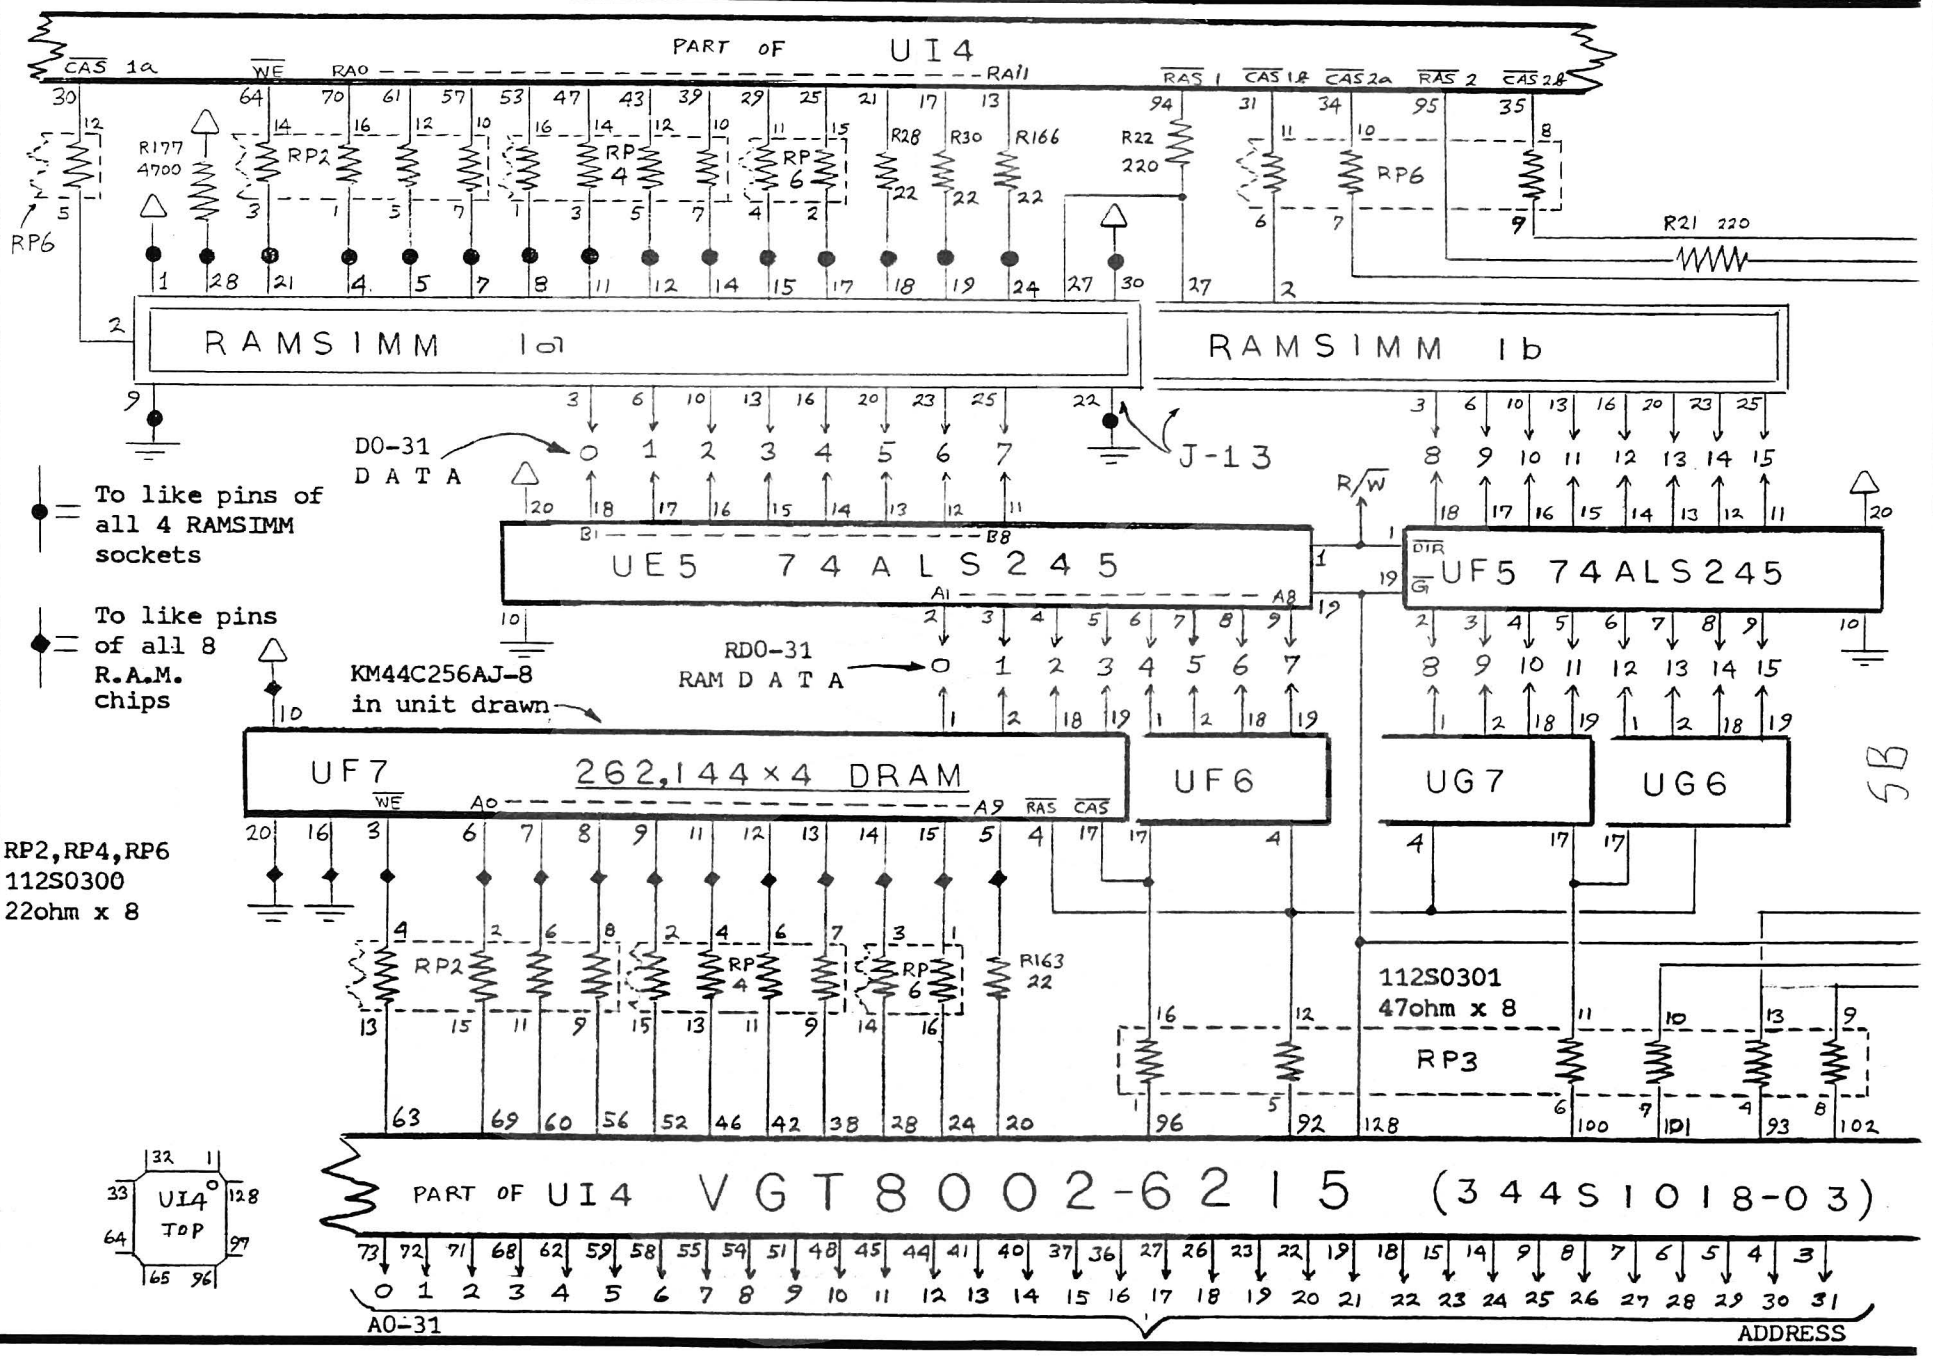

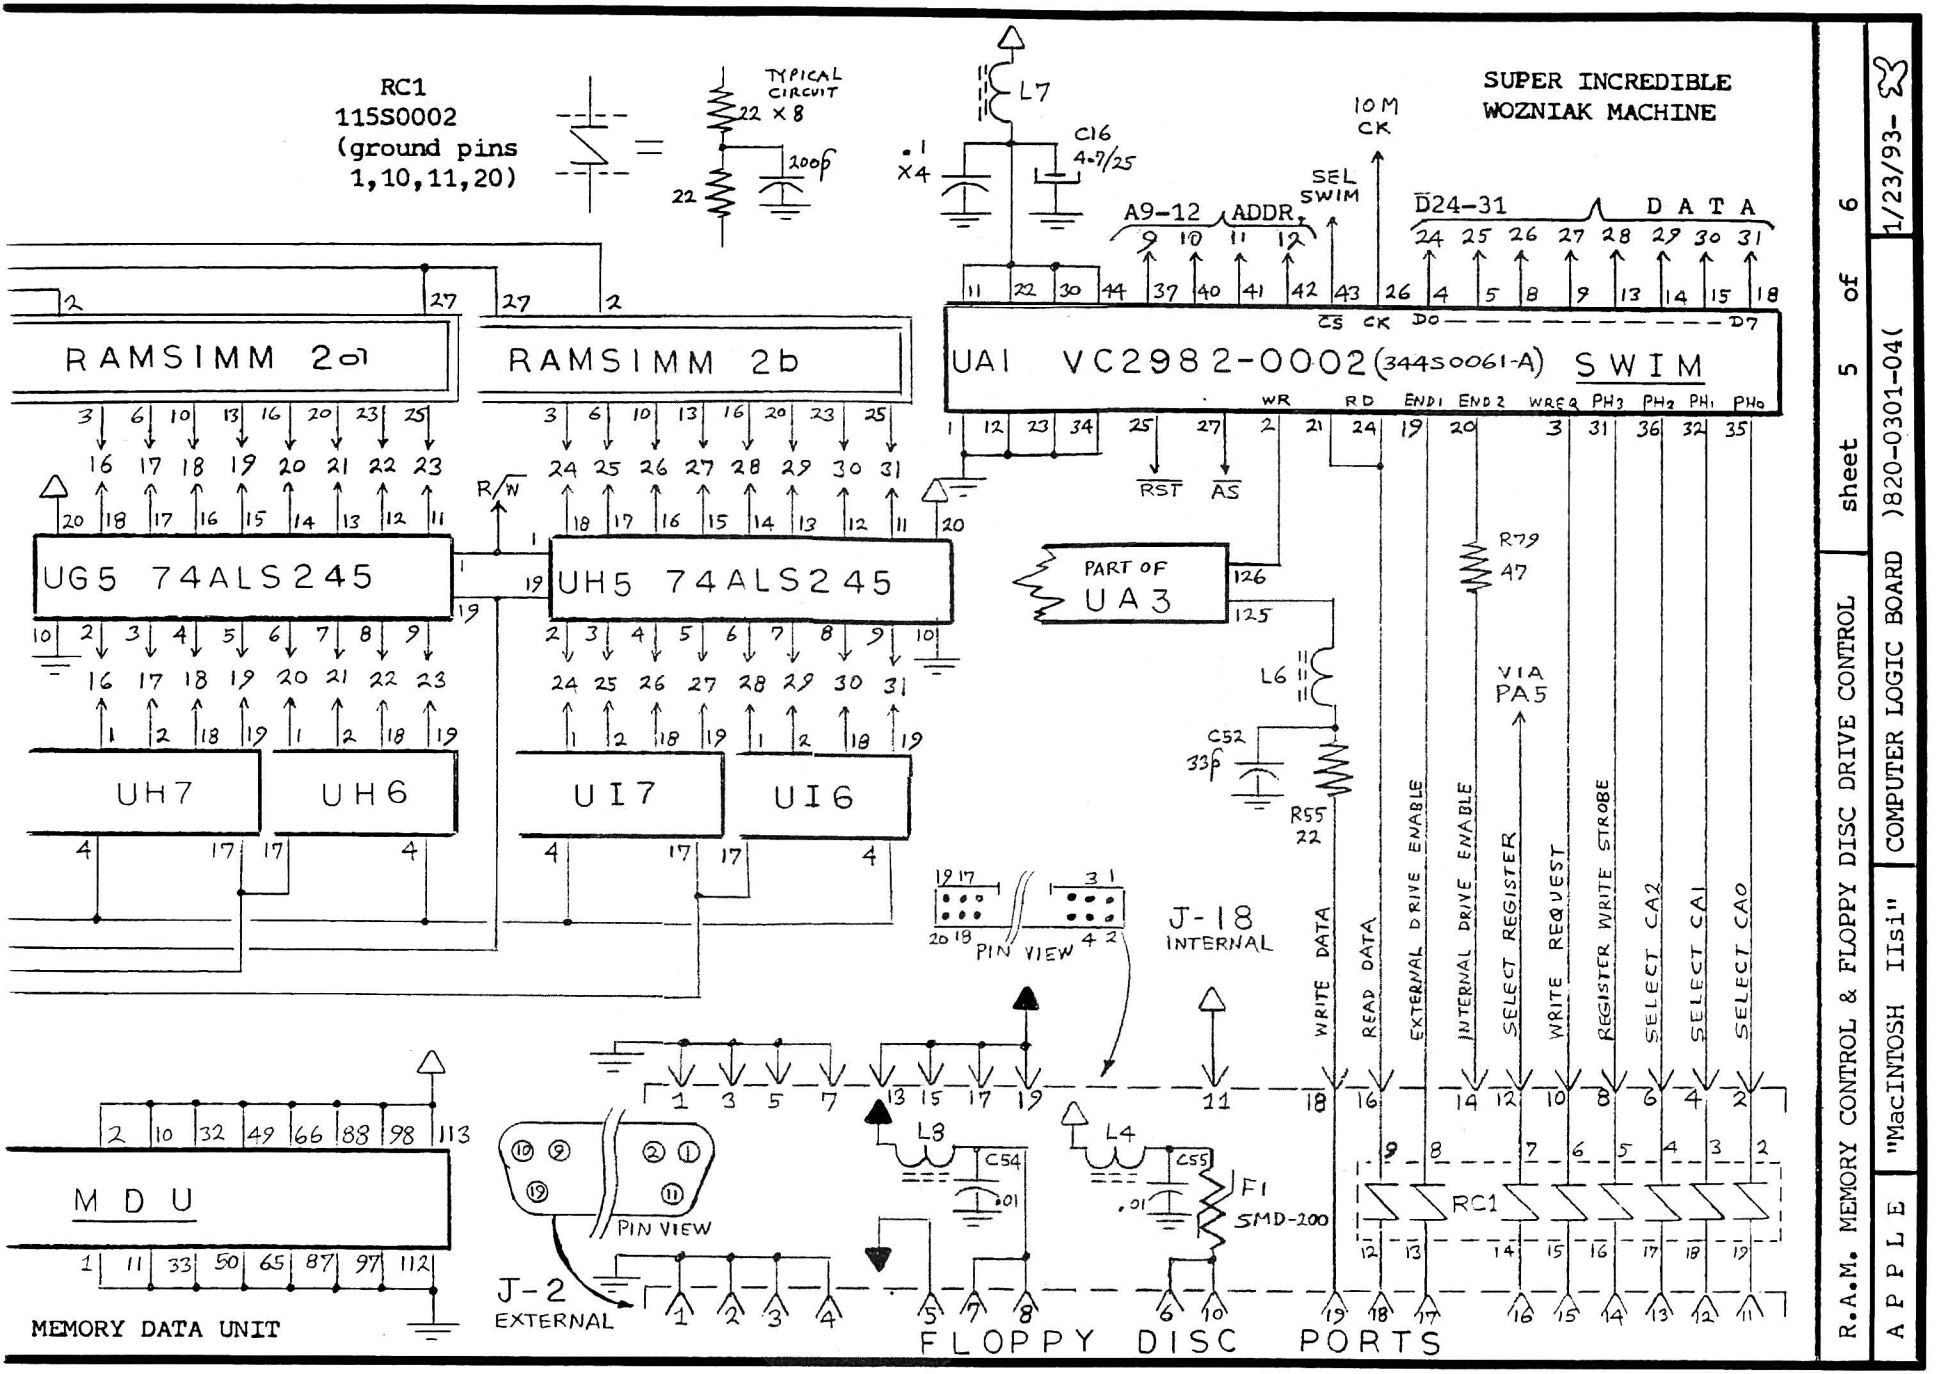

R.A.M. MEMORY CONTROL & FLOPPY DISC DRIVE CONTROL | sheet 5 of 6 | 1/23/93-

APPLE | "MacINTOSH IIsi" | COMPUTER LOGIC BOARD 820-0301-04(

54

COPYRIGHT © 1993 by BOMARC SERVICES P.O. BOX 1113 CASPER, WYOMING 82602

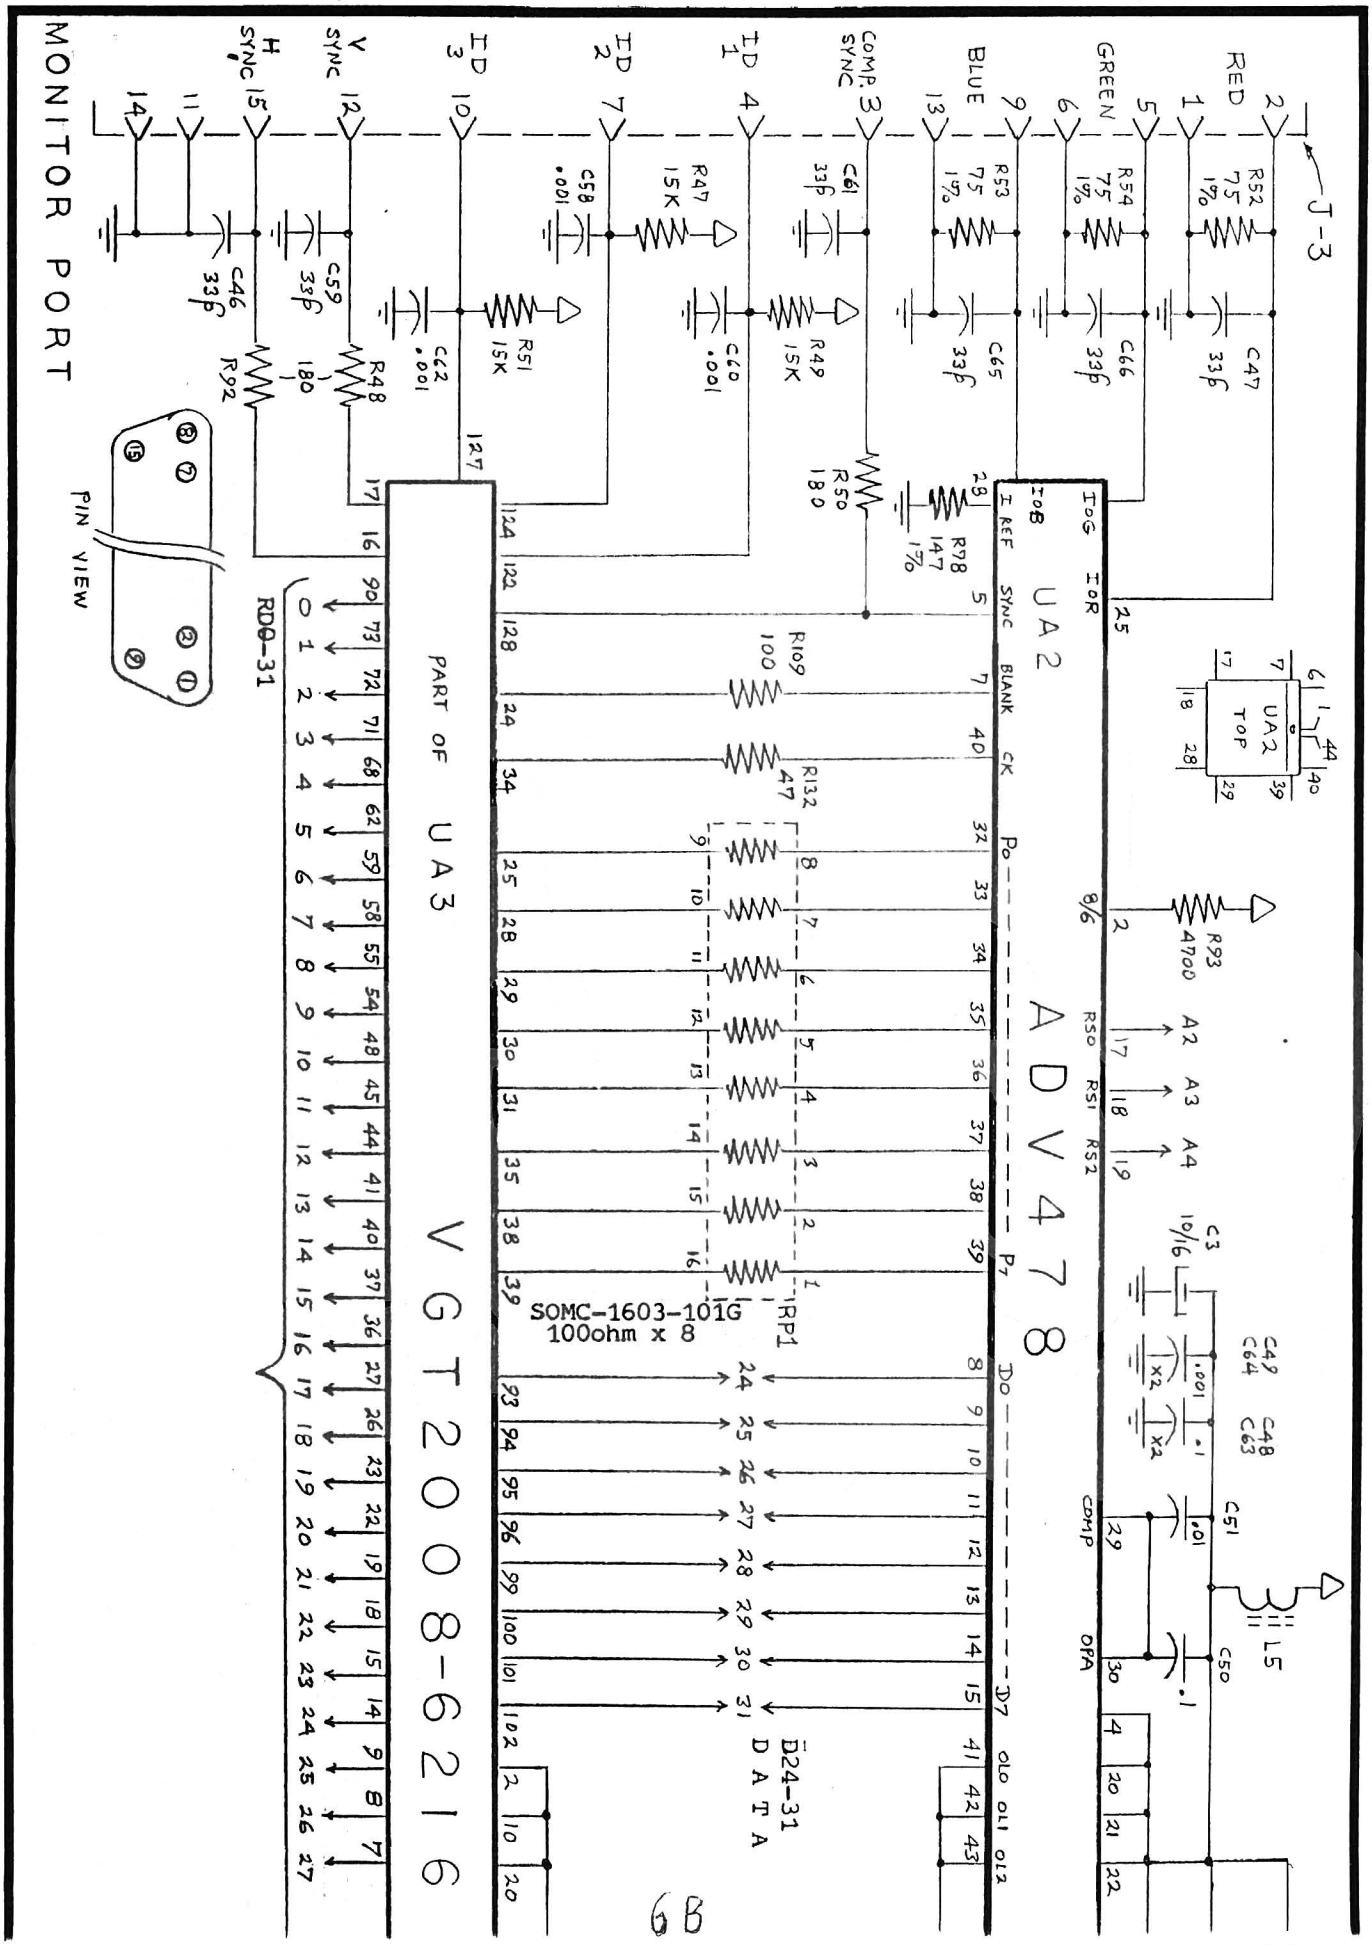

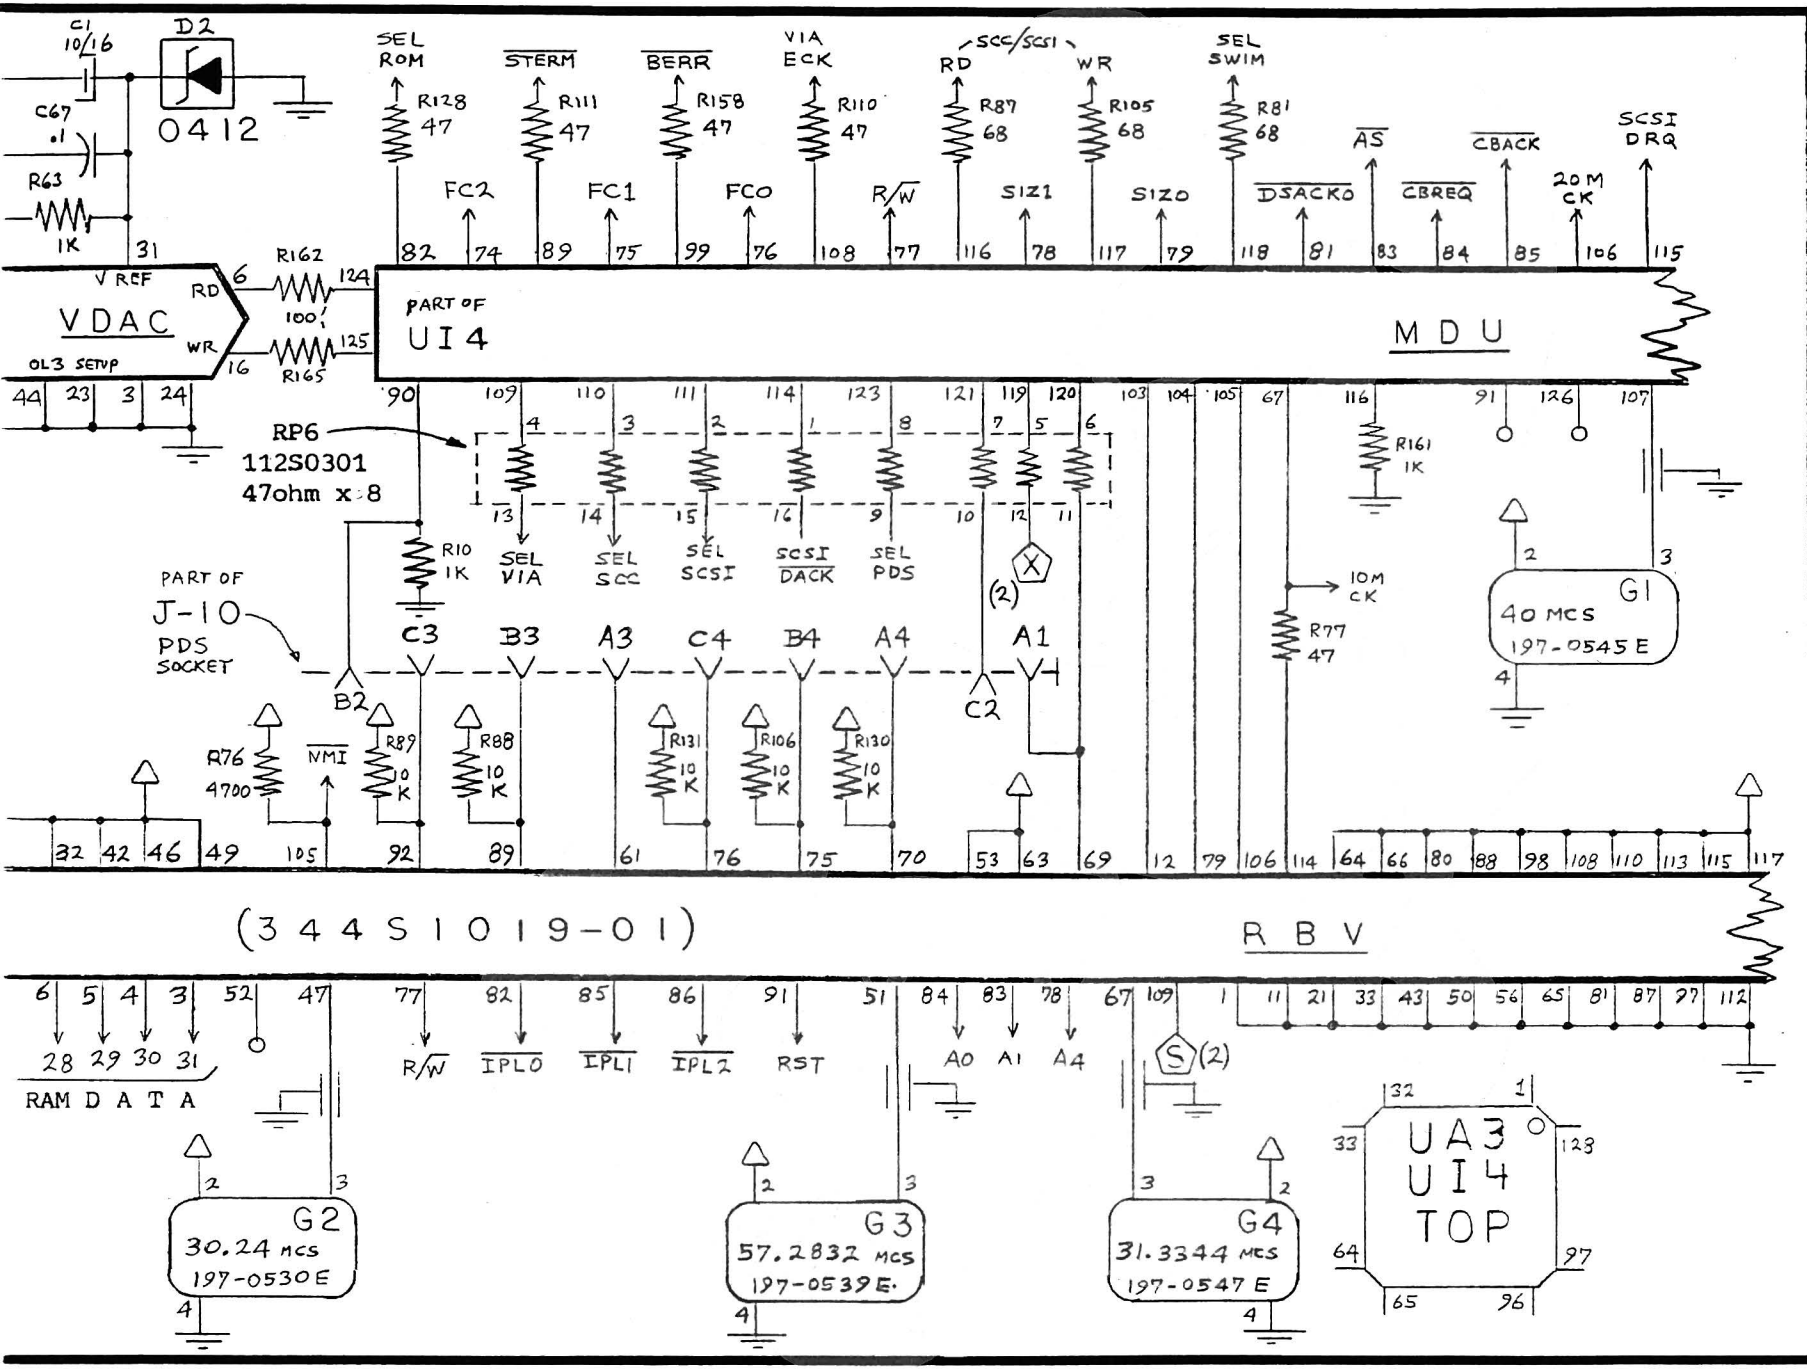

VIDEO PORT / CLOCK / GATE ARRAY SECTIONS | sheet 6 of 6 | COMPUTER LOGIC BOARD 820-0301-04(| 1/22/93- | APPLE "MacINTOSH IIsi"

6A

COPYRIGHT © 1993 by BOMARC SERVICES P.O. BOX 1113 CASPER, WYOMING 82602

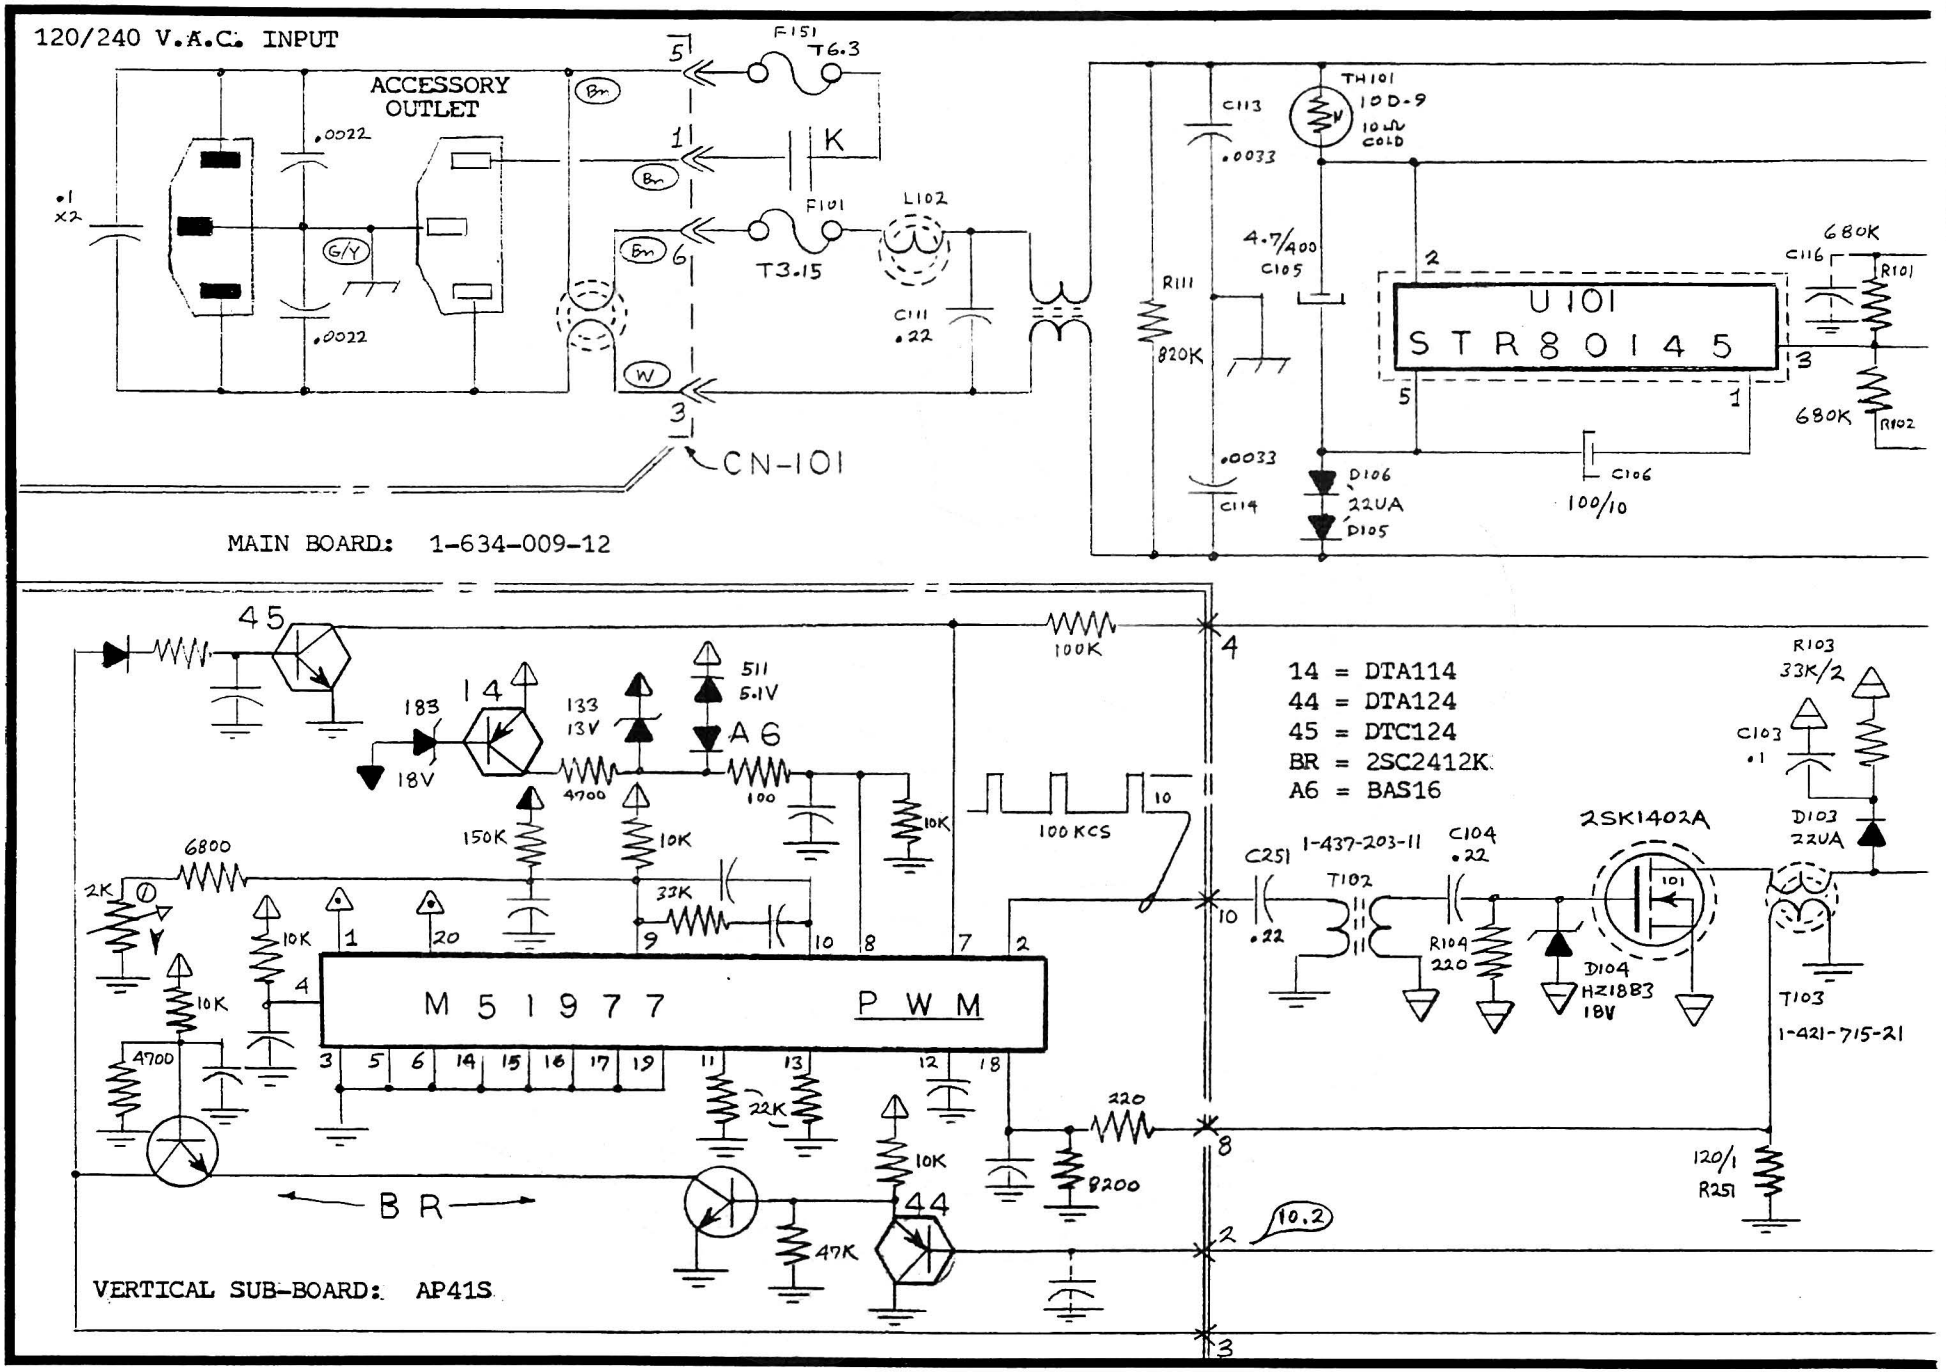

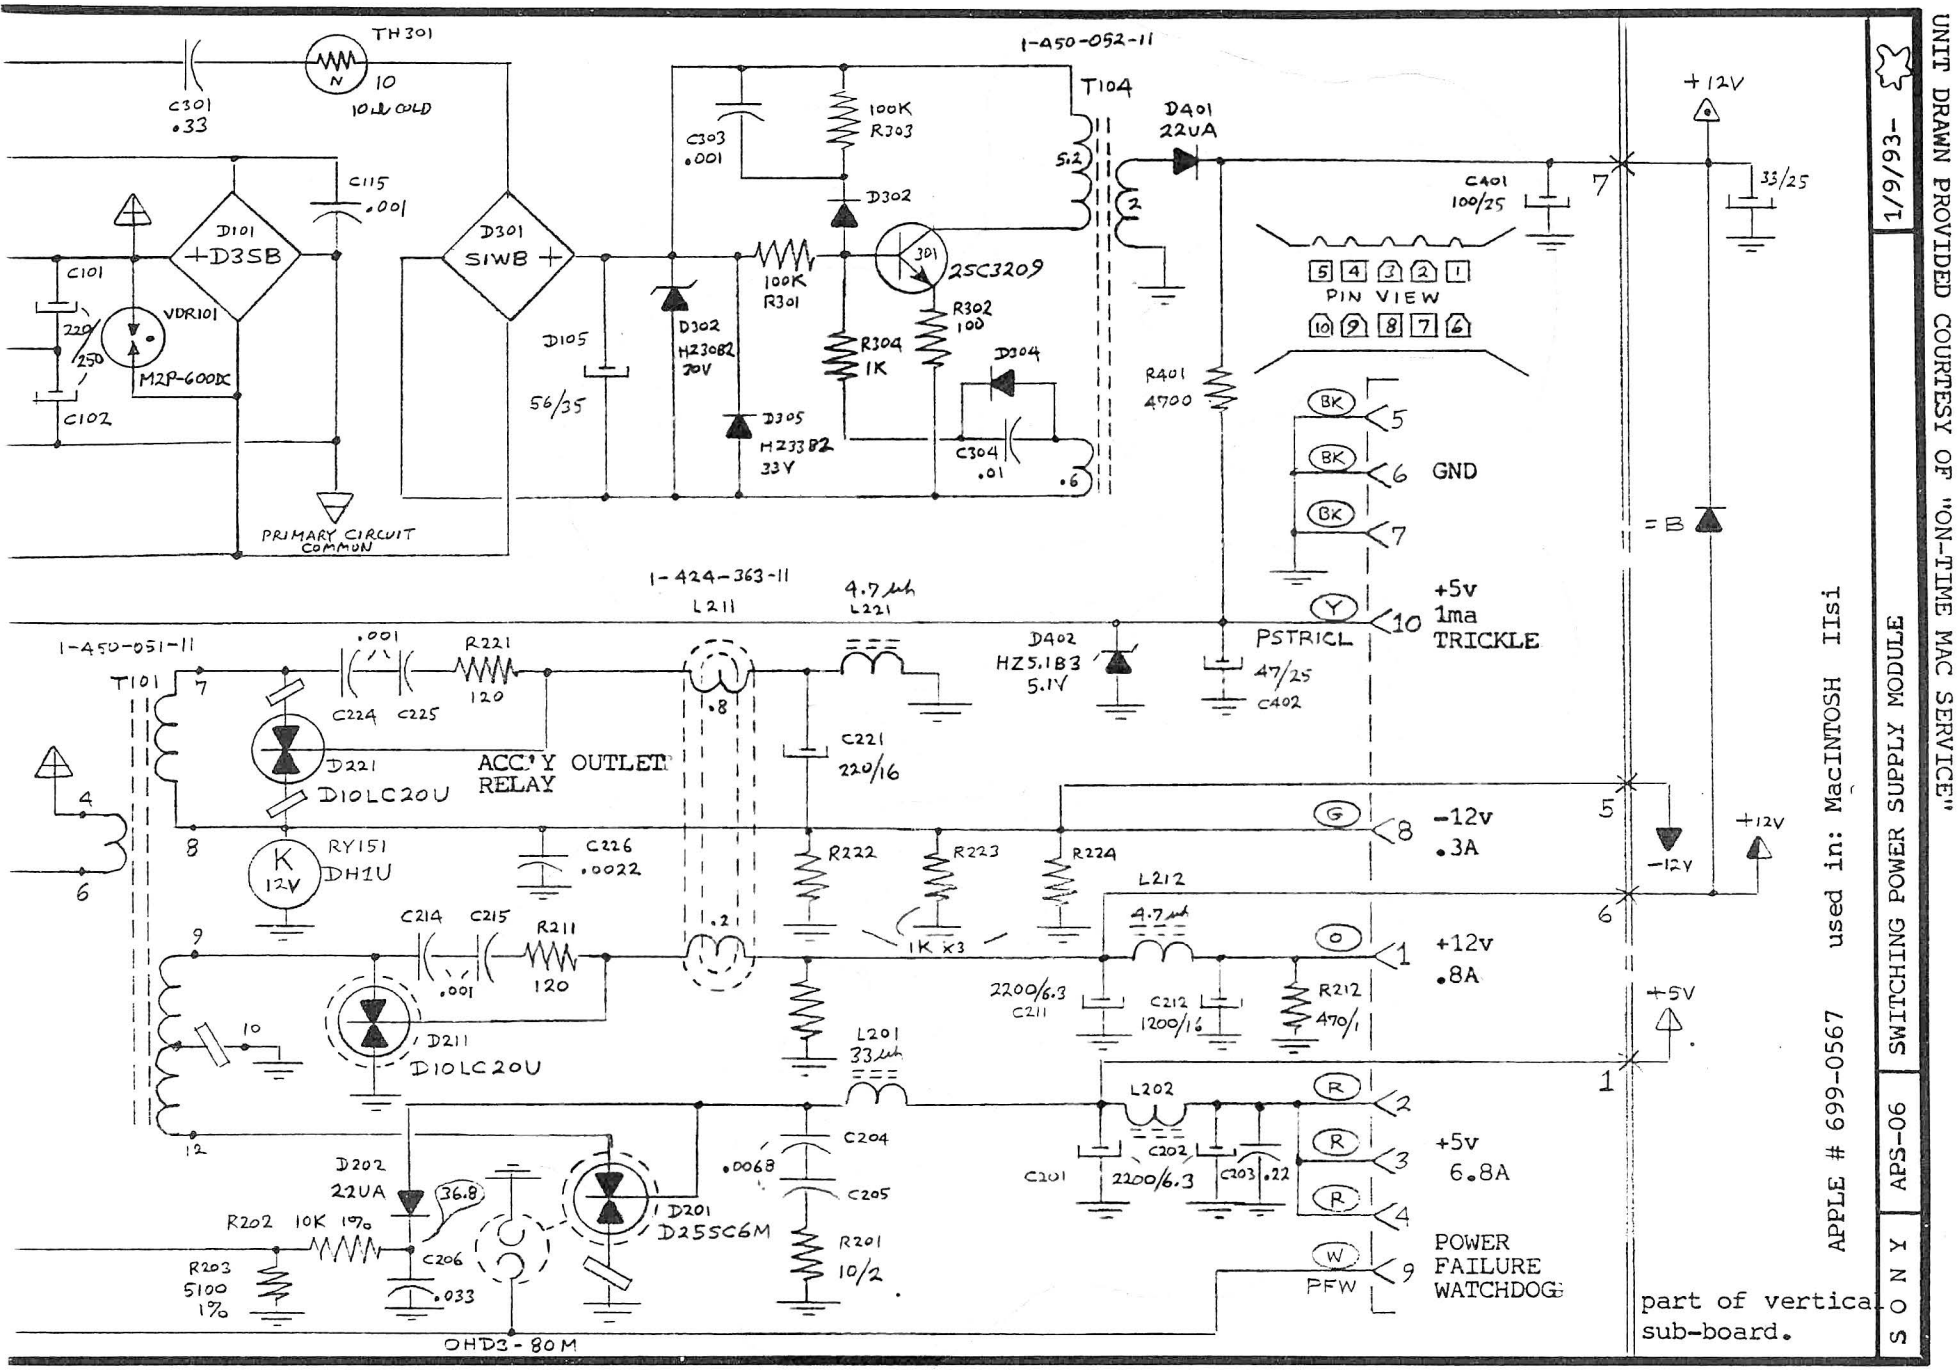

UNIT DRAWN PROVIDED COURTESY OF "ON-TIME MAC SERVICE"

SONY	APS-06	SWITCHING POWER SUPPLY MODULE	1/9/93-

APPLE # 699-0567 used in: MacINTOSH IIsi

part of vertical sub-board.