2026-10-15 23:12Z

TRIAL 3 CF TOP PLATE DROP (SYSTEM FILE)

● PASS VERIFIED

Does the 8-ply 3K twill top plate crack or flex into the blade when the bot lands flat from 1 m?

SURVIVES? PASS

YES

plate cracks SF 4.08, plate hits blade SF 2.14

PLATE CRACKS PASS

SF 4.08


P(fail) 0% | SF P5 2.74

PLATE HITS BLADE [GOVERNING] PASS

SF 2.14

P(fail) 0% | SF P5 1.44

Margin to each user-defined failure mode

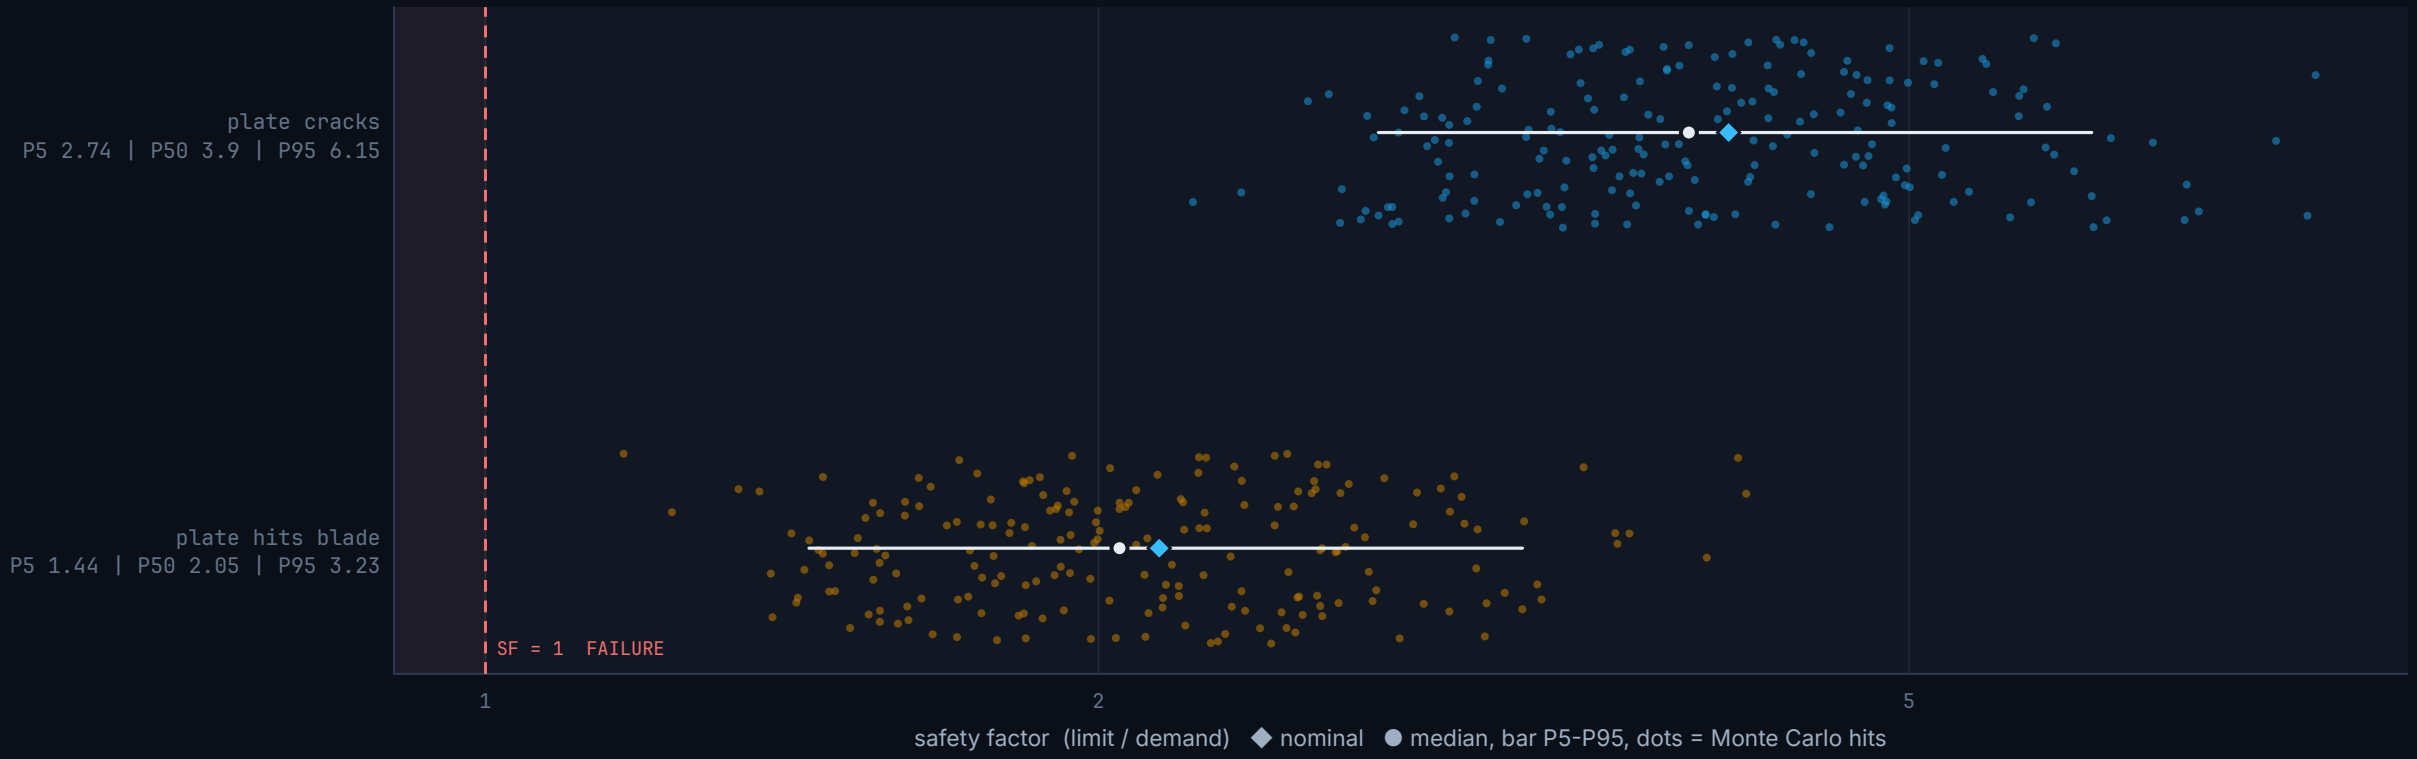

TRIAL 3 CF TOP PLATE DROP (SYSTEM FILE)

Time histories of the governing states (nominal case)

Plate force from the motor


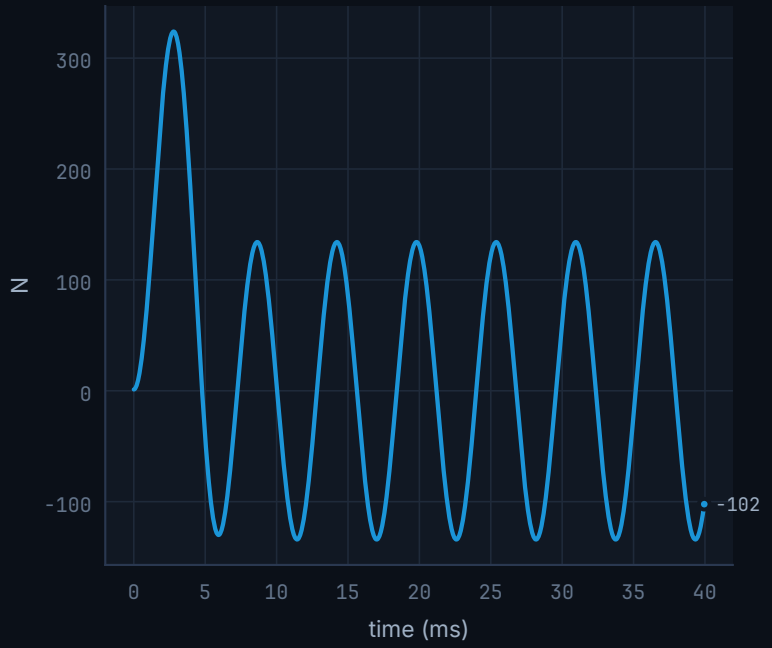


Plate flex under the motor



Floor force on the wheels

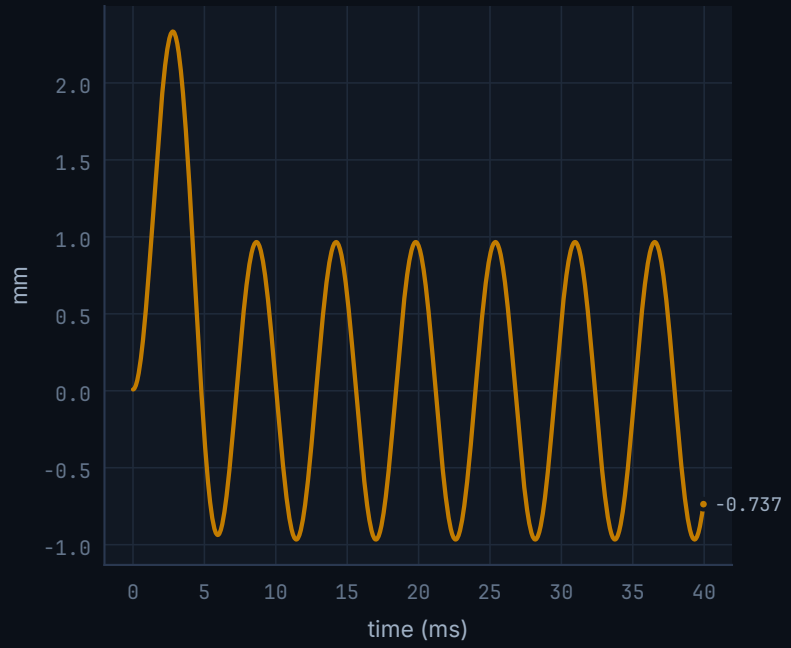


TRIAL 3 CF TOP PLATE DROP (SYSTEM FILE)

What to design around: drivers of the governing margin and the design-variable sweep

Drivers of 'plate hits blade' margin



fpf_SF vs h

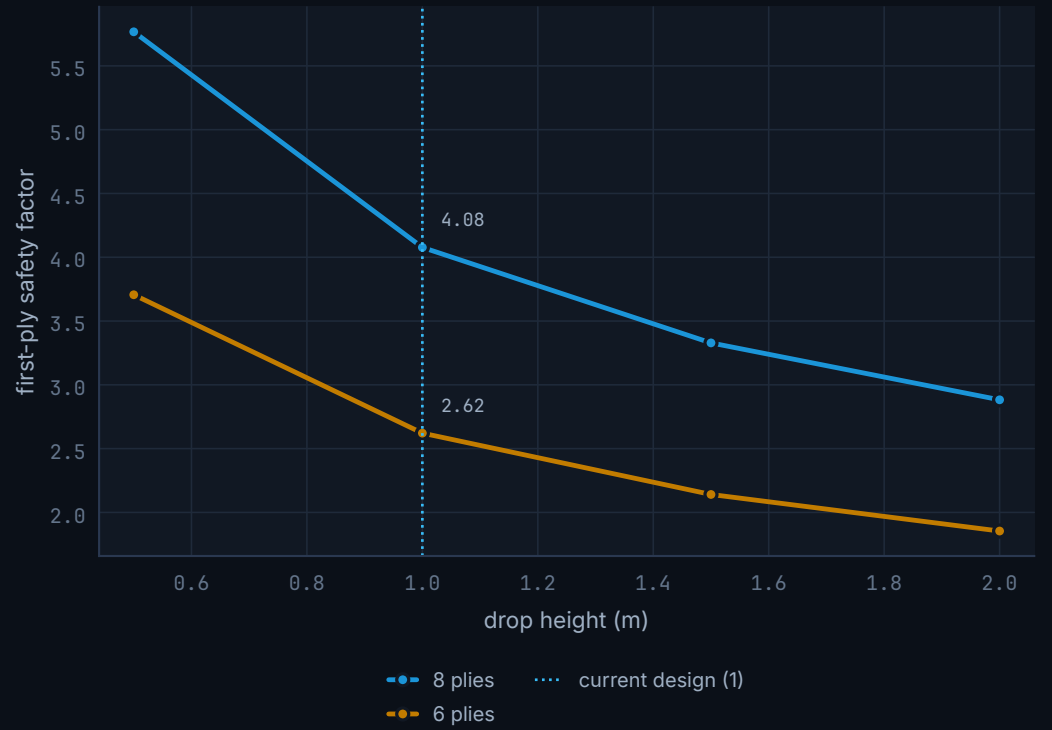

SIMBLOCKS // VERIFICATION

2026-10-15 23:12Z

TRIAL 3 CF TOP PLATE DROP (SYSTEM FILE)

● PASS VERIFIED

Automated verification battery

CHECK	STATUS	DETAIL
determinism	● PASS	bit-identical repeat
finite_outputs	● PASS	all outputs finite
physical_bounds	● PASS	2 bounds respected
stability_margin	● PASS	critical dt 0.00178 s / dt 2e-06 s = 887.8x
dt_convergence	● PASS	F_plate_peak_N: err 0.043% (order 1); plate_defl_mm: err 0.043% (order 1); F_floor_peak_N: err 0.044% (order 1); fpf_SF: err 0.043% (order 1)
energy_ledger	● PASS	worst closure residual 0.13% across 3 dt levels (tol 5%)
limit:no gravity, no drop → no load	● PASS	matches expected limit
knockout:no floor_contact	● PASS	F_plate_peak_N -99.6%, plate_defl_mm -99.6%, F_floor_peak_N -100%, fpf_SF +2.74e+04%
knockout:no plate	● WARN	F_plate_peak_N -100%, plate_defl_mm +9.89e+03%, F_floor_peak_N -0.899%, fpf_SF +inf% | non-finite output with this term removed (load path gone)
sensitivity	● PASS	4 inputs swept low/high (trends reported, not judged)
monte_carlo	● PASS	200 samples, 0 failed finite/bounds/ledger (0.0%)
failure_modes	● PASS	plate cracks: nominal SF 4.08, P(fail) 0%; plate hits blade: nominal SF 2.14, P(fail) 0%