Restroom Air Outlets - Breakdown by Floor

Clouded areas on M-529 / M-530 / M-531 (re-issued 10/14/2026) | Quantities only, pricing to follow

Scope (typical for each of the 6 restrooms)

1. Two new continuous linear supply diffusers, type C (Titus FL-15-HT, (1) 1-1/2" slot): C(250) along the toilet partitions and C(200) along the urinal / stall side, each approx. 17 LF. Drawing note: "Arch to confirm final length. 4'-0" of active supply/exhaust required."

2. Per the air outlet schedule notes: cable operated dampers for linear diffusers (5); non-active lengths of linear diffusers used as return with light shields (6).

3. New 12x8 supply ductwork: approx. 28 LF from the existing 12x8 at the restroom entry (point of new connection) to C(200), and approx. 17 LF from a second point of connection at the vanity wall to C(250). Insulated per spec.

4. 30th floor only: combination fire/smoke damper with duct access door on the existing 24x8 at the Food Prep / Holding 30.12B wall (FSD added in the cloud).

5. Lengths scaled from the 1/8" = 1'-0" plans; final diffuser lengths per architect.

Open items before pricing

1. Linear diffuser length: price the drawn approx. 17 LF each, or wait for the architect? Active 4 LF + inactive (return / light shield) for the rest.

2. Second point of connection at the vanity wall (to C(250)): which existing duct is it, and is it supply? The note reads "supply/exhaust".

3. FSD on the 30th floor: wiring and fire alarm interface by the electrician / FA vendor (our scope: furnish, install, access door)?

4. Is any of this ductwork or ceiling already installed (removal), or all new?

Quantities by floor


Floor	Rest-rooms	Linear diffusers (qty / LF)	Active / inactive LF	12x8 duct LF	Connections to existing	Cable op. VD	FSD 24x8
29th floor (M-529)	2	4 / 68	16 / 52	~90	4	4	-
30th floor (M-530)	2	4 / 68	16 / 52	~90	4	4	1
31st floor (M-531)	2	4 / 68	16 / 52	~90	4	4	-
Total	**6**	**12 / 204**	**48 / 156**	**~270**	**12**	**12**	**1**

Per restroom (typical)


Item	Qty	Unit
Linear supply diffuser C(250), Titus FL-15-HT 1-slot, 4 LF active, plenum on active section, light shield on inactive	17	LF
Linear supply diffuser C(200), Titus FL-15-HT 1-slot, 4 LF active, plenum on active section, light shield on inactive	17	LF
12x8 duct from existing 12x8 at restroom entry to C(200), fittings, insulation, hangers	~28	LF
12x8 duct from point of connection at vanity wall to C(250), fittings, insulation, hangers	~17	LF
Point of new connection to existing duct	2	EA
Cable operated volume damper at each linear diffuser	2	EA
Air balancing of new outlets	2	EA

29-1 Women's RR 29.39: 2 linear diffusers C(250) / C(200), approx. 34 LF (4 LF active each), approx. 45 LF 12x8, 2 connections, 2 cable op. VD

BEFORE - Bulletin 3

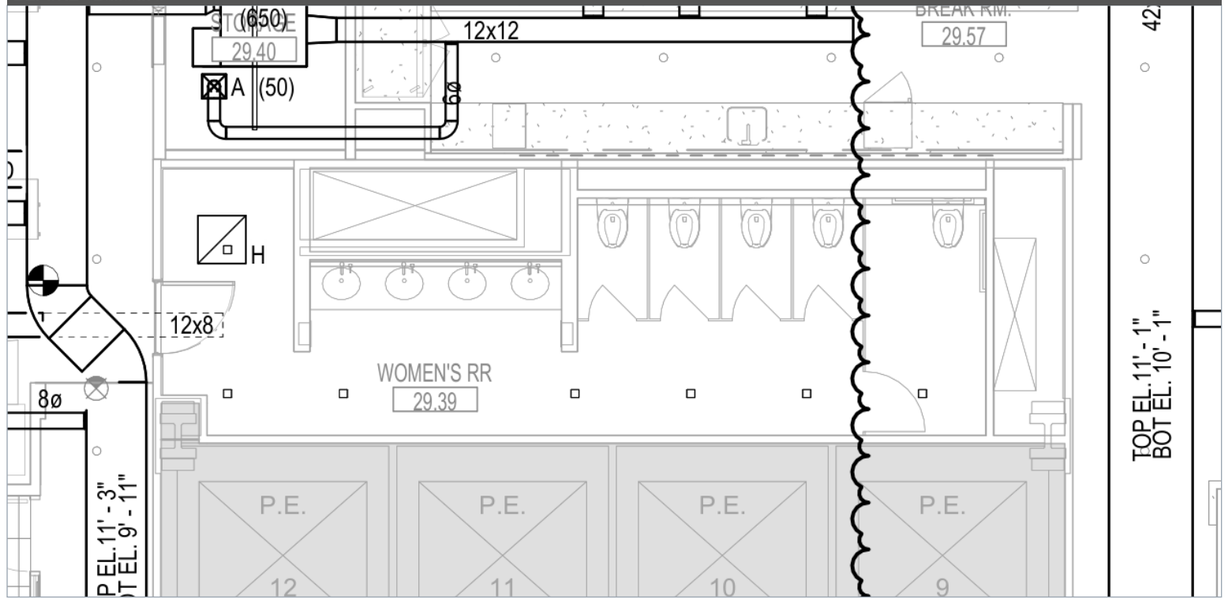


AFTER - re-issued 10/14/2026

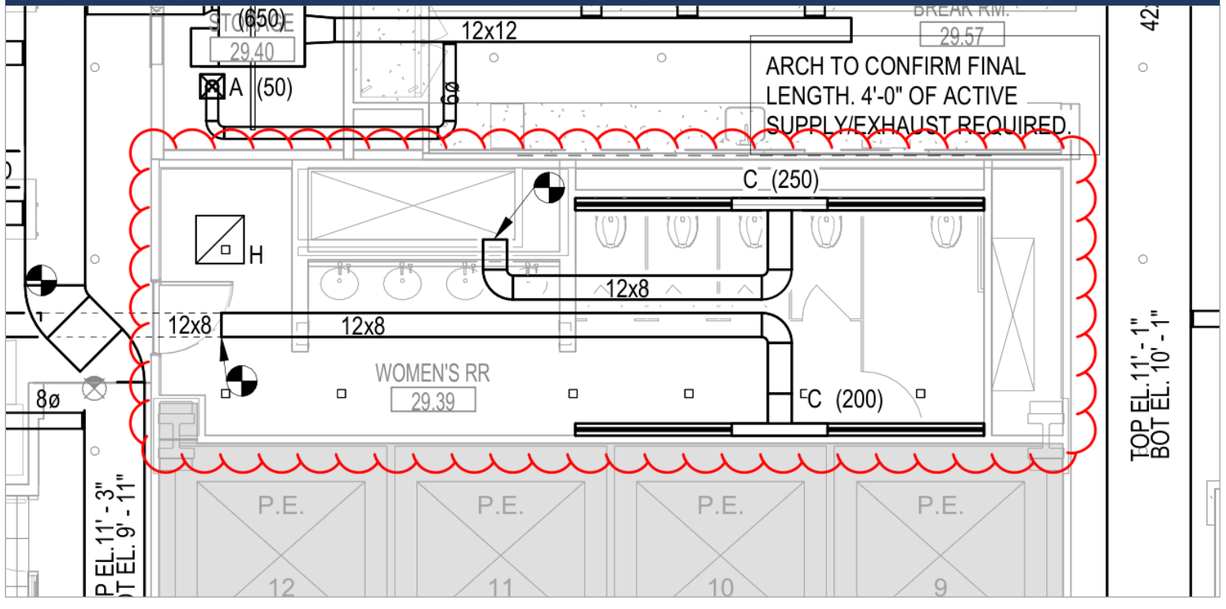


29-2 Men's RR 29.33: 2 linear diffusers C(250) / C(200), approx. 34 LF (4 LF active each), approx. 45 LF 12x8, 2 connections, 2 cable op. VD

BEFORE - Bulletin 3

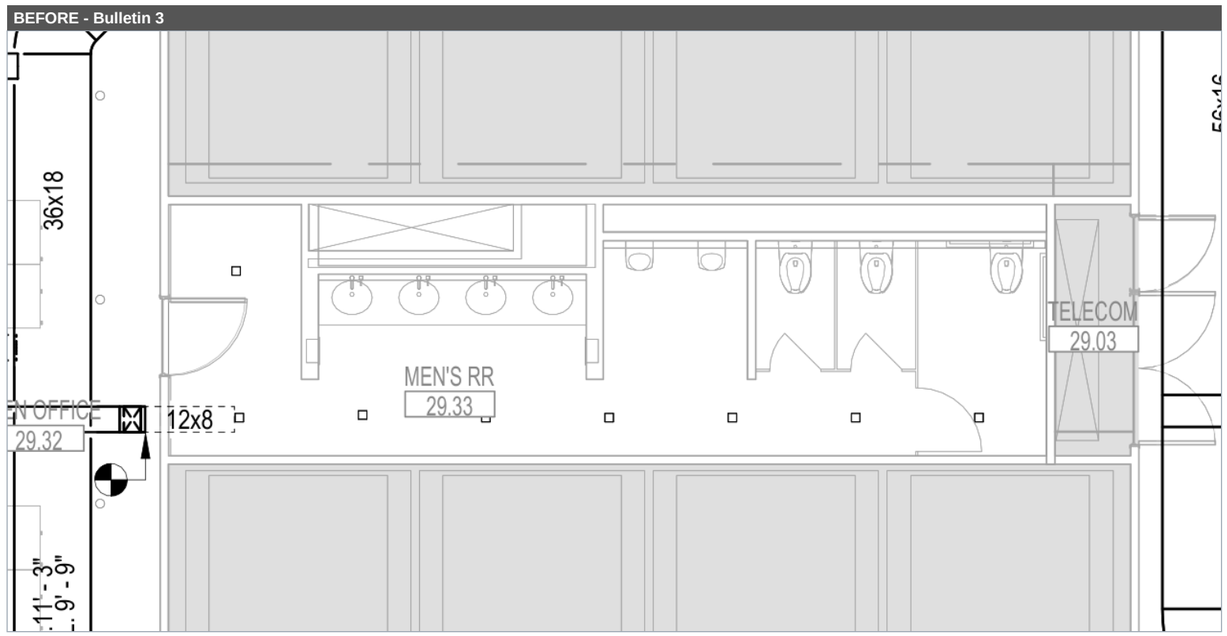


AFTER - re-issued 10/14/2026

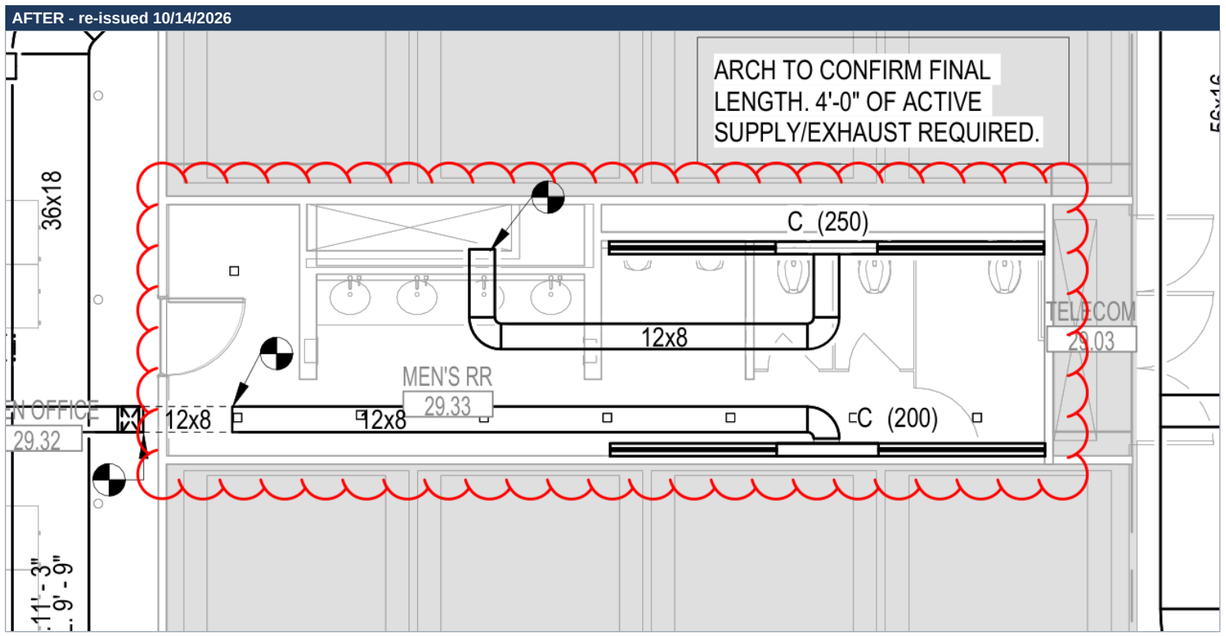


30-1 Women's RR 30.33: 2 linear diffusers C(250) / C(200), approx. 34 LF (4 LF active each), approx. 45 LF 12x8, 2 connections, 2 cable op. VD

BEFORE - Bulletin 3

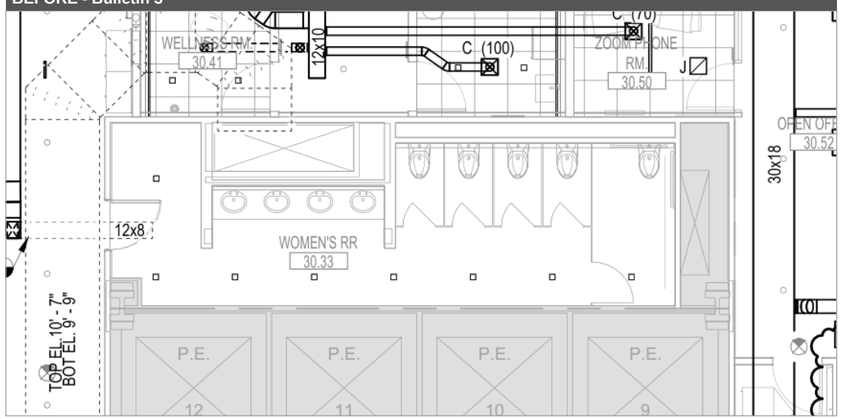


AFTER - re-issued 10/14/2026

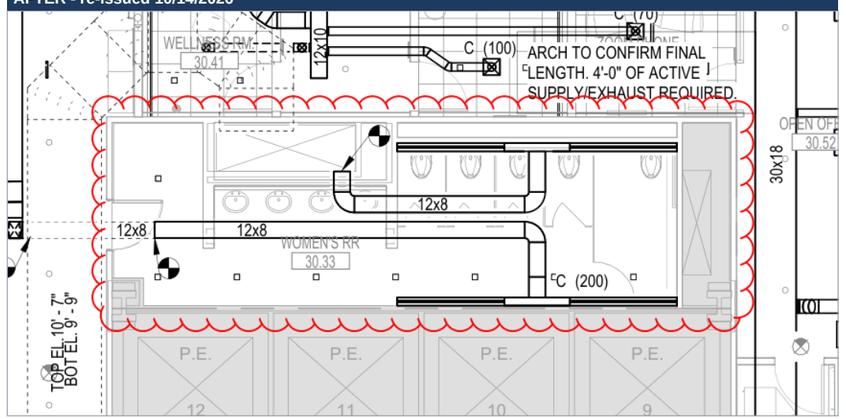


30-2 Men's RR 30.26: 2 linear diffusers C(250) / C(200), approx. 34 LF (4 LF active each), approx. 45 LF 12x8, 2 connections, 2 cable op. VD

BEFORE - Bulletin 3

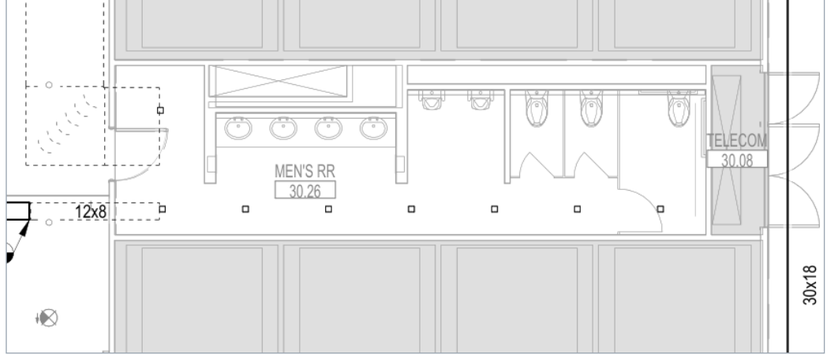


AFTER - re-issued 10/14/2026

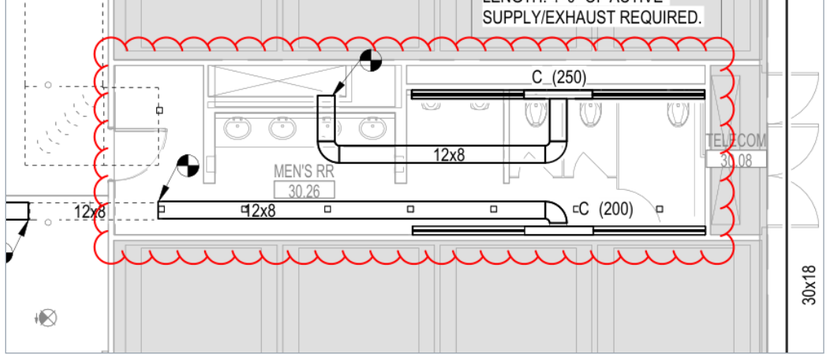


30-3 Food Prep / Holding 30.12B: Combination fire/smoke damper 24x8 with duct access door at rated wall on existing 24x8 supply duct (FPB-D (750) to A (750))

BEFORE - Bulletin 3

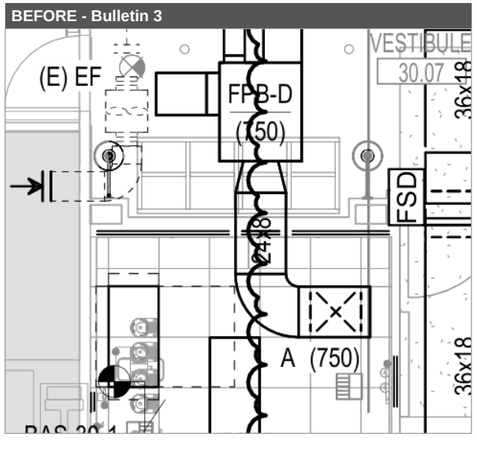

AFTER - re-issued 10/14/2026

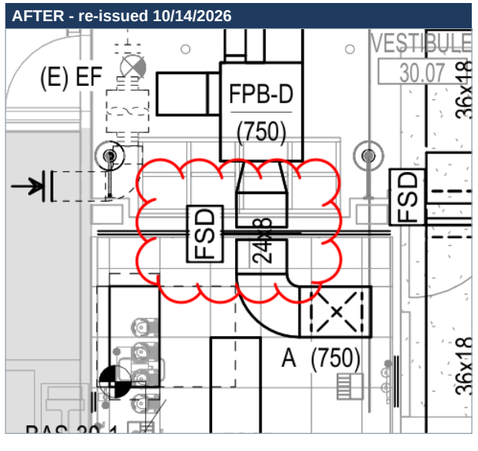


31st Floor - M-531: Restroom Air Outlets, Before and After


Left: Bulletin 3 (before) | Right: re-issued 10/14/2026 with cloud (after)

31-1 Women's RR 31.57: 2 linear diffusers C(250) / C(200), approx. 34 LF (4 LF active each), approx. 45 LF 12x8, 2 connections, 2 cable op. VD

BEFORE - Bulletin 3

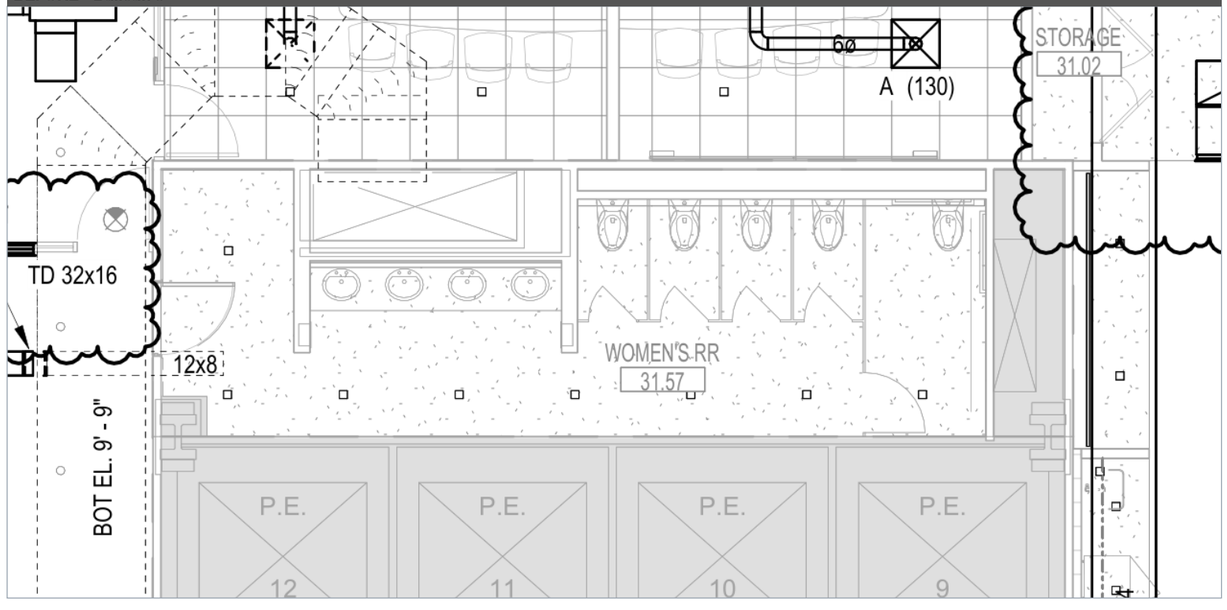


AFTER - re-issued 10/14/2026

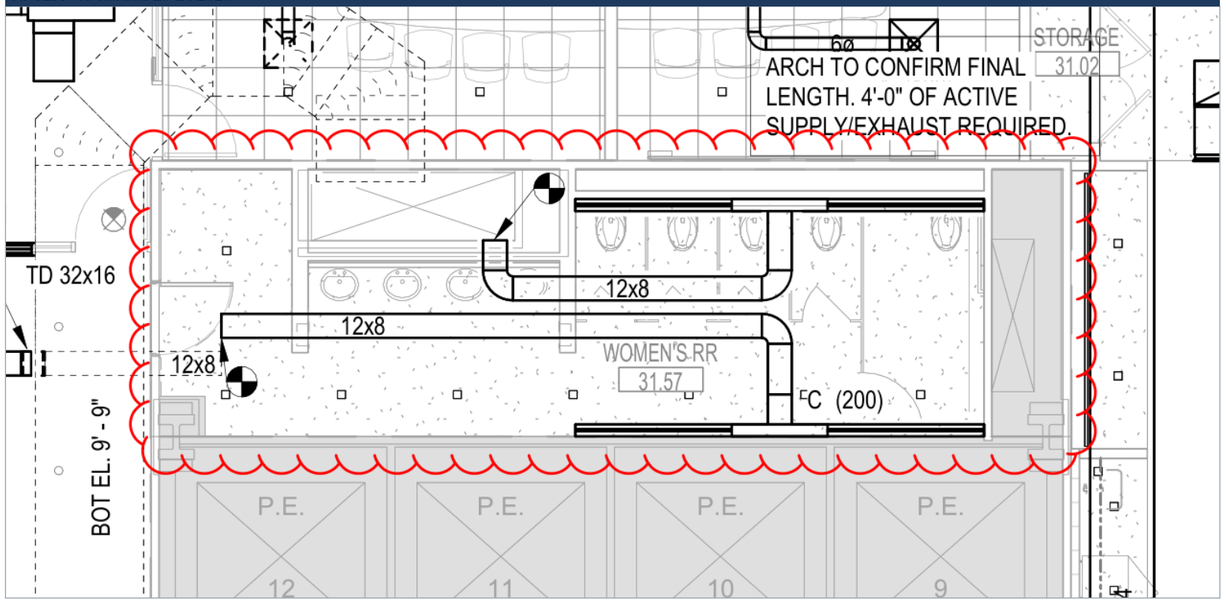

31-2 Men's RR 31.41: 2 linear diffusers C(250) / C(200), approx. 34 LF (4 LF active each), approx. 45 LF 12x8, 2 connections, 2 cable op. VD

BEFORE - Bulletin 3

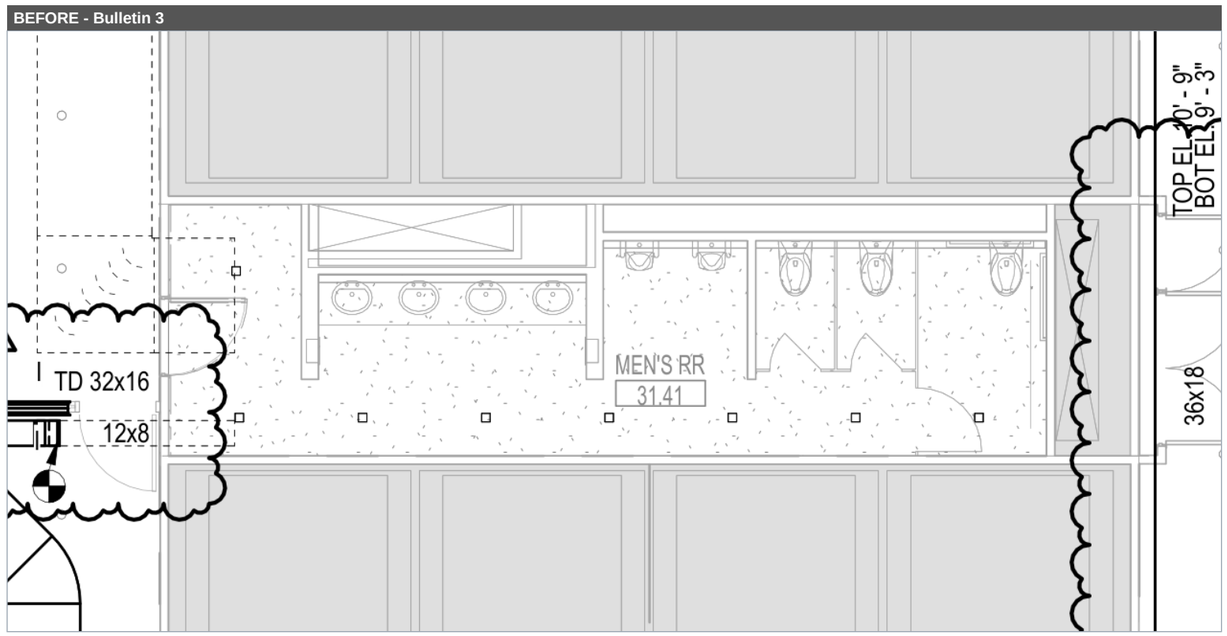

AFTER - re-issued 10/14/2026

