
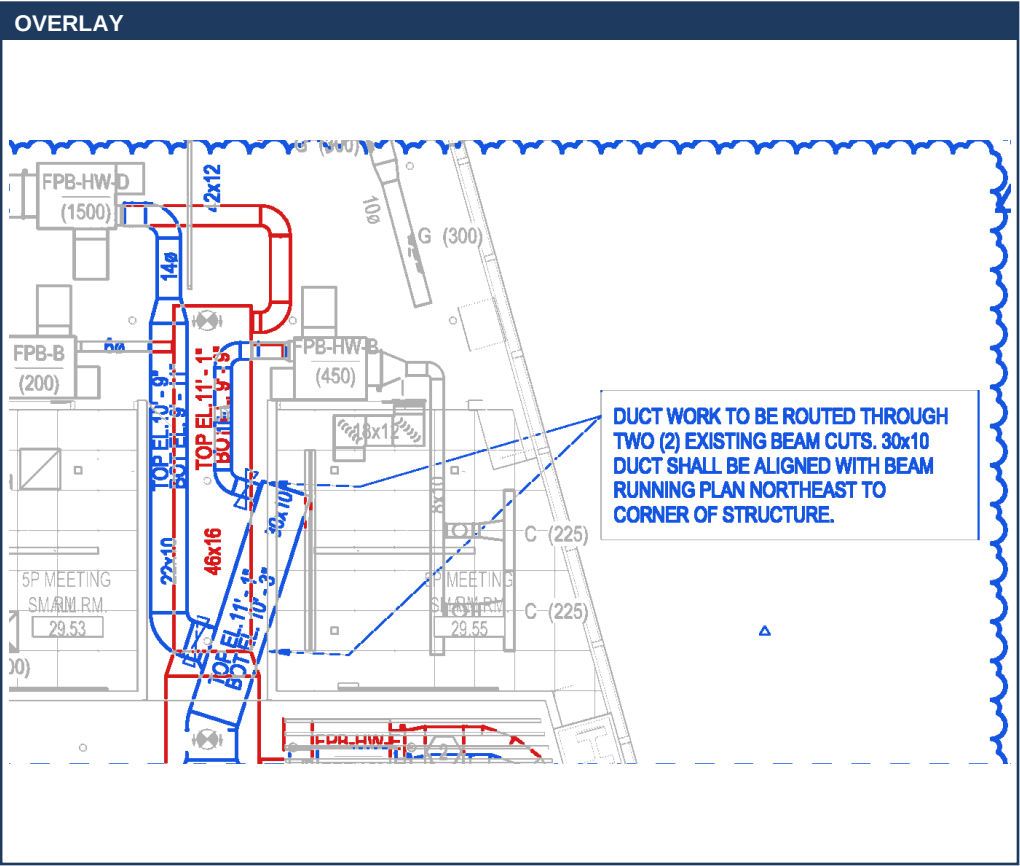
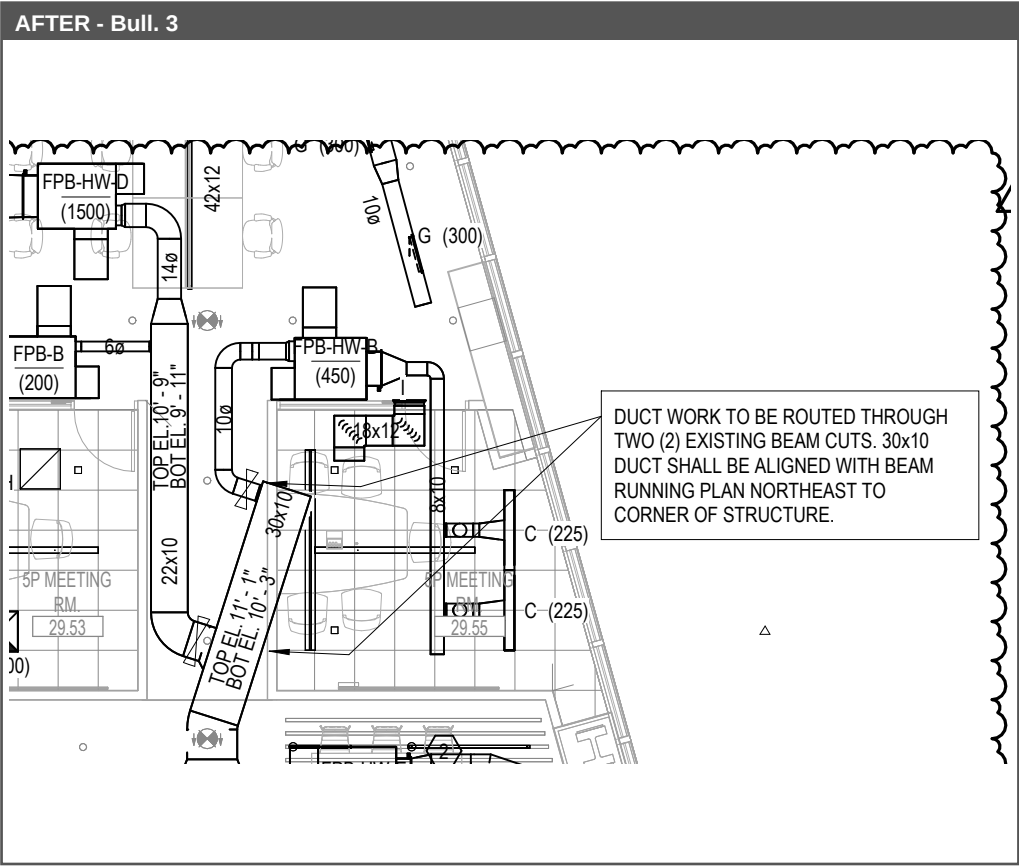





29-1 North supply main - reroute through existing beam cuts

\$13,875

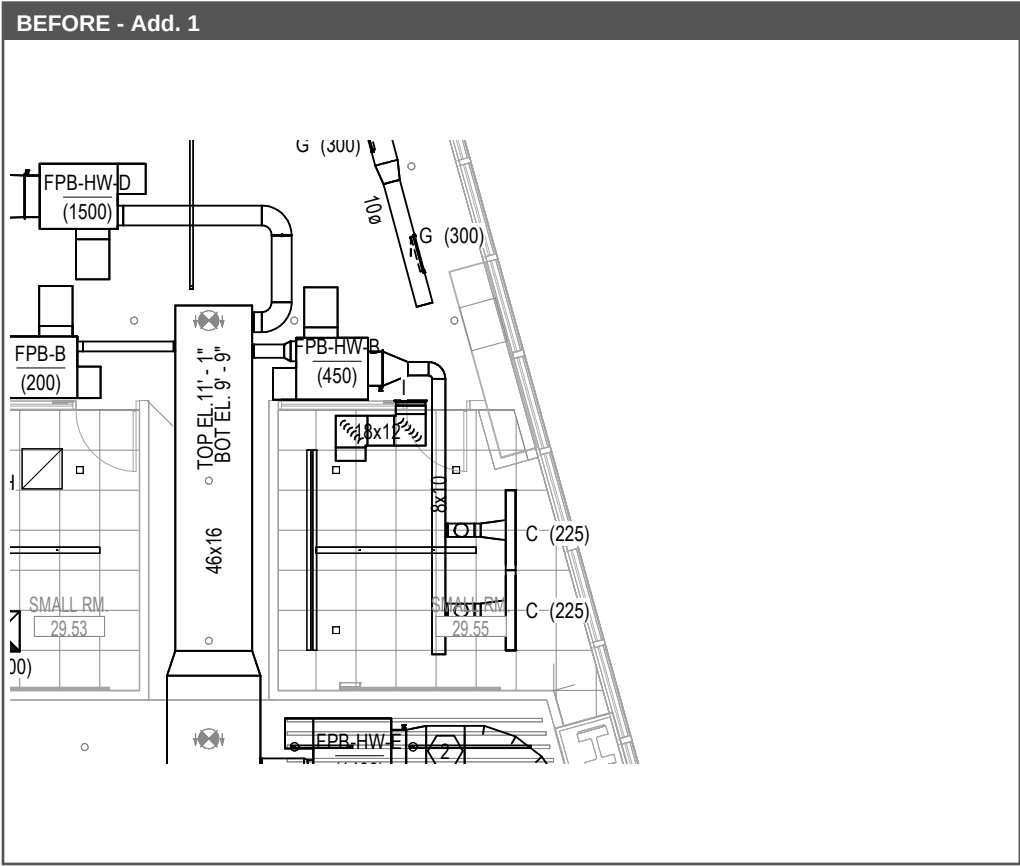

29-3 FPB-HW-E (1400) relocation and discharge reroute

\$1,500

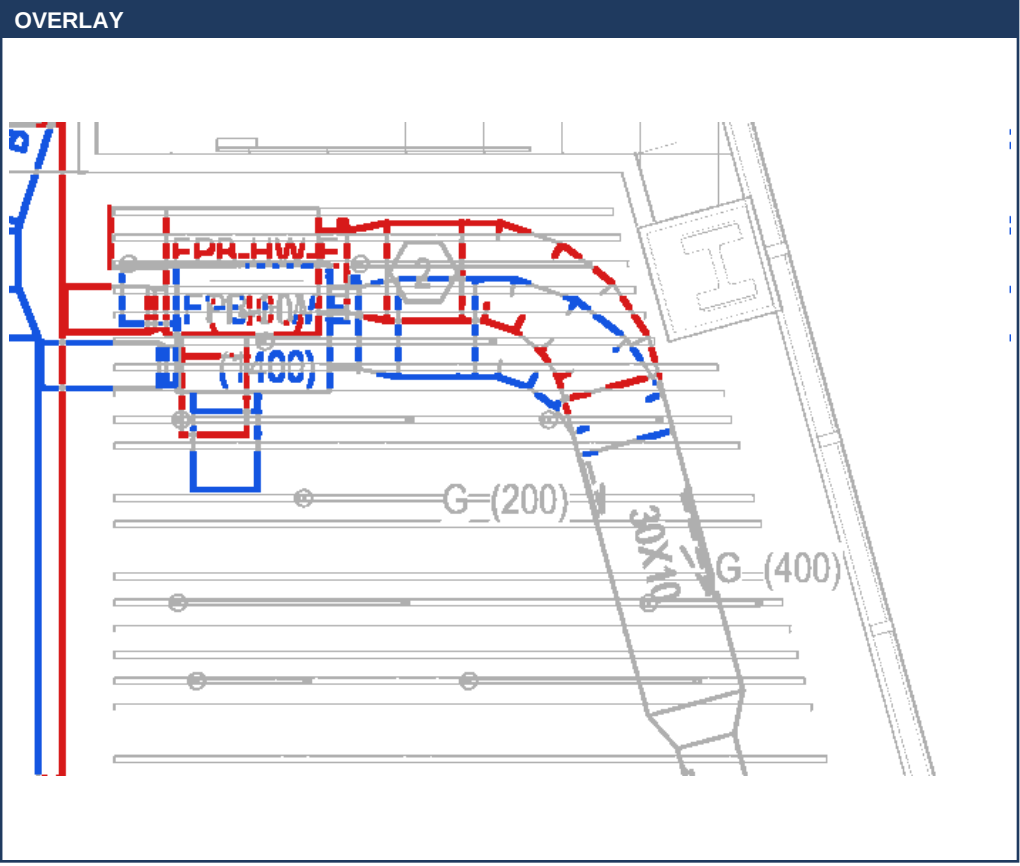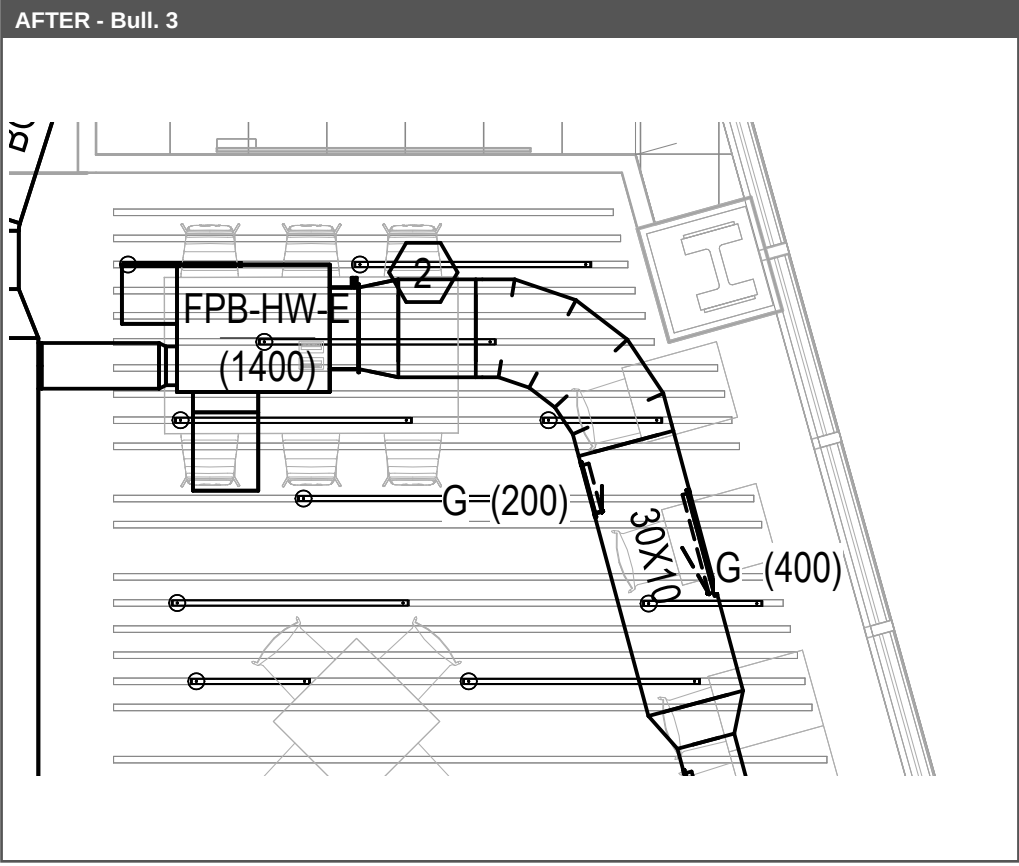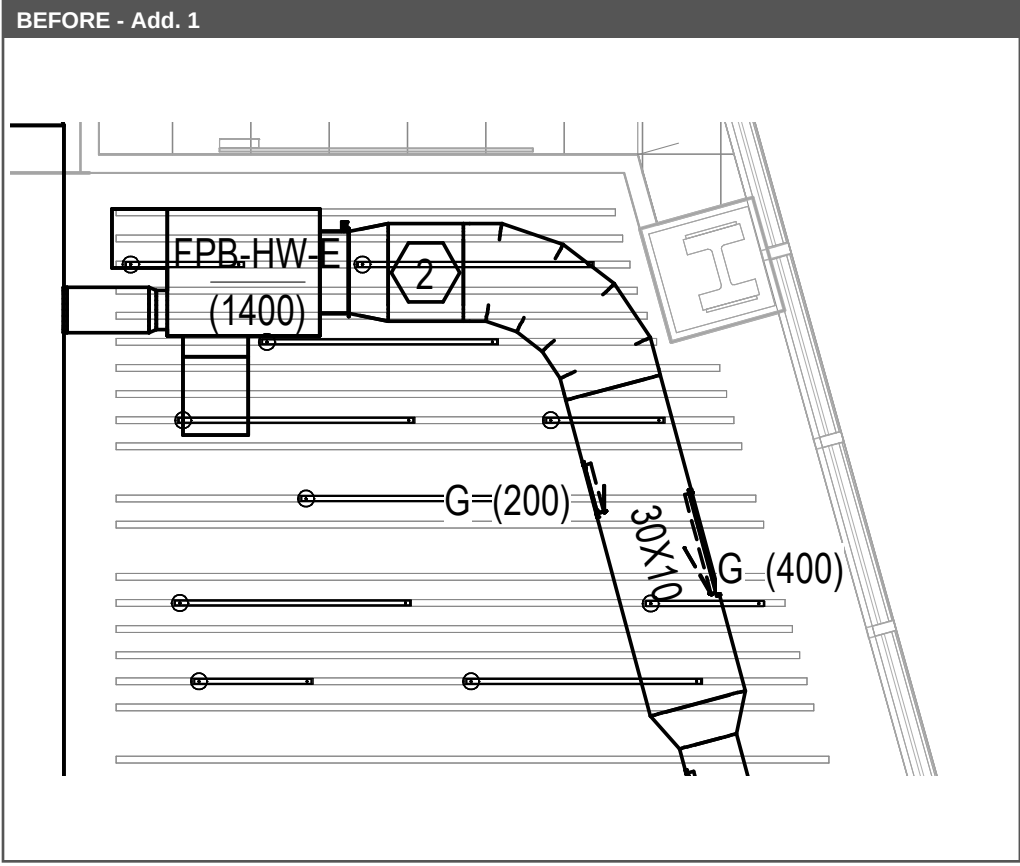


29th Floor - M-529.00: Scope of Work and Cost Breakdown

Labor at \$125.00 per man-hour | Disconnect = removal of installed Addendum 1 work incl. haul away | Material = fabricated ductwork, fittings, insulation, accessories and air outlets | Snowflake Fitout - 7 Times Square, Floors 29-31 | COP-SF-05 Bulletin 3 Revision

Area	Scope of work	Disconnect / removal	Material	Install labor	Total
29-1	North supply main - reroute through existing beam cuts Before: 46x16 supply main (approx. 20 LF, bottom el. 9'-9") with branch connections to FPB-HW-D (1500), FPB-HW-B (450) and FPB-B (200). After: Main rerouted as 22x10 and 30x10 through (2) existing beam cuts, 30x10 aligned with the beam running plan northeast. New 14ø branch to FPB-HW-D, 10ø to FPB-HW-B and 6ø to FPB-B. Work: Disconnect and remove installed 46x16 section and branch connections. Fabricate and install 22x10 / 30x10 duct and round branches with insulation.	12 MH \$1,500	\$4,875	60 MH \$7,500	\$13,875
29-3	FPB-HW-E (1400) relocation and discharge reroute Before: FPB-HW-E (1400) with inlet and 30x10 discharge to the G(400) / G(200) linear diffusers along the northeast wall. After: FPB-HW-E relocated; inlet connection and 30x10 discharge elbow rerouted. Work: Disconnect inlet and discharge, relocate and rehang FPB-HW-E, fabricate and install new inlet and 30x10 discharge fittings, reconnect.	2 MH \$250	\$500	6 MH \$750	\$1,500
29-2	Supply main resized 56x16 to 42x12 Excluded - per Bulletin 3 the existing 56x16 main on the 29th floor remains as installed; no change to this ductwork.	-	-	-	Excluded
	Shop drawings for revised design				\$1,000
	29th floor total (14 MH disconnect, 66 MH install)	\$1,750	\$5,375	\$8,250	\$16,375

Key plan - Addendum 1 / Bulletin 3 overlay

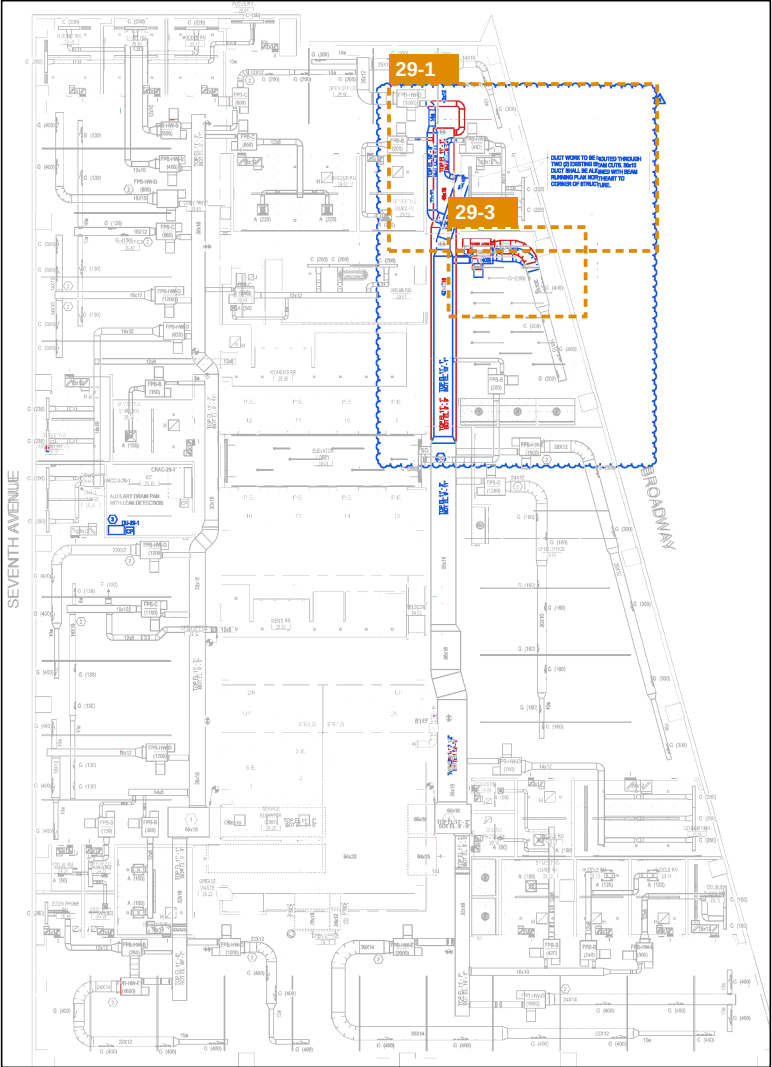

- Unchanged
- Addendum 1 only - installed, removed
- Bulletin 3 only - new work

COP-SF-05 summary

Floor	Total
29th floor (M-529.00)	\$16,375
30th floor (M-530.00)	\$20,150
31st floor (M-531.00)	\$17,030
COP-SF-05 revised total	\$53,555

Bulletin 3 was issued after the ductwork in these areas had been fabricated and installed per Addendum 1, so each area includes disconnecting and removing the installed work. Quantities are approximate, taken from the drawings at 1/8" = 1'-0".

NORTHERN WOLVES AC

Snowflake Fitout - 7 Times Square, Floors 29-31 | COP-SF-05 Bulletin 3 Revision


Northern Wolves AC | 55 9th St, 55-A2, Brooklyn, NY 11215 | (347) 463-9248 | 10/01/2026

30th Floor - M-530.00: Scope of Work and Cost Breakdown

Labor at \$125.00 per man-hour | Disconnect = removal of installed Addendum 1 work incl. haul away | Material = fabricated ductwork, fittings, insulation, accessories and air outlets | Snowflake Fitout - 7 Times Square, Floors 29-31 | COP-SF-05 Bulletin 3 Revision

Area	Scope of work	Disconnect / removal	Material	Install labor	Total
30-1	IT Build Rm 30.23 / F&B Storage 30.14 / west dining Before: 12x10 branch with (2) C(220) ceiling diffusers; G(400) linear diffuser run on 16x12 branch. After: 12x10 branch and (2) C(220) deleted, replaced with 10ø branch to (1) new G(440) linear diffuser. New 40x20 transfer duct at F&B Storage 30.14. G(400) diffusers relocated along the 16x12 branch. Work: Disconnect and remove 12x10 branch and (2) C(220). Install 10ø branch, 40x20 transfer duct, rework 16x12 branch. F&I G(440). F/I (2) 40x20 wall transfer grilles.	8 MH \$1,000	\$4,300	40 MH \$5,000	\$10,300
30-2	Lounge 30.02 - new transfer ducts Before: No transfer ducts at Lounge 30.02 walls. After: (2) new 48x24 transfer ducts with 1" AL. Work: Fabricate and install (2) 48x24 lined transfer ducts and (2) 48x24 transfer return grilles.	-	\$2,400	20 MH \$2,500	\$4,900
30-3	Meeting Rms 30.04 / 30.05, Storage 30.09, Vestibule 30.07 Before: 44x20 transfer duct; (2) 12x12 grilles; 12ø branch to FPB-HW-D (1200). After: (2) 12x12 grilles relocated to 5P / 7P Meeting; 12ø branch rerouted. Work: Disconnect and remove affected duct, FSD, fittings. Install 44x20 duct, FSD with angles, and 12ø branch at new locations.	12 MH \$1,500	\$200	18 MH \$2,250	\$3,950
	Shop drawings for revised design				\$1,000
	30th floor total (20 MH disconnect, 78 MH install)	\$2,500	\$6,900	\$9,750	\$20,150

Key plan - Addendum 1 / Bulletin 3 overlay

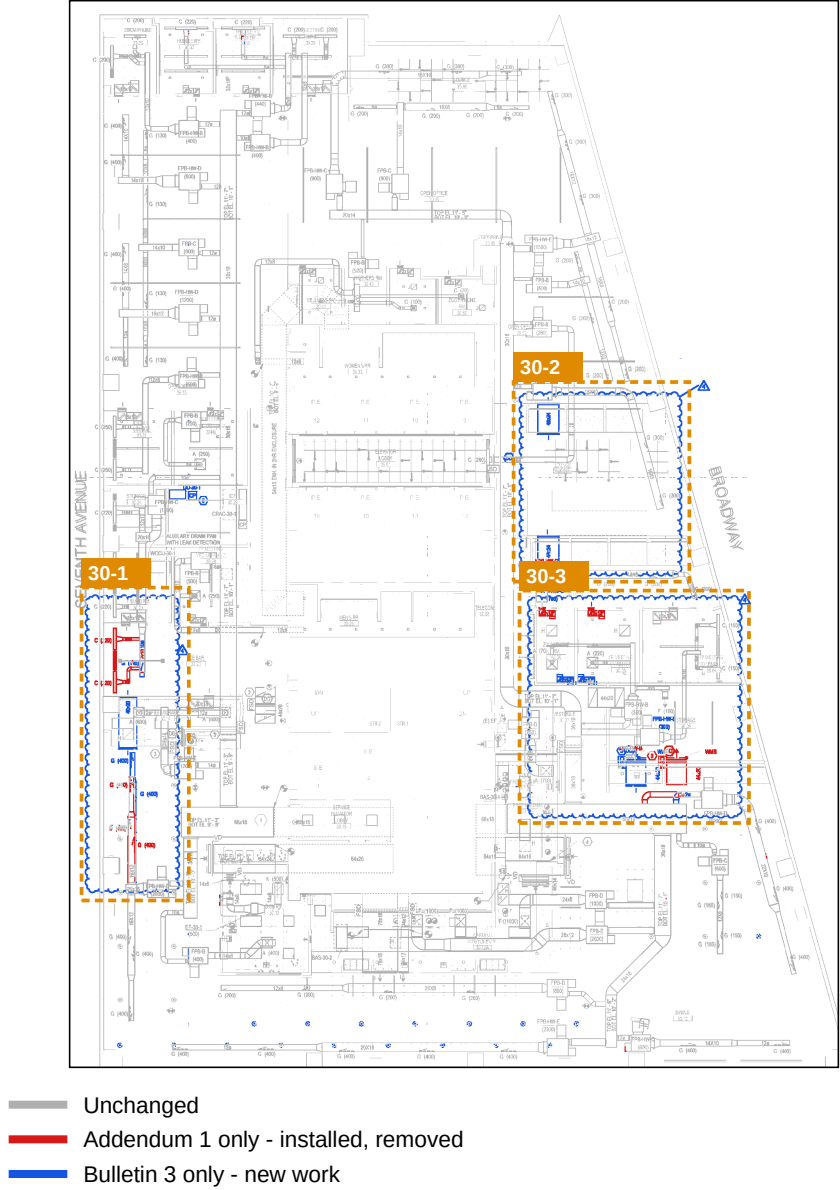

COP-SF-05 summary

Floor	Total
29th floor (M-529.00)	\$16,375
30th floor (M-530.00)	\$20,150
31st floor (M-531.00)	\$17,030
COP-SF-05 revised total	\$53,555


Bulletin 3 was issued after the ductwork in these areas had been fabricated and installed per Addendum 1, so each area includes disconnecting and removing the installed work. Quantities are approximate, taken from the drawings at 1/8" = 1'-0".

31st Floor - M-531.00: Change Areas, Before and After


Before = Addendum 1 (installed) After = Bulletin 3 (rev 4, 08/10/2026) | Overlay: Unchanged Addendum 1 only - removed Bulletin 3 only - new

Snowflake Fitout - 7 Times Square, Floors 29-31 | COP-SF-05 Bulletin 3 Revision


31-1 Zoom rooms, northwest - transfers \$1,280

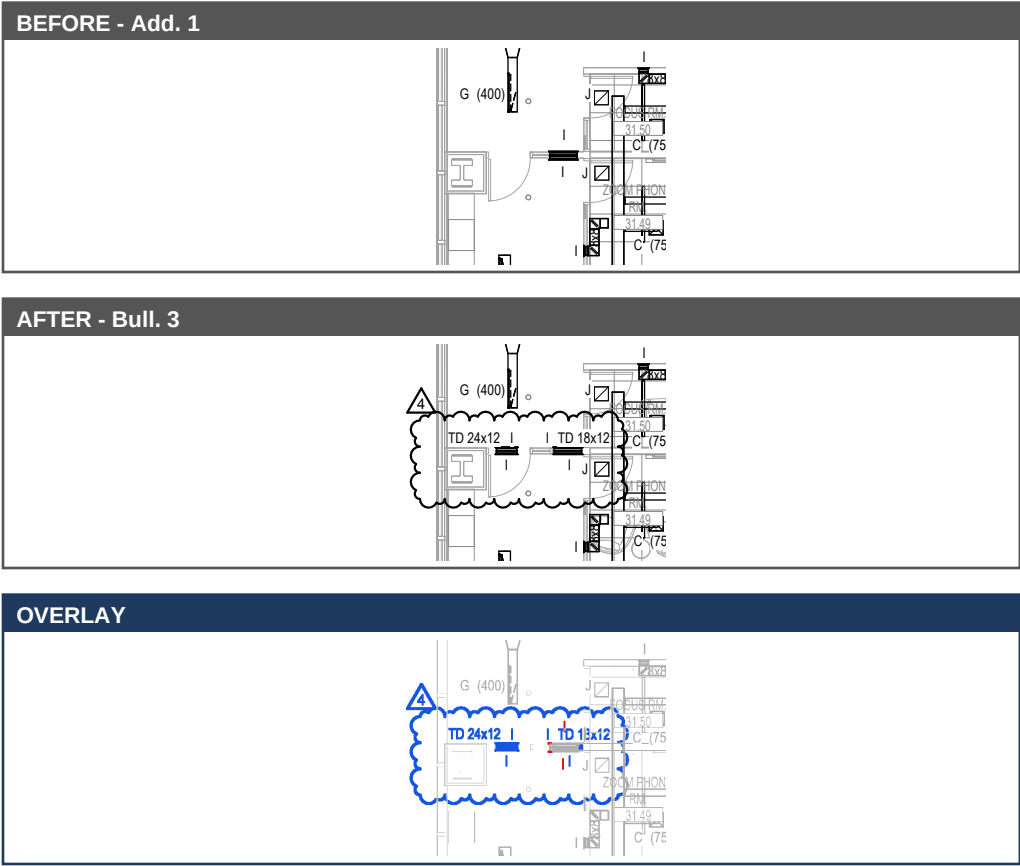


31-2 Transfer TD 32x16, north \$800

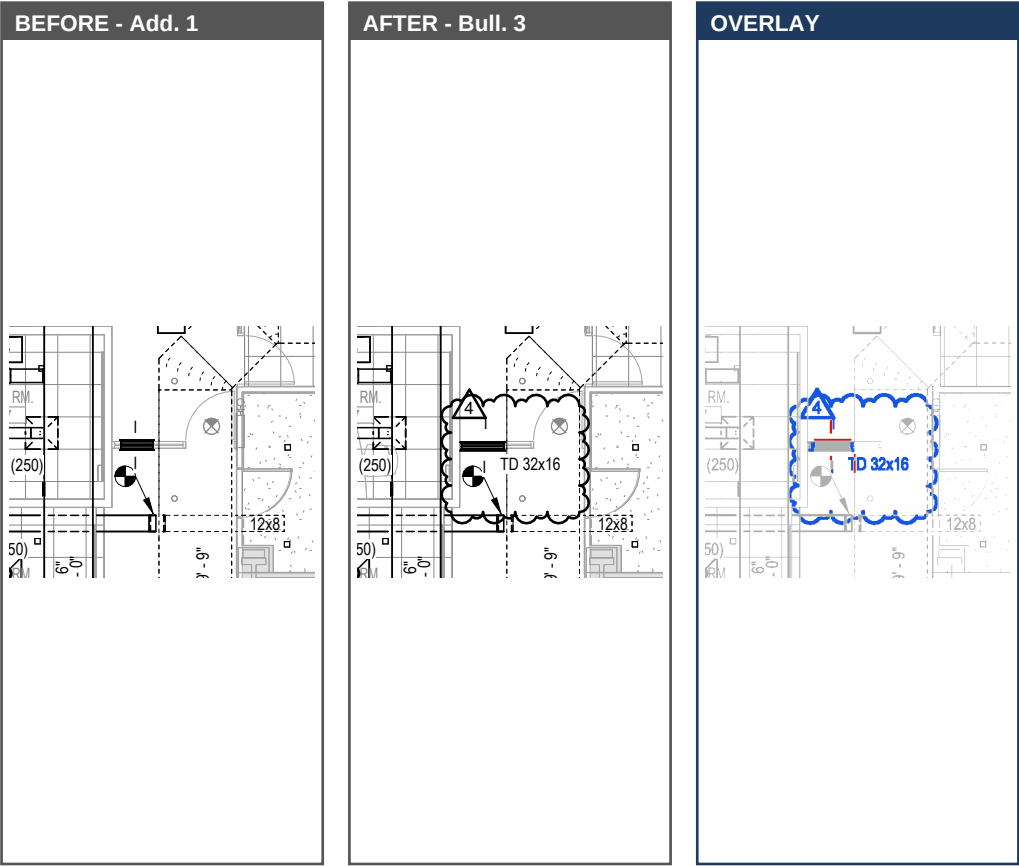


31-3 Storage 31.02 - new transfer ducts \$3,700

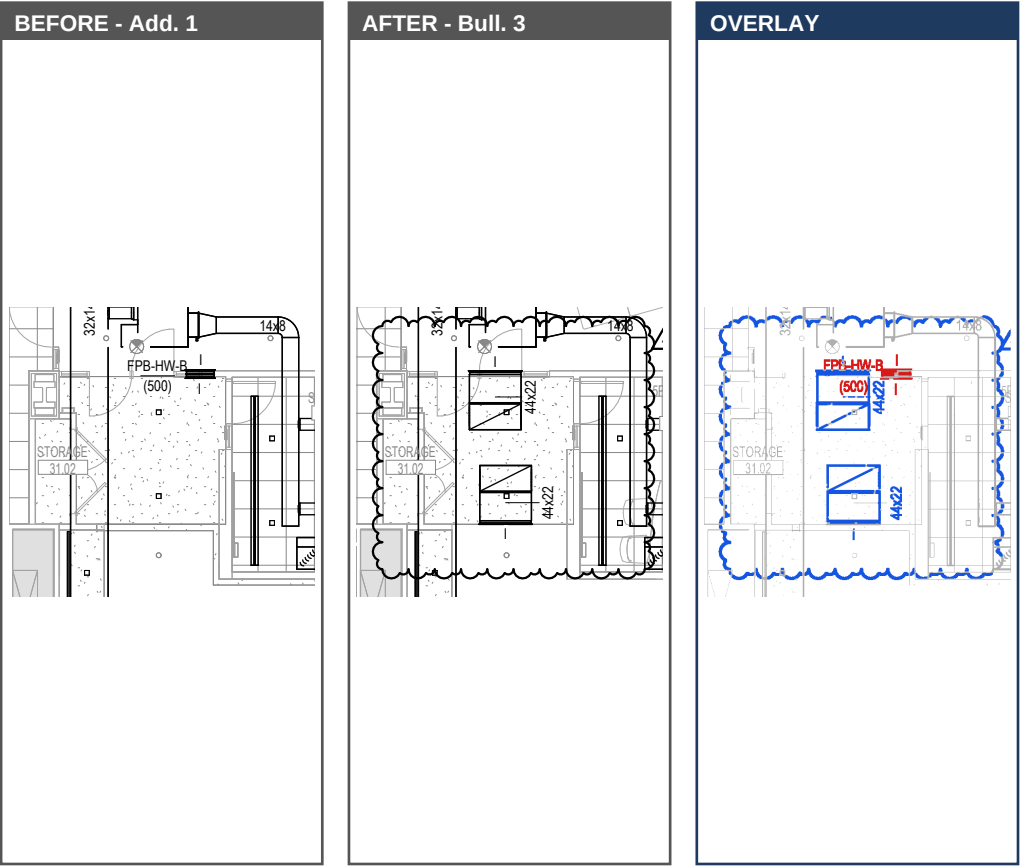


31-4 Coffee Bar 31.12 - transfer ducts and main fitting \$5,750

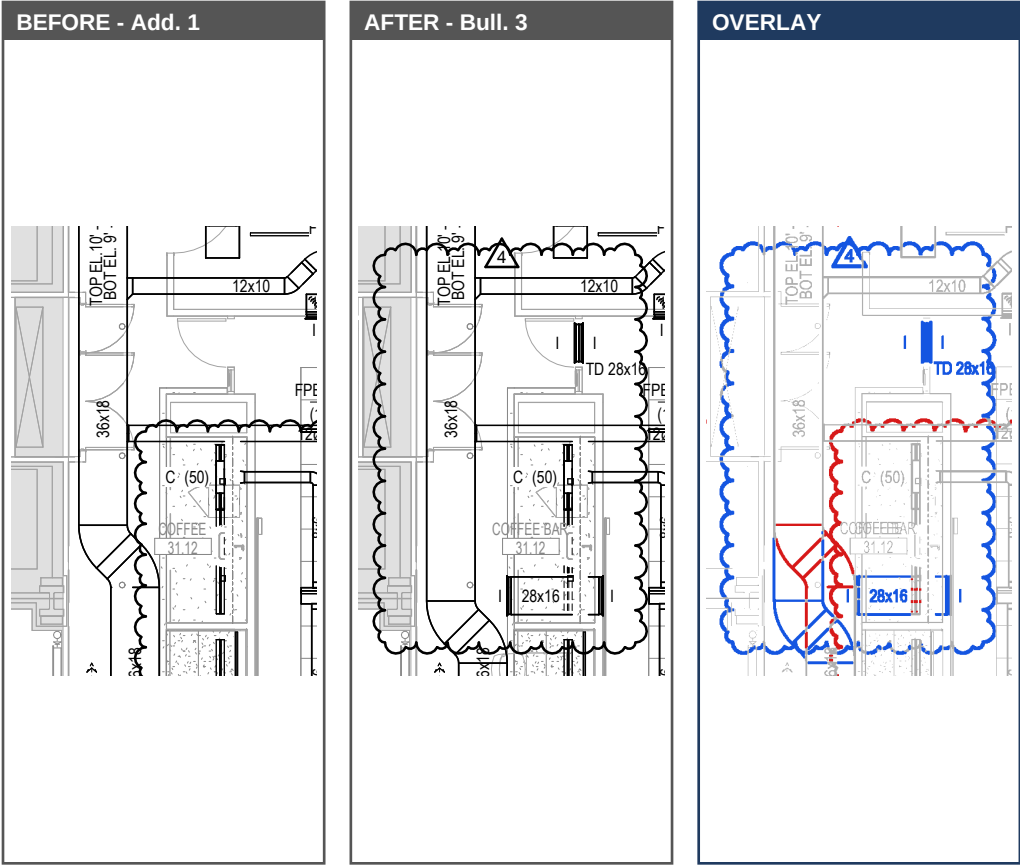

31-5 Transfer TD 32x16, southwest \$1,900

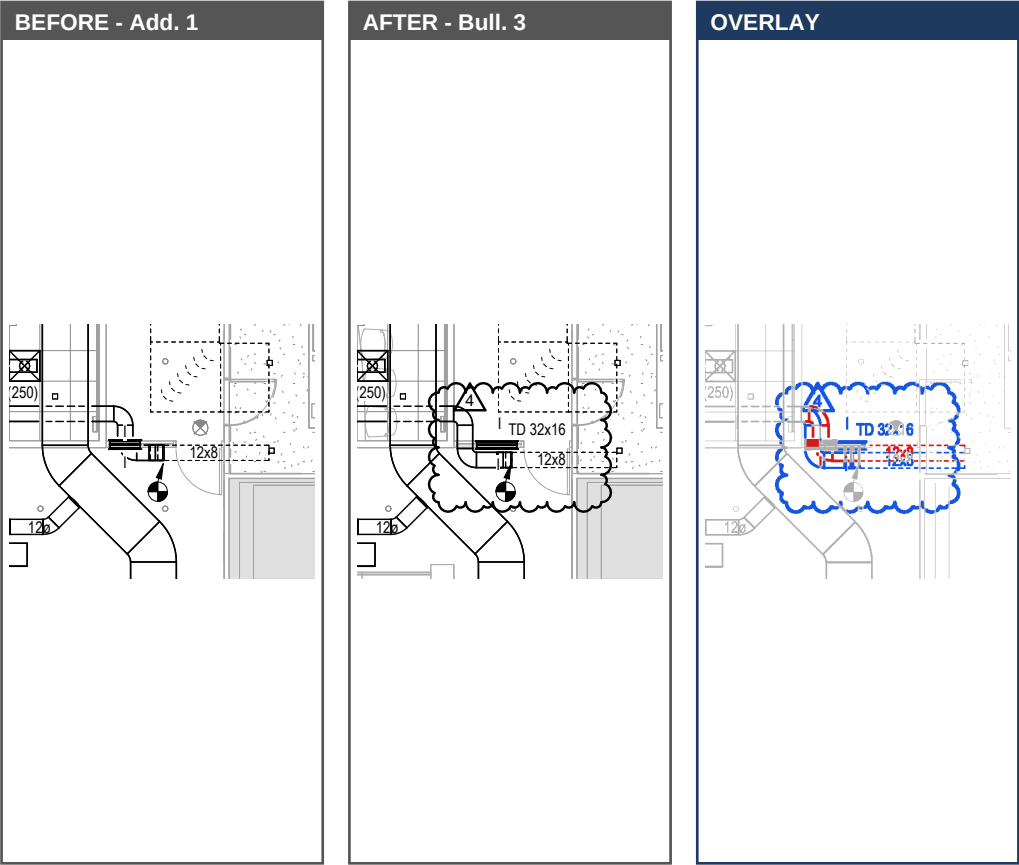

31-6 Storage 31.15 / Room 31.16, southeast \$2,600

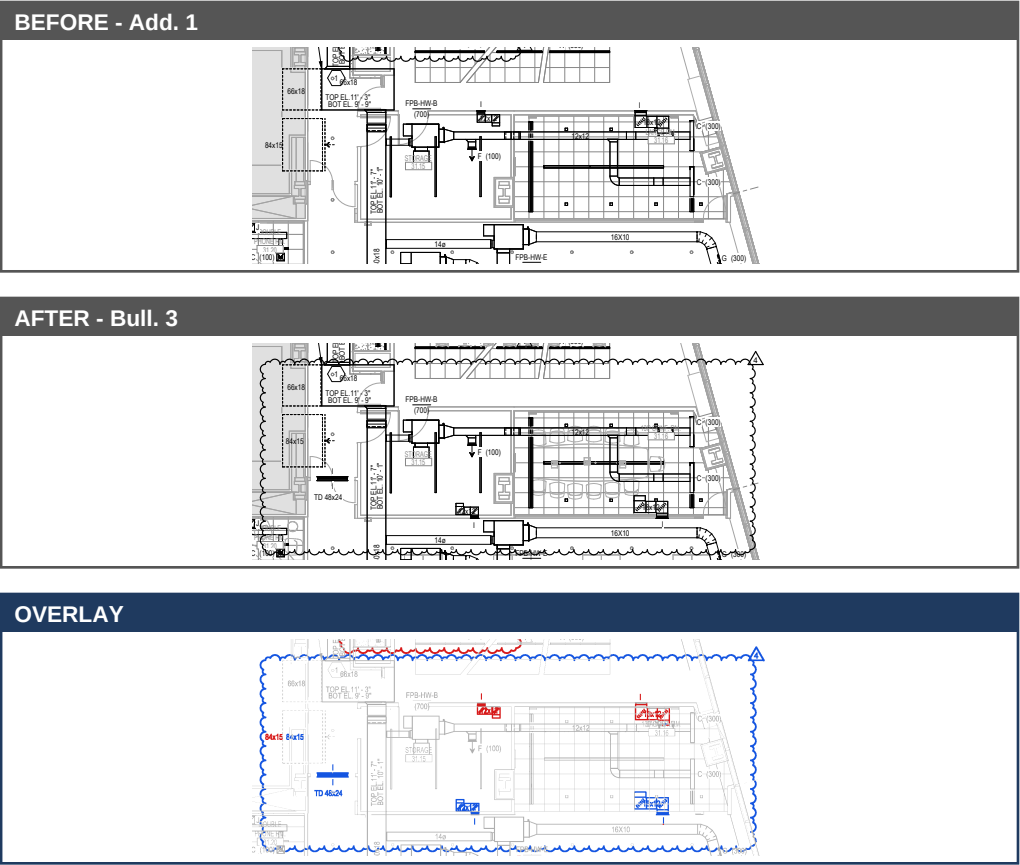


31st Floor - M-531.00: Scope of Work and Cost Breakdown

Labor at \$125.00 per man-hour | Disconnect = removal of installed Addendum 1 work incl. haul away | Material = fabricated ductwork, fittings, insulation, accessories and air outlets Snowflake Fitout - 7 Times Square, Floors 29-31 | COP-SF-05 Bulletin 3 Revision

Area	Scope of work	Disconnect / removal	Material	Install labor	Total
31-1	Zoom rooms, northwest - transfers Before: (1) transfer. After: TD 24x12 and new TD 18x12. Work: Mark-up the wall openings, furnish and install (4) transfer grilles.	-	\$530	6 MH \$750	\$1,280
31-2	Transfer TD 32x16, north Before: Smaller transfer. After: New increased size for wall transfer and (2) grilles. Work: Mark-up the wall openings, furnish and install (2) transfer grilles.	-	\$300	4 MH \$500	\$800
31-3	Storage 31.02 - new transfer ducts Before: No transfer ducts. After: (2) new 44x22 transfer ducts. Work: Fabricate and install (2) 44x22 lined transfer ducts.	-	\$1,700	16 MH \$2,000	\$3,700
31-4	Coffee Bar 31.12 - transfer ducts and main fitting Before: 36x18 main with elbow at Coffee Bar 31.12; no transfer ducts. After: (2) new TD 28x16; 36x18 main elbow reconfigured. Work: Disconnect and remove 36x18 elbow; fabricate and install new fitting and (2) TD 28x16.	6 MH \$750	\$1,750	26 MH \$3,250	\$5,750
31-5	Transfer TD 32x16, southwest Before: Transfer and duct elbow as installed per Addendum 1, next to the 12x8 branch. After: Transfer revised to TD 32x16; 12x8 offset shifted to fit transfer. Work: Remove installed transfer and elbow; fabricate and install new offset, F/I (2) 32x16 transfer grilles.	2 MH \$250	\$650	8 MH \$1,000	\$1,900
31-6	Storage 31.15 / Room 31.16, southeast Before: 12x12 and 18x12 grilles at previous locations; no transfer duct at Storage 31.15. After: New TD 48x24; 12x12 and 18x12 grilles relocated. Work: Remove grilles and their duct connections; mark-up the wall openings, furnish and install (2) 48x24 transfer grilles; relocate 12x12 and 18x12 grilles with duct connections at new locations.	4 MH \$500	\$600	12 MH \$1,500	\$2,600
	Shop drawings for revised design				\$1,000
	31st floor total (12 MH disconnect, 72 MH install)	\$1,500	\$5,530	\$9,000	\$17,030

Key plan - Addendum 1 / Bulletin 3 overlay

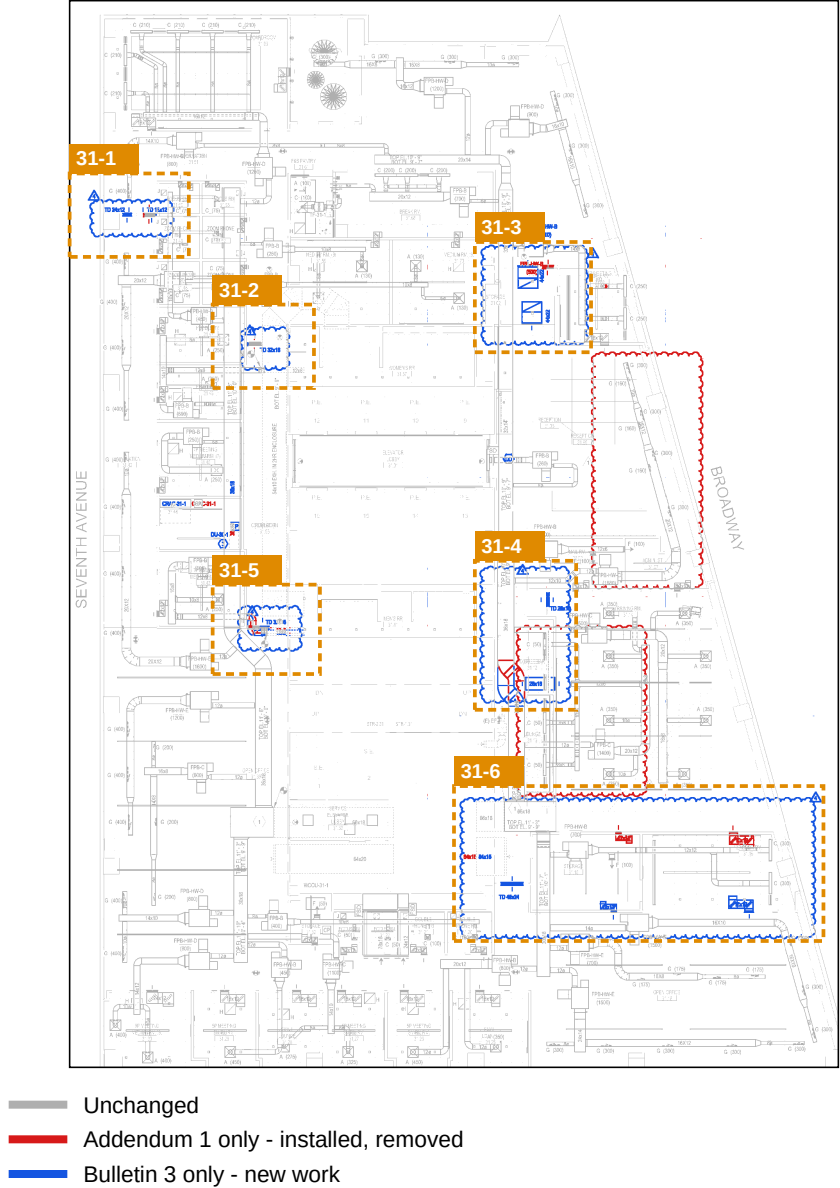

COP-SF-05 summary

Floor	Total
29th floor (M-529.00)	\$16,375
30th floor (M-530.00)	\$20,150
31st floor (M-531.00)	\$17,030
COP-SF-05 revised total	\$53,555

Bulletin 3 was issued after the ductwork in these areas had been fabricated and installed per Addendum 1, so each area includes disconnecting and removing the installed work. Quantities are approximate, taken from the drawings at 1/8" = 1'-0".