

TECHNICAL BULLETIN

JTB00389NAS1
04 DEC 2014



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 206-04A

'Squeal' Noise From Rear Brakes - 380mm Brake Discs

AFFECTED VEHICLE RANGE:

F-TYPE (X152)

Model Year: 2014 Onwards
VIN: K00317 Onwards

With: High Performance Brakes

MARKETS:

NAS

CONDITION SUMMARY:

Situation: A 'squeal' noise from the rear brakes may be evident at slow speed as the vehicle is coming to a stop.

Cause: This may be caused by noise generated from the contact points of the brake caliper and pads.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

C2C39930	Grease Sachet	Quantity: 1
----------	---------------	-------------

TOOLS:

No Tools Required

WARRANTY:



NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.



NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Rear brake caliper set - Apply grease	70.55.08	1.1	42	T2R12793



NOTE: Normal Warranty procedures apply.

SERVICE INSTRUCTION:



NOTE: The following steps must be completed on both sides of the vehicle.

1. Remove the rear left-hand brake pads (see TOPIx Workshop Manual Section 206-04A: Rear Disc Brake - Vehicles Without: Carbon Ceramic Brakes - Brake Pads).




NOTE: Do not apply excessive amounts of grease to the areas shown.

Using a suitable brake cleaner, clean the rear surface of the brake pads and apply the supplied grease to the areas shown.



3. Using a suitable brake cleaner, clean the brake caliper piston and apply the supplied grease in the area shown.

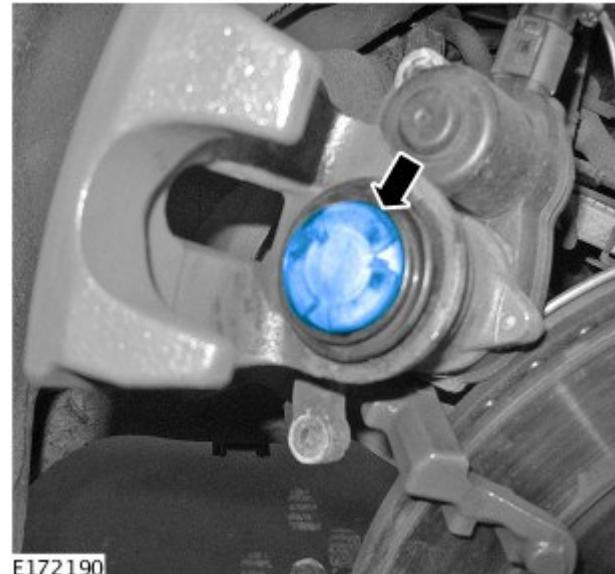

4. Using a suitable brake cleaner, clean the brake caliper carrier and apply the supplied grease to the areas shown.



E172184

- 5.** Install the rear left-hand brake pads (see TOPIx Workshop Manual, section 206-04A: Rear Disc Brake - Vehicles Without: Carbon Ceramic Brakes - Brake Pads).
- 6.** Repeat steps 1-5 on the rear right-hand brake pads.
- 7.** Confirm the rear brake squeal noise is no longer evident.