
## RADIATOR ASSY (2AZ-FE)(From July, 2003) ON-VEHICLE CLEANING

160PU-02

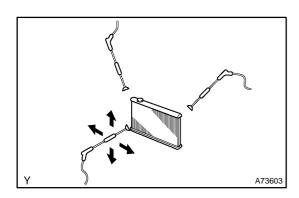

## 1. INSPECT FINS BLOCKAGE

If the fins are clogged, wash them with water or a steam cleaner. Dry with compressed air.

## NOTICE:

• If the distance between the steam cleaner and the core is too close, the fins may become damaged. Keep the following injection distance.

## Standard:

Injection Distance	Injection Pressures
300 mm (11.81 in.)	2,942 to 4,903 kPa (30 to 50 kg/cm², 427 to 711 psi)
500 mm (19.69 in.)	4,903 to 7,845 kPa (50 to 80 kg/cm <sup>2</sup> , 711 to 1,138 psi)

- If the fins are bent, straighten them with a screwdriver or pliers.
- Never apply water directly onto the electronic components.