TRAXNYC box · artwork · flat

every face at full size, laid out as the box unwraps. magenta cuts, blue folds, grey is tooling, gold is foil

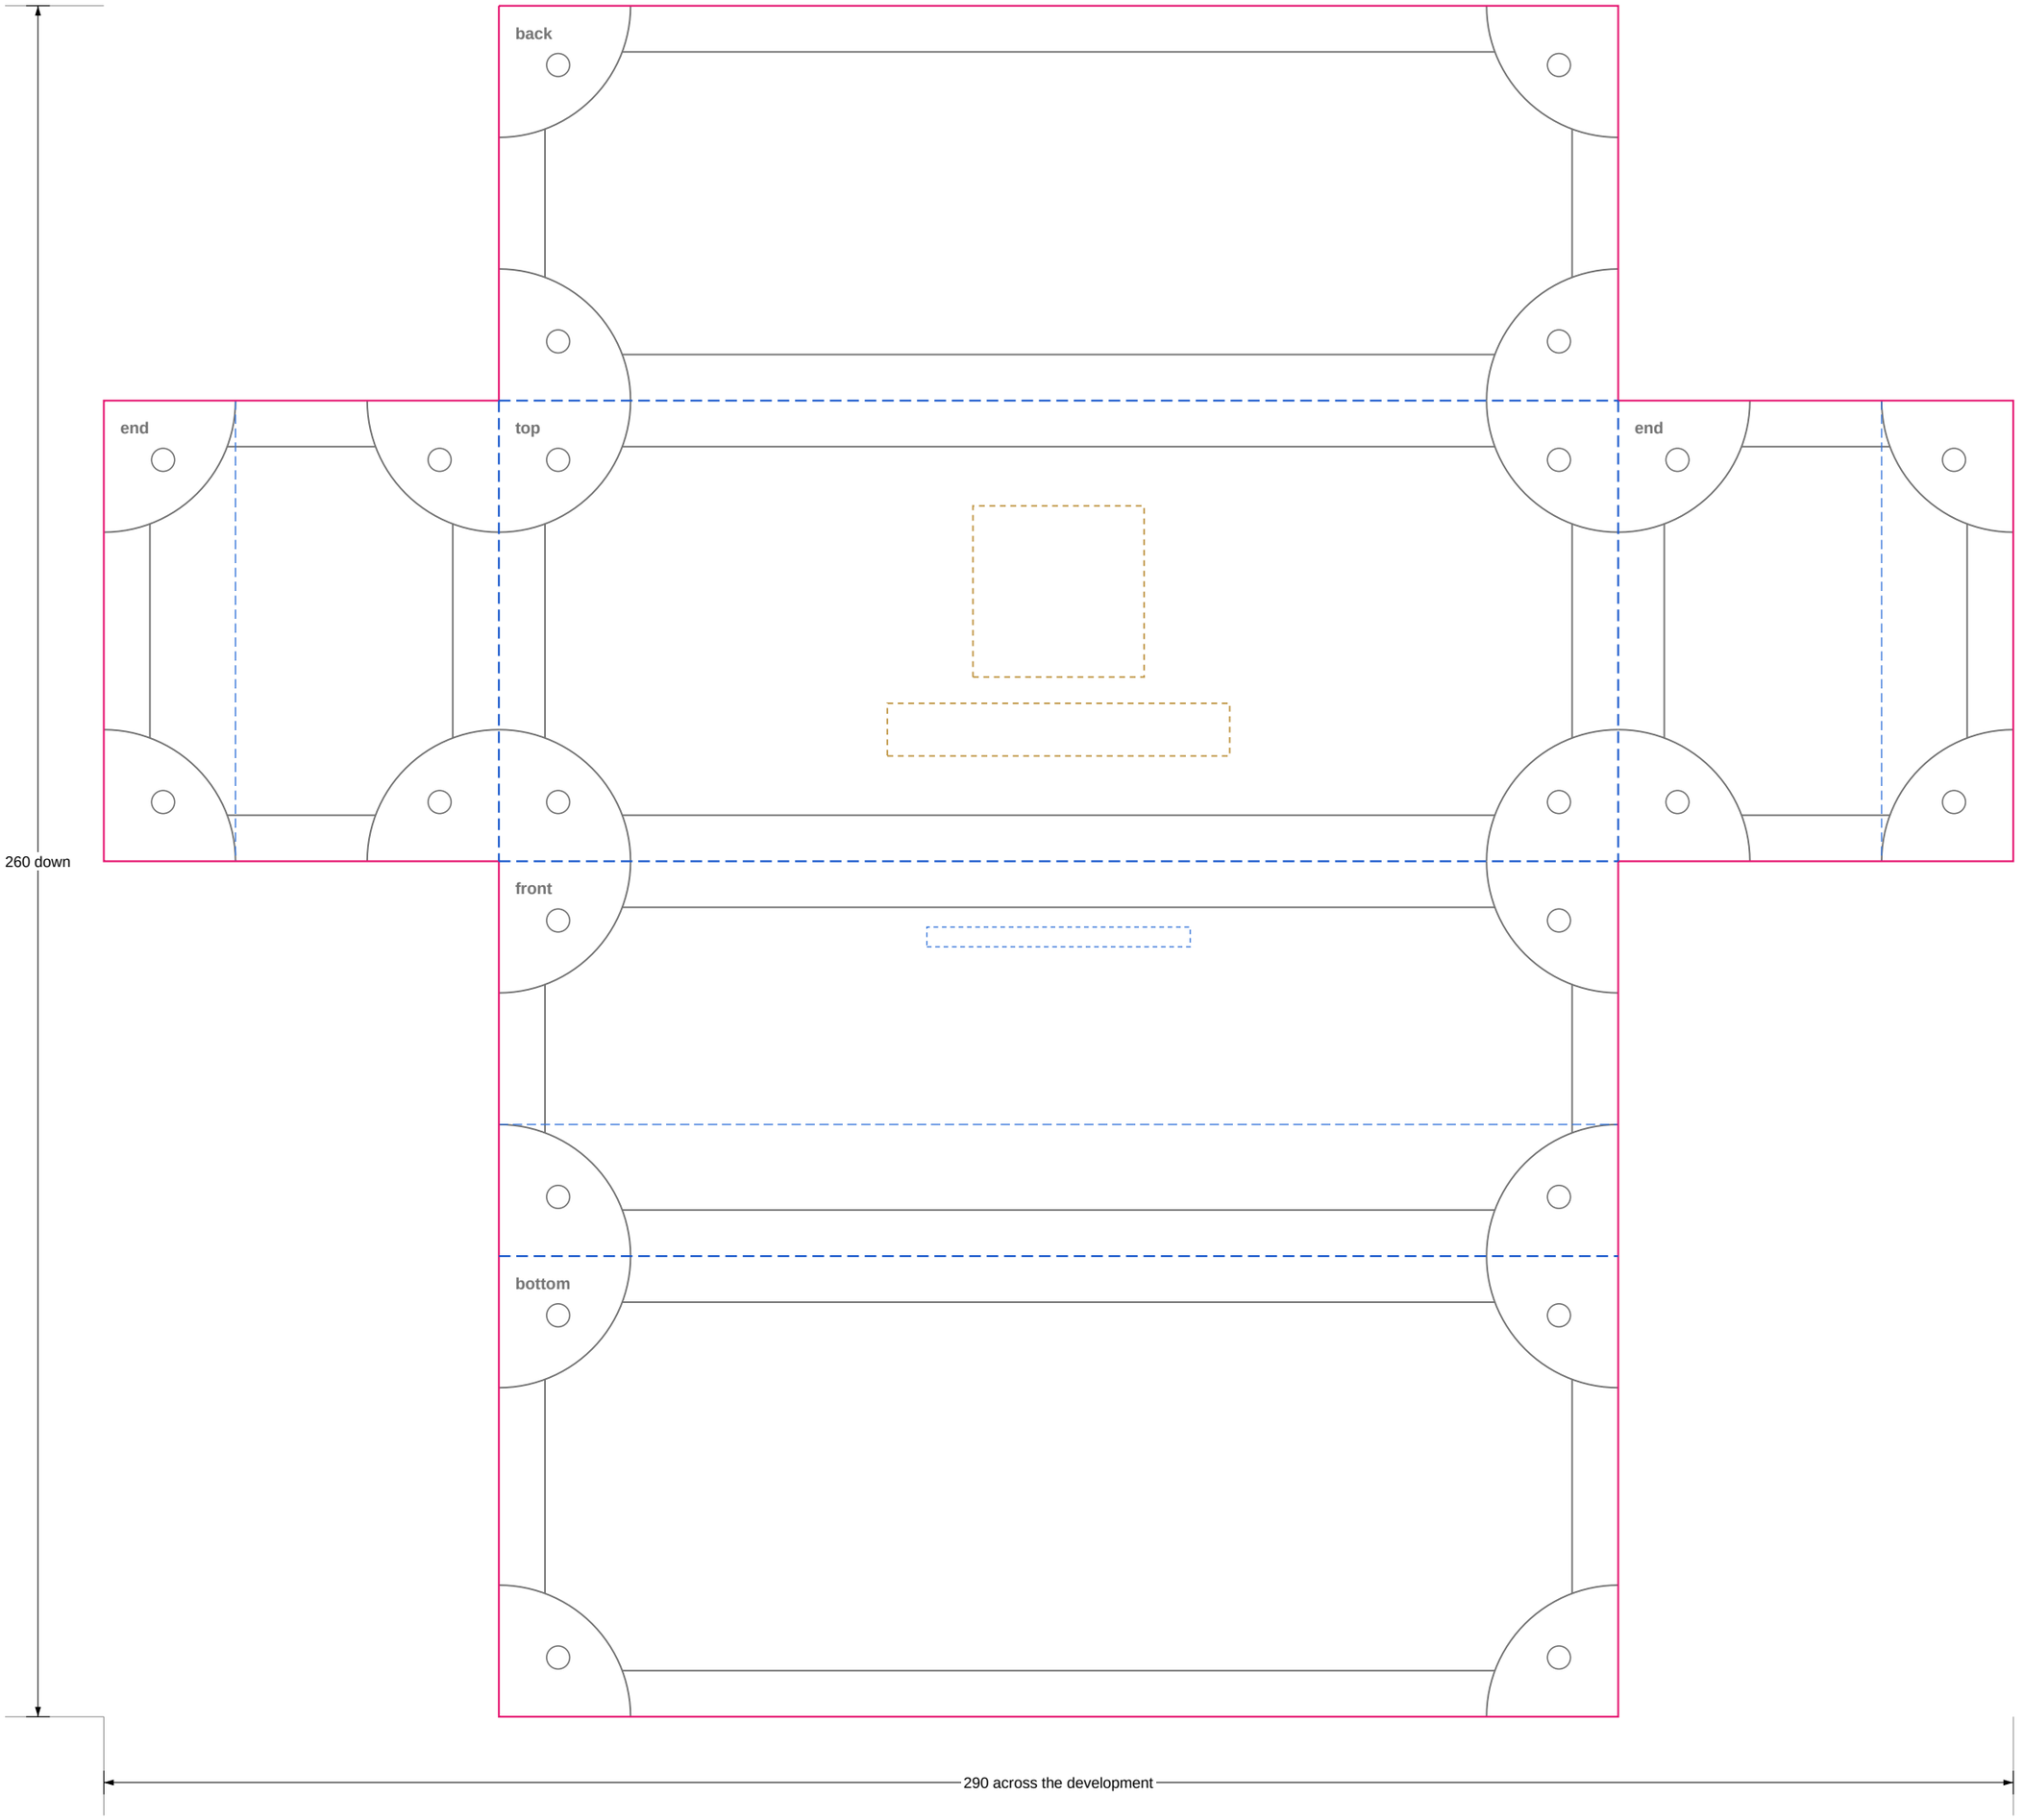

magenta = trim. blue dashed heavy = fold. blue dashed fine = the band line and the magnet, neither of them printed.
grey = blind deboss and cap, the same on every face: line 7 in from the edge, each run stopping 18.7 from the corner where the R20 cap meets it, stud ø3.5 at 9, 9. nothing grey is printed or foiled.

TRAXNYC box · artwork · top · tooling + gold foil

full size. magenta cuts, grey is tooling, gold is foil

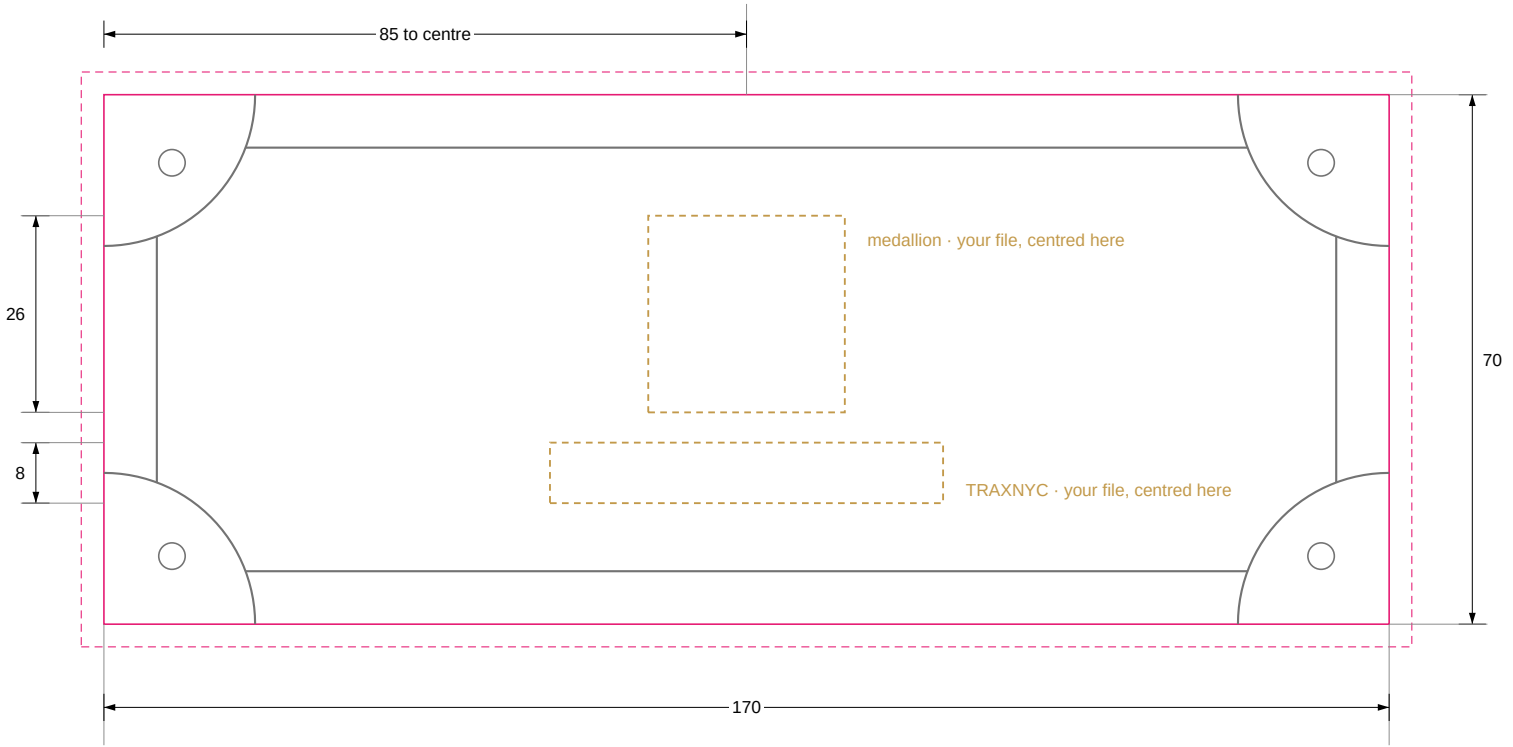

magenta solid = trim. magenta dashed = 3 mm bleed on the wrap.
grey = blind deboss and cap: line 7 in, stopping 18.7 from each corner where the R20 cap meets it; stud ø3.5 at 9, 9.
the line never crosses the cap and the cap never crosses the line.
nothing grey is printed or foiled; it is tooling only.

TRAXNYC box · artwork · front · tooling

full size. magenta cuts, grey is tooling, gold is foil

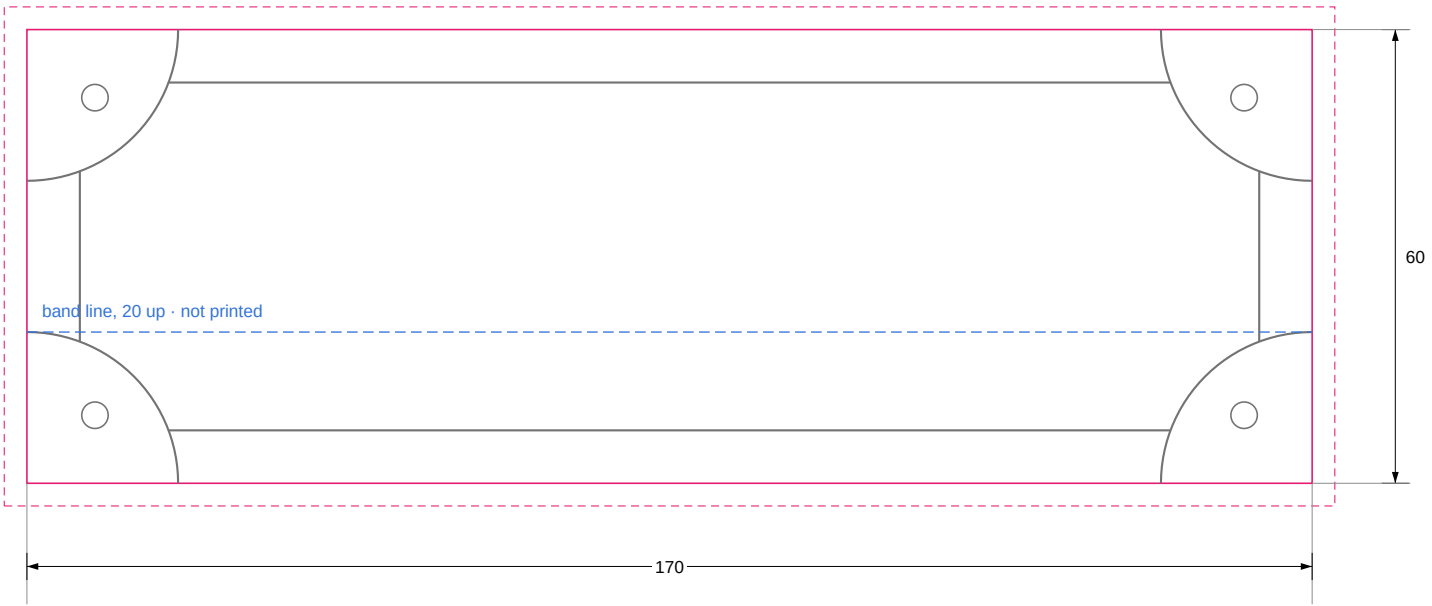

magenta solid = trim. magenta dashed = 3 mm bleed on the wrap.
grey = blind deboss and cap: line 7 in, stopping 18.7 from each corner where the R20 cap meets it; stud ø3.5 at 9, 9.
the line never crosses the cap and the cap never crosses the line.
nothing grey is printed or foiled; it is tooling only.

TRAXNYC box · artwork · end · tooling

full size. magenta cuts, grey is tooling, gold is foil

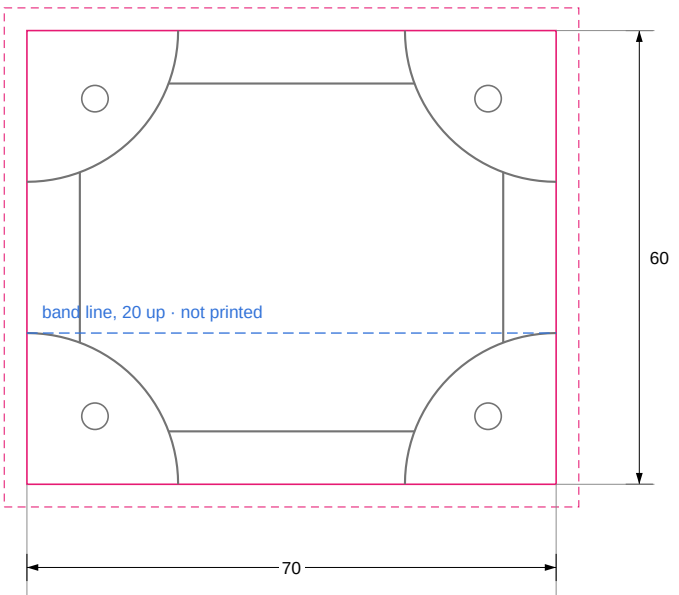

magenta solid = trim. magenta dashed = 3 mm bleed on the wrap.
grey = blind deboss and cap: line 7 in, stopping 18.7 from each corner where the R20 cap meets it; stud ø3.5 at 9, 9.
the line never crosses the cap and the cap never crosses the line.
nothing grey is printed or foiled; it is tooling only.