

OpenIris camera calibration targets


Print at 100% / Actual size (no fit to page, no scaling). Laser printer, matte paper.
Measure the rulers and the outer dots with calipers and enter the measured pitch (printers scale x and y differently).
The missing dots mark the center (where the eye goes): the center, two to its right and one above it. Glue flat on a rigid plate.

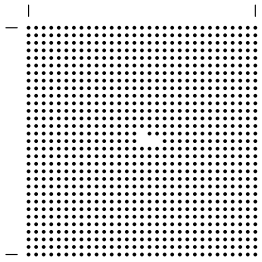


A: pitch 1.0 mm, dots 0.5 mm
31 x 31 dots, outer dots 30 mm apart

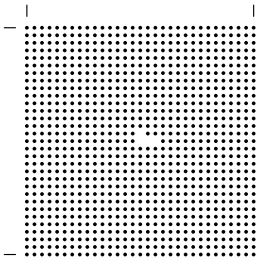

A: pitch 1.0 mm, dots 0.5 mm (spare)
31 x 31 dots, outer dots 30 mm apart

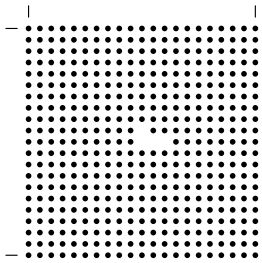

B: pitch 1.5 mm, dots 0.75 mm (more blur tolerant)
21 x 21 dots, outer dots 30 mm apart

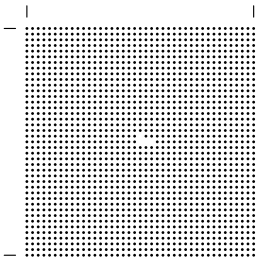

C: pitch 0.75 mm, dots 0.375 mm (finer)
41 x 41 dots, outer dots 30 mm apart



150 mm

Outer dots of every grid are 30 mm apart: measured pitch = measured span / gaps (A 30, B 20, C 40).



150 mm