

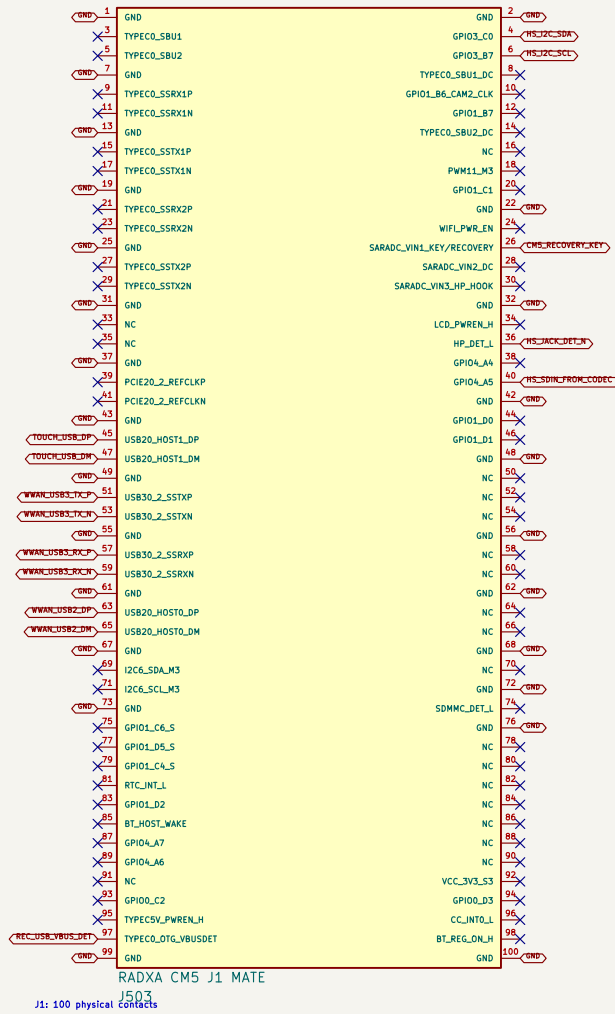
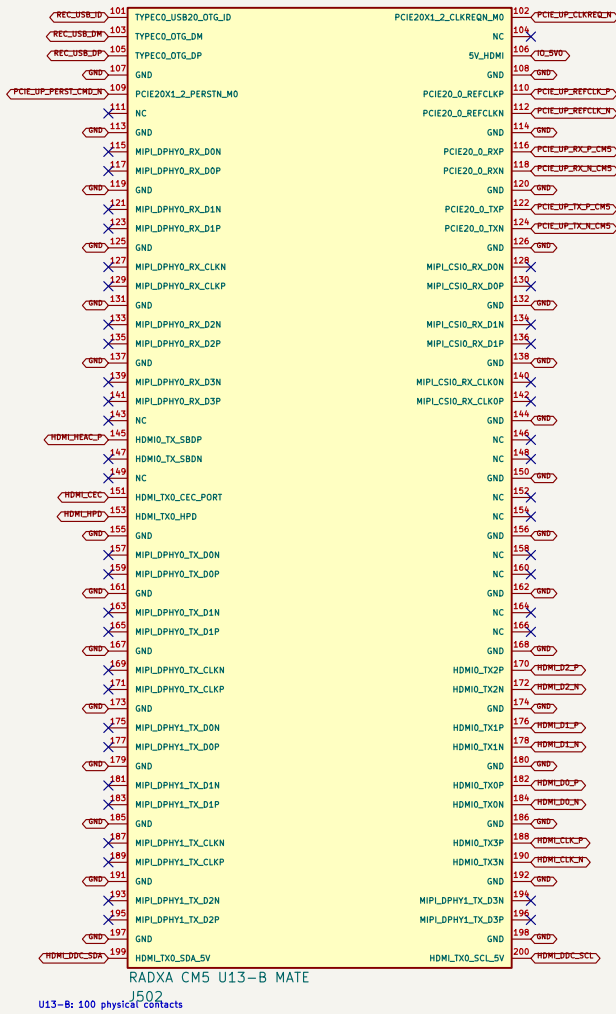
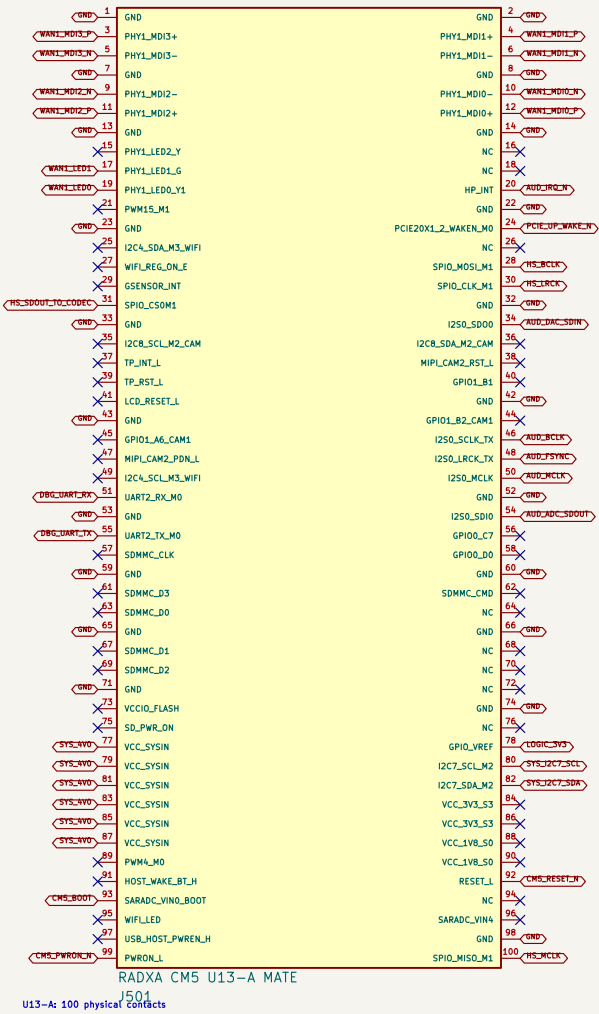
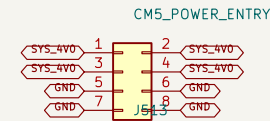
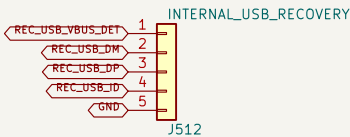


1. EXACT RADXA CM5 MATING CONNECTORS

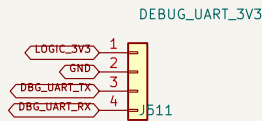

2. INTERNAL POWER / STARTUP / RECOVERY SERVICE

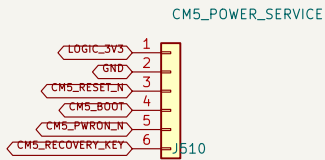

3.3 V UART only; keyed factory/debug cable.

Internal keyed recovery harness; service fixture owns the protected USB-C receptacle and CC network.

Kelvin-sense SYS_AVDD at J501; 4.0 V follows the Radxa CM5 carrier design note.

Internal keyed service header; never exposed on the top panel.

3. OWNERSHIP AUDIT

76 / 76 contacts owned; 74 connected, 2 assigned NC, 0 duplicate physical-pin claims.

WAN1 uses native MDL PCIe Gen2 x1 feeds the packet switch.

WAN0 owns USB30_2 + USB20_HOST0; touch owns USB20_HOST1.

HDMI_TX0, I2S0 TDM, I2S1 headset, I2C7, I2C3 and UART2 are reserved exactly once.

Pin 145 reaches HDMI pin 14; pin 147 is assigned NC because HEAC/ARC is unused. U13-B pin 106 receives IO_5V0.

Unused alternate-function contacts carry explicit no-connect markers on this A1 baseline.