

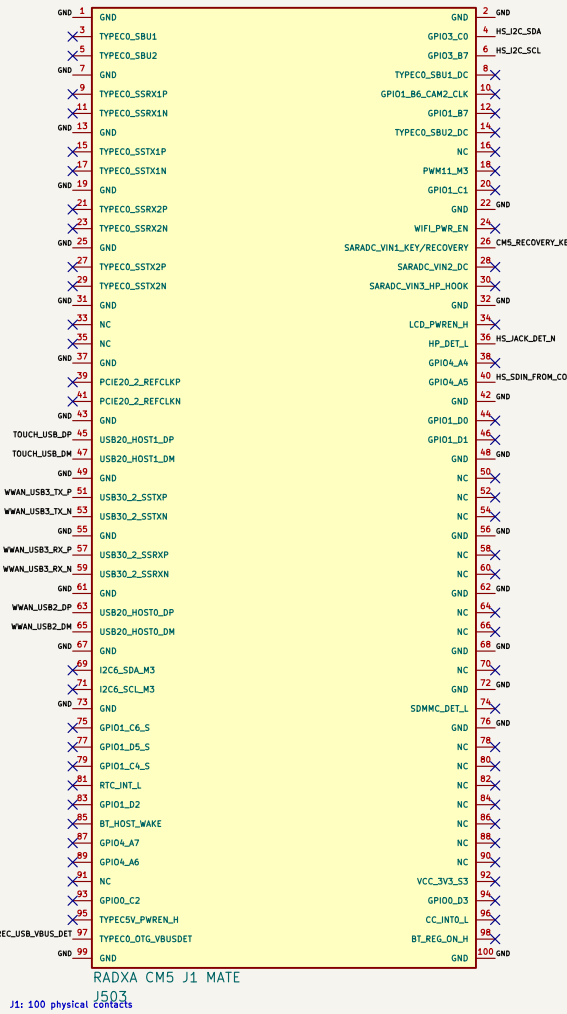
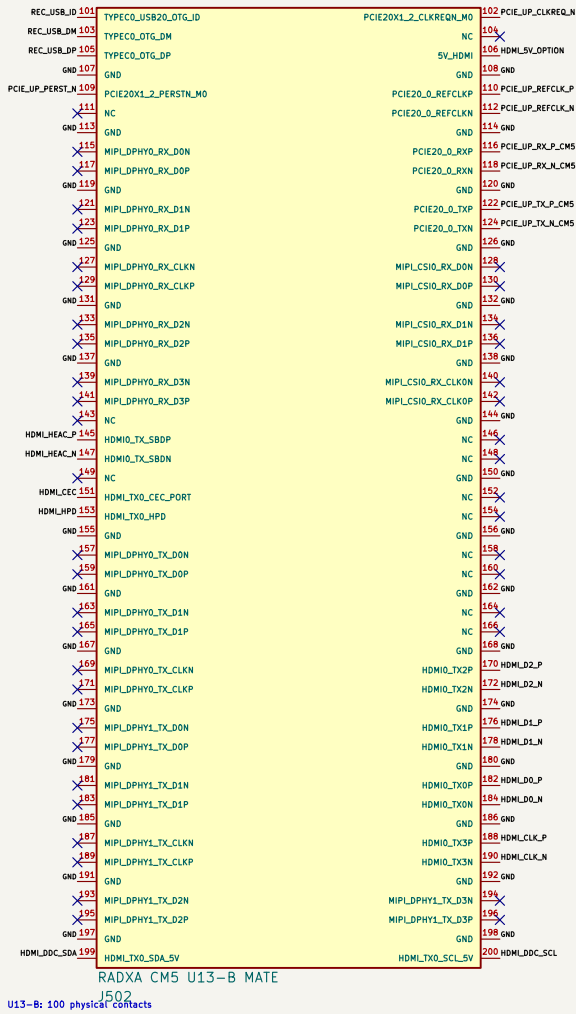
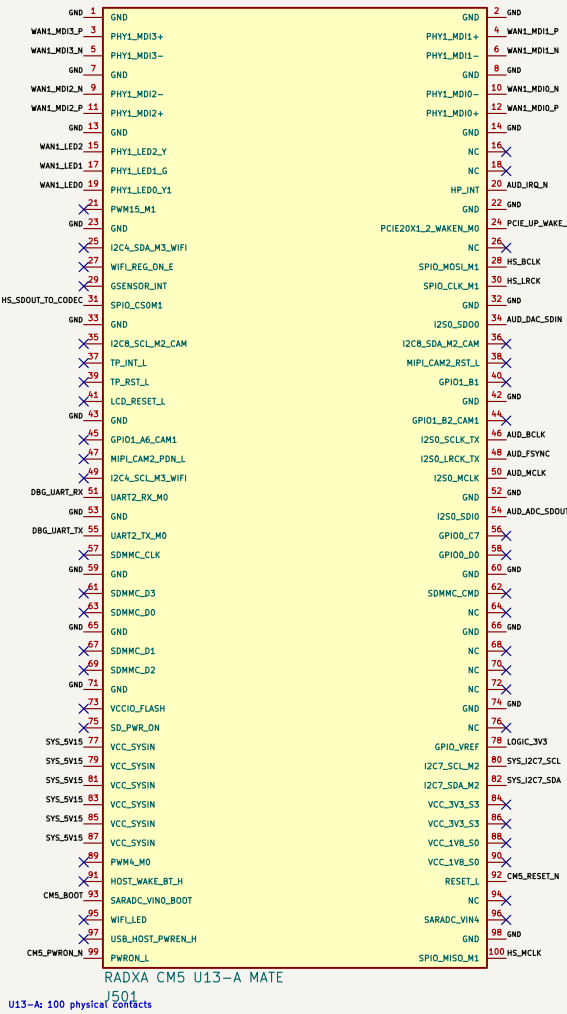
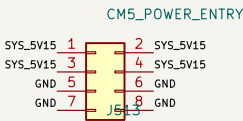
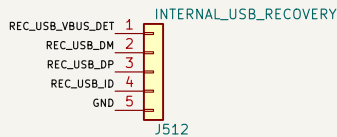


1. EXACT RADXA CM5 MATING CONNECTORS

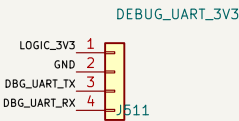

2. INTERNAL POWER / STARTUP / RECOVERY SERVICE

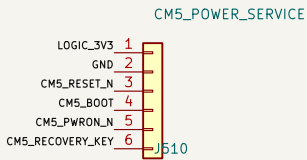

3.3 V UART only; keyed factory/debug cable.

Internal recovery interface; add final protected USB-C receptacle circuit.

Kelvin-sense SYS_SV15 at J501; final setpoint remains a release gate.

Internal keyed service header; never exposed on the top panel.

3. OWNERSHIP AUDIT

76 / 76 allocated contacts connected; 0 duplicate physical-pin claims.

WAN1 uses native MDL PCIe Gen2 x1 feeds the packet switch.

WAN owns USB30_2 + USB20_HOST0; touch owns USB20_HOST1.

HDMI_TX0, I2S0 TDM, I2S1 headset, I2C7, I2C3 and UART2 are reserved exactly once.

Pins 145/147 remain HDMI HEAC reserved. HDMI_SV_OPTION remains a controlled DNP/link decision.

Unused alternate-function contacts carry explicit no-connect markers on this A1 baseline.