



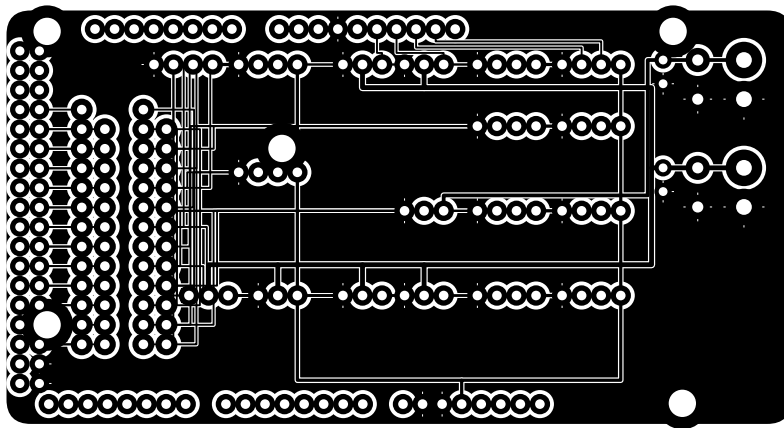

CALIBRATION CHECK BAR = EXACTLY 100.0 mm (Measure with physical caliper/ruler)



PECODROP RVM – ARDUINO MEGA 2560 SENSOR SHIELD (100% SINGLE-SIDED DIY ETCH MASK)

FABRICATION INSTRUCTIONS (TONER TRANSFER / CHEMICAL ETCHING):

1. PRINT SETUP: Print on A4 Glossy Photo Paper or Toner Transfer Film using a Monochrome Laser Printer.
CRITICAL: Set Page Scaling to '100% Actual Size' (Do NOT use 'Fit to Printable Area').
2. VERIFY SCALE: Measure the 100.0 mm calibration bar above with a physical ruler before etching.
3. SOLID COPPER FLOOD: The black background is continuous copper (GND plane) - only white lines are etched.
This prevents over-etching and completes in 6-10 minutes in Ferric Chloride (FeCl3).
4. DRILLING: Drill all component and jumper pads with a 0.8 mm carbide bit. Mounting holes = 3.2 mm.
5. JUMPERS: Solder 25 insulated solid-core 24 AWG jumper wire links between JMP_A and JMP_B on the top side.
All jumper pairs are parallel 8.0 mm horizontal bridges across the central corridor.
6. COMPATIBILITY: 100% hardware match for PecoDropDesktopApp/Arduino/RVM_Arduino/RVM_Arduino.ino.

PECODROP RVM — SHIELD TOP COMPONENT & JUMPER WIRE ASSEMBLY GUIDE (REV 5.0)

