



ISP Environmental Solutions Pvt. Ltd.

MANUFACTURER • ENTERPRISE SMART RECYCLING SYSTEMS

PecoDrop Operator & Employee User Manual

Enterprise dual-display kiosk operation for employee authentication,
material deposits, corporate rewards and safe daily care

Manufactured by: ISP Environmental Solutions Pvt. Ltd.

Product family: ISP PecoDrop Enterprise Recycling Kiosk

Application: PecoDropDesktopApp

Environment: Corporate campuses, offices, factories and universities

Physical system: Dual landscape displays, optical QR scanner, digital keypad and three illuminated shape intakes

Edition: 1 October 2026

This manual intentionally contains only normal operating controls. Confidential service, administrative, servo and display controls are excluded.

1. System identity

PecoDrop is the enterprise/corporate recycling kiosk. One landscape display presents video and instructions; the other provides the interactive kiosk workflow and live corporate leaderboard. Employees authenticate by QR or approved keypad flow, recycle into the matching shaped intake, and receive organization-linked rewards and environmental credit.

CIRCLE

Neon magenta/pink

Plastic PET bottles

TRIANGLE

Neon emerald green

Aluminum/metal cans

SQUARE


Neon cyan blue

Office paper/documents

Measured by weight

Safety and confidentiality: Never insert hands, confidential documents that are not approved for disposal, liquids, glass, batteries, aerosols, sharp metal or general waste. Follow the organization’s document-destruction and privacy policy before recycling office paper.

2. Understand the dual-display dashboard

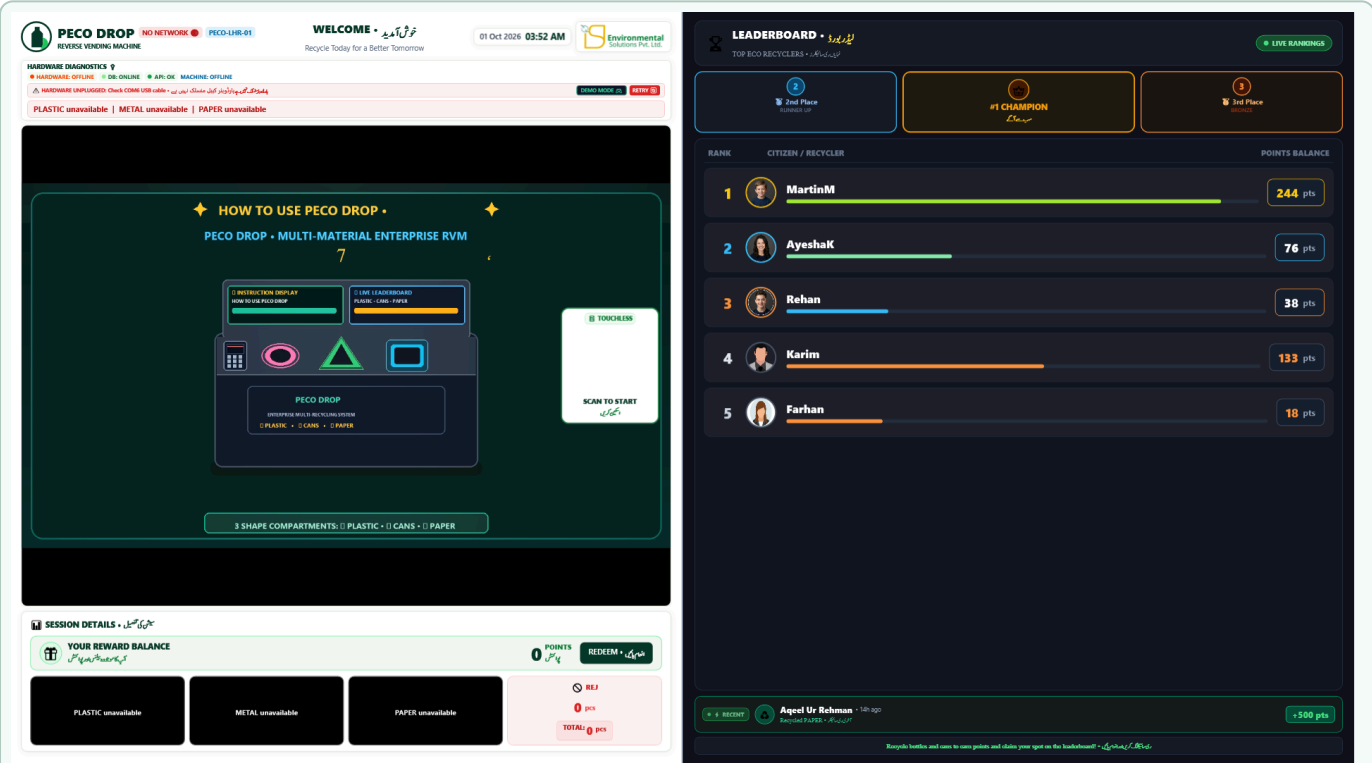

Screen capture from the current PecoDrop landscape application. In this documentation capture, hardware is intentionally disconnected and simulator mode is used; production should show the connected/available state.


- **Instruction/signage side:** Video, step guidance and QR start prompt.
- **Interactive side:** Employee/session information, live totals, reward balance and corporate leaderboard.
- **Diagnostics banner:** Shows hardware, database, API and compartment availability.
- **Compartment cards:** Show plastic count, metal count and paper weight.

3. Before using PecoDrop

- ☐ The correct corporate site/machine identity is displayed.
- ☐ Both displays are on, full-screen and in the expected physical positions.
- ☐ QR scanner window and keypad are clean and unobstructed.
- ☐ No red hardware warning remains on screen.
- ☐ PLASTIC, METAL and PAPER compartments needed for the session show available.
- ☐ All three illuminated apertures are empty and undamaged.

4. Employee authentication and session start


1. Open the approved SmartRecycling/PecoDrop employee experience and scan the start QR, or use the organization's approved QR badge at the optical scanner.
2. If instructed to use the keypad, press operational key **0** once to begin the walk-up flow.
3. Wait for the greeting/session confirmation. Confirm that the displayed corporate context is correct.
4. Do not share another employee's QR identity or credentials.

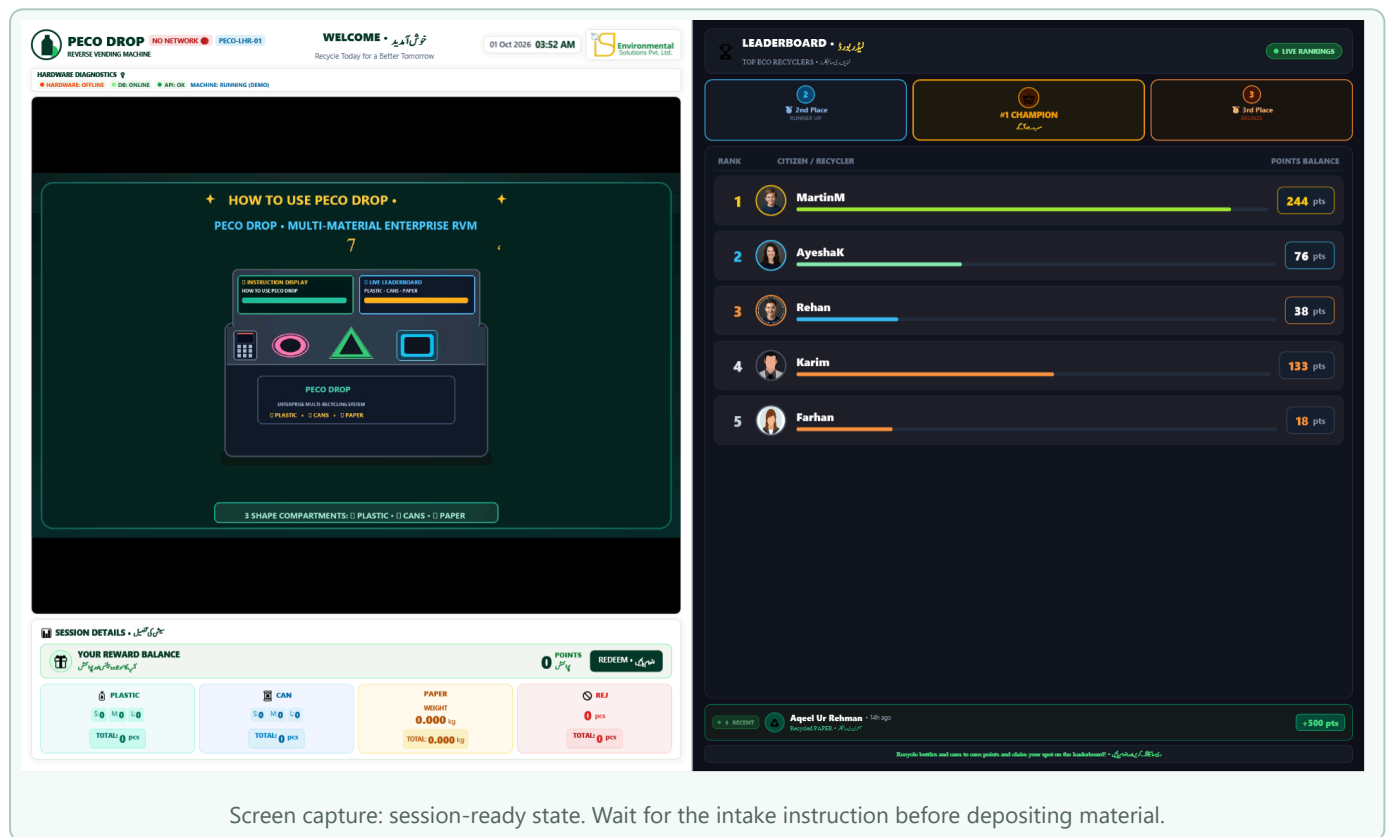

5. Deposit plastic bottles

Use the **0** magenta/pink CIRCLE aperture only.

1. Empty the PET bottle and keep its basic shape recognizable.
2. Wait until plastic is shown as available.
3. Insert one bottle into the circle aperture when prompted.
4. Release it and wait for validation and drop confirmation.
5. Confirm the plastic count and points increased.

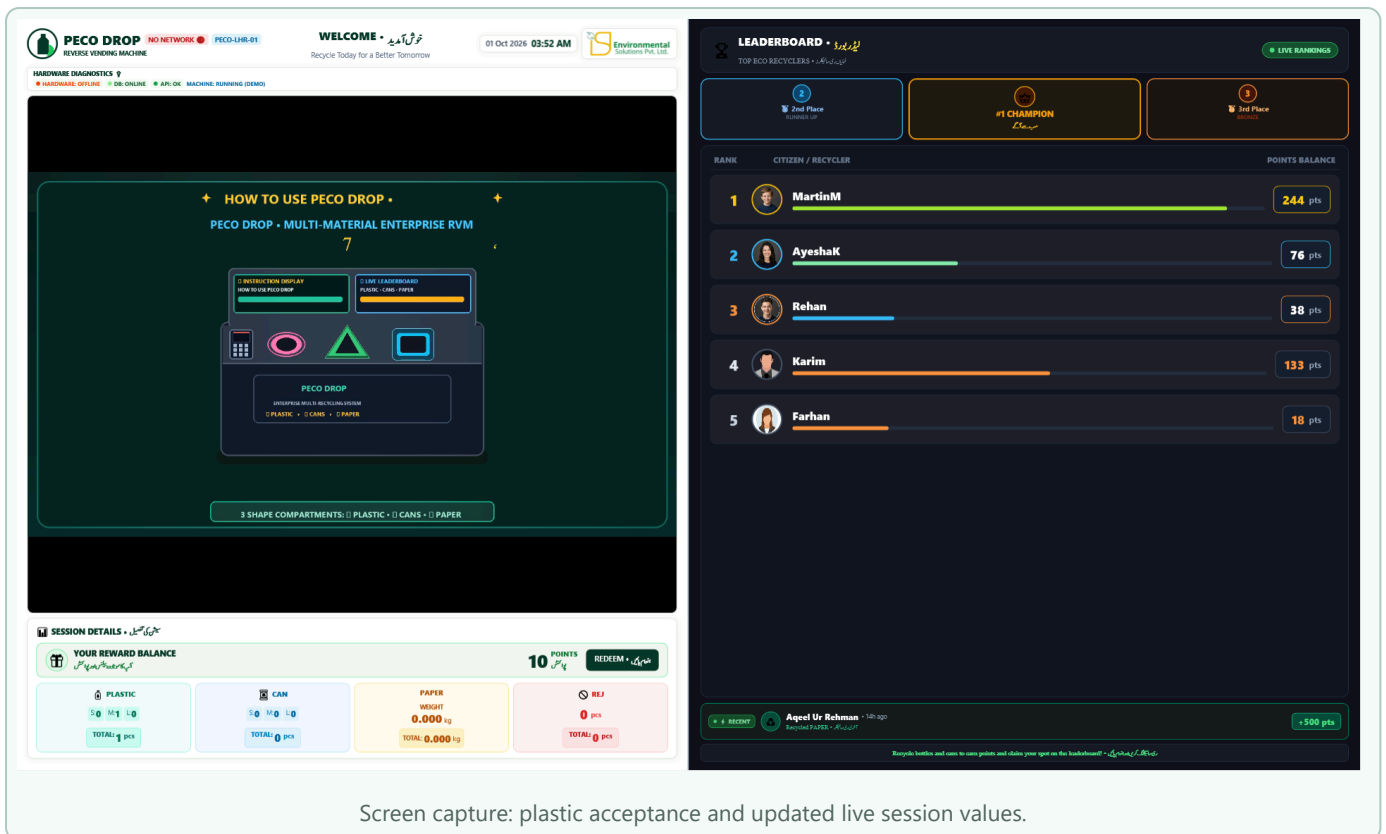


Screen capture: plastic acceptance and updated live session values.

6. Deposit aluminum/metal cans

Use the ▲ emerald TRIANGLE aperture only.

1. Use an empty supported beverage can; do not insert aerosol cans or batteries.
2. Wait until metal is shown as available.
3. Insert one can and release it.
4. Wait for inductive/material validation and drop confirmation.
5. Confirm the metal count and points increased.

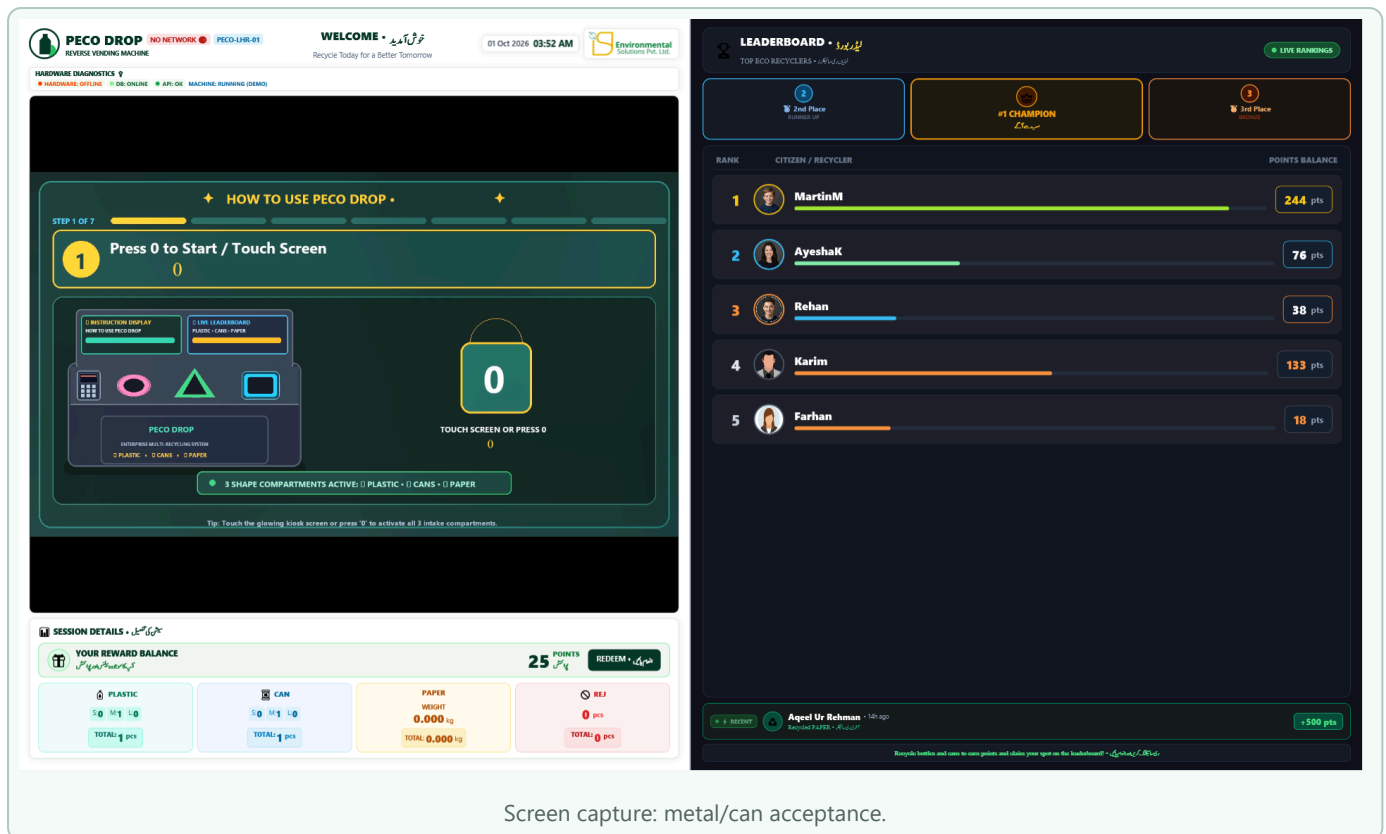


Screen capture: metal/can acceptance.


7. Deposit office paper

Use the ■ cyan SQUARE aperture only. Paper is credited by measured weight.

1. Confirm the paper is permitted by corporate information-security policy.
2. Remove binders, plastic folders, batteries, electronics, food and wet contamination.
3. Wait until paper is shown as available.
4. Place/insert the approved paper as demonstrated, without pushing or holding it during weighing.
5. Wait for a stable measurement and drop confirmation.
6. Confirm the paper weight and reward total increased.

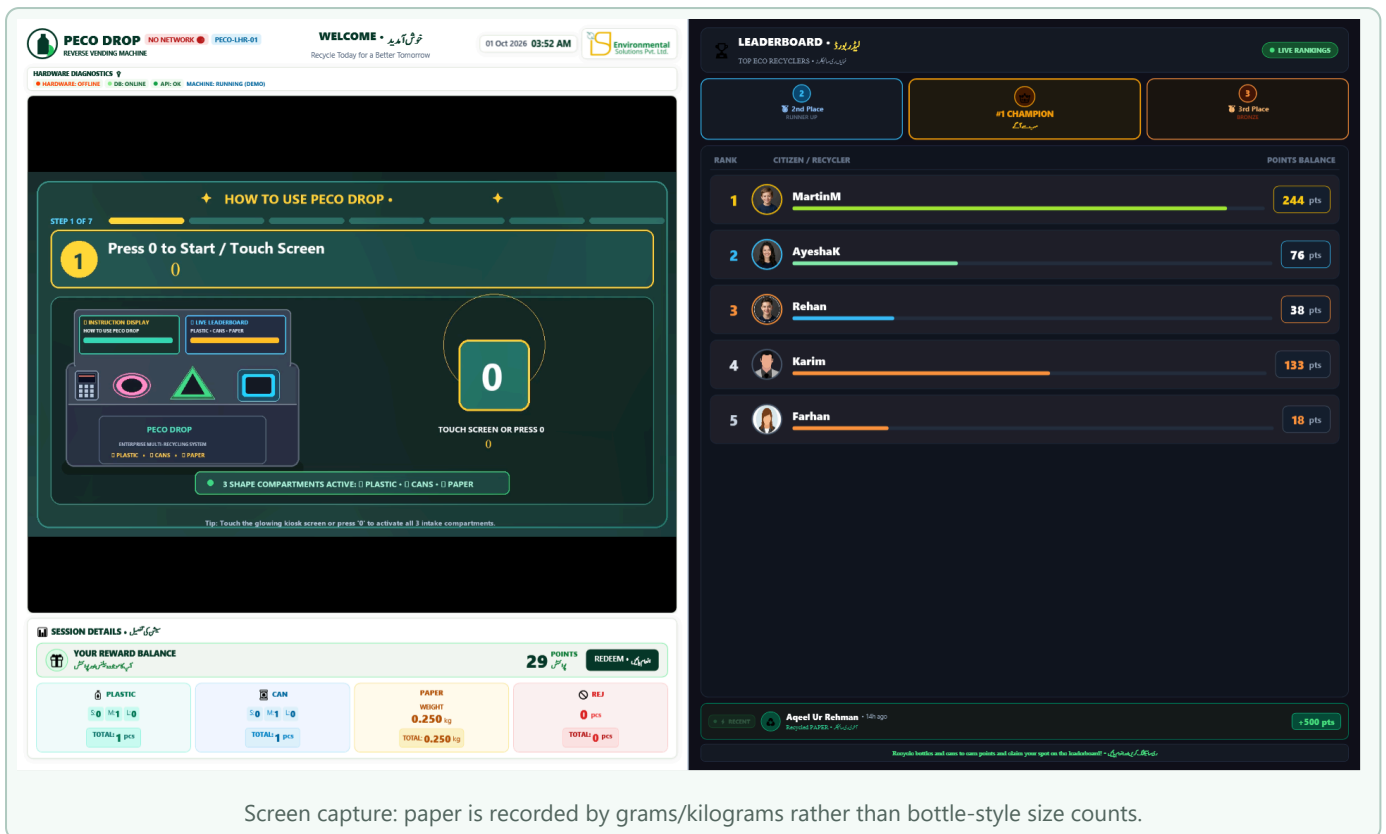

8. Rejected material

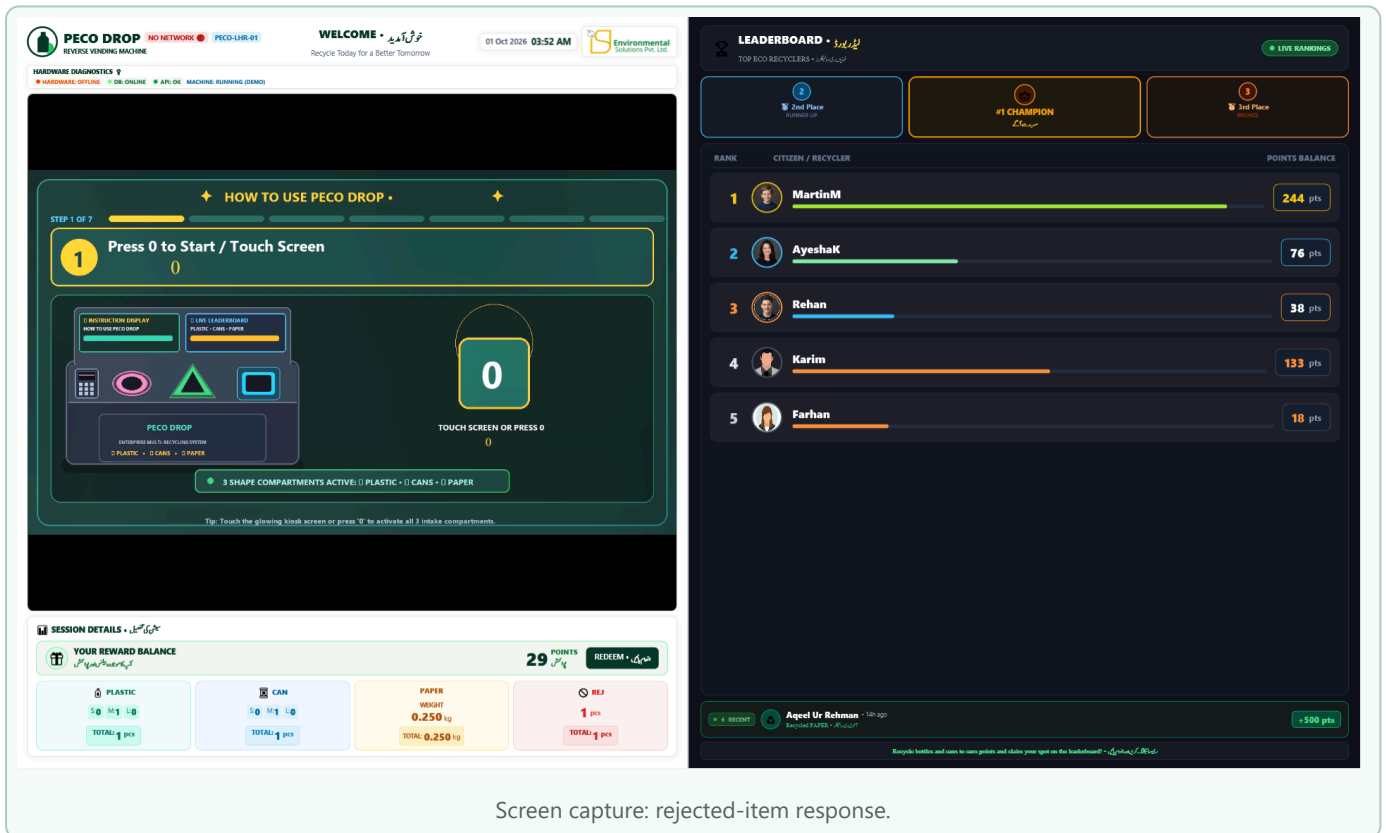

1. Wait until all gate movement stops.
2. Remove the item only from the designated return point when instructed.
3. Confirm the material and shape aperture were correct.
4. Retry a clean eligible item only once.

5. Do not reach inside or attempt to override an unavailable/full compartment.

9. Complete the session

1. After the last accepted item, press operational key **Enter** if the screen requests keypad completion, or finish through the authenticated mobile flow.
2. Review plastic count, metal count, paper weight and earned points.
3. Confirm the reward/corporate perk destination shown on screen.
4. Complete optional feedback and wait for the completion confirmation.
5. Allow the kiosk to return to its welcome screen before leaving.

Enterprise benefits: Depending on organizational policy, points may contribute to employee recognition, department performance, cafeteria discounts, internal perks and CSR/ESG reporting.

10. Site operator opening checklist

- ☐ Cabinet, displays, QR scanner, keypad and apertures are clean and undamaged.
- ☐ Both screens are correctly positioned and responsive.
- ☐ Hardware, database and API indicators are normal.
- ☐ Plastic, metal and paper compartments show the expected availability.
- ☐ Paper weighing area is empty before the first transaction.
- ☐ No residual item blocks a beam, gate or return path.
- ☐ Corporate identity, location and leaderboard scope are correct.
- ☐ One approved test transaction succeeds where site policy permits.

11. First-response troubleshooting

Message/symptom	Safe response
Hardware unplugged/offline	Stop deposits. Do not open energized panels. Notify technical support and record the displayed machine ID.
One compartment unavailable/full	Keep that material closed and service its bin using the approved facility procedure. Other materials may continue only if explicitly shown available.
Calibration/waiting message	Do not deposit until calibration completes and compartment status is verified.
Paper weight does not stabilize	Remove the paper when instructed, ensure it is dry and free of foreign material, and retry once. Report repetition.
QR not recognized	Clean the scanner window, increase screen brightness on the phone, hold the QR steady and confirm the employee account is active.
Wrong display or blank signage	Do not change Windows display settings. Record which physical screen is affected and contact support.
Gate/jam/noise	Do not reach inside or force any mechanism. Isolate the kiosk from users and escalate immediately.
Reward or department credit missing	Record employee/account reference, machine ID, time and displayed session totals for the corporate administrator.

12. Cleaning, privacy and closing

- Use approved screen-safe and exterior cleaning products; apply liquid to a cloth, never directly into hardware.
- Do not use metal tools inside the QR window, keypad or illuminated apertures.
- Handle recovered office paper under the organization's document-security policy.
- Never photograph or distribute employee QR codes or personal information.
- At closing, let active sessions finish, check all apertures/returns, record warnings and follow the approved always-on/shutdown policy.

Emergency escalation: smoke, burning smell, exposed wiring, liquid ingress, repeated uncontrolled motion, damaged glass, forced cabinet access or any injury risk requires immediate isolation and qualified support.