

6.6A -> 3.3V output

max 27V
5A

Q1

100k
R1

FDS8449

VGS = 20V max

Divider 1/11

VOLTAGE

U1
ZXCT1086

CURRENT

0.01
R4

C1

220µF/35V

C2

100nF

C3

1µF/10V

10k
R6

C4

1nF

max. 25V

U2

AOZ1212

D4

+5V

PMEG4050BEP
DS

PMEG4050BEP

C6

100nF

C7

470µF/16V

R7

57.6k

R8


10k

Copyright Tinkerforge GmbH 2016.
This documentation describes Open Hardware and is licensed under the
CERN OHL v. 1.1.
You may redistribute and modify this documentation under the terms of the
CERN OHL v.1.1. (<http://ohwr.org/cernohl>). This documentation is distributed
WITHOUT ANY EXPRESS OR IMPLIED WARRANTY, INCLUDING OF
MERCHANTABILITY, SATISFACTORY QUALITY AND FITNESS FOR A
PARTICULAR PURPOSE. Please see the CERN OHL v.1.1 for applicable
conditions

DRILL DRILL

DRILL DRILL

stack

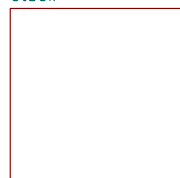

File: ../../../../tmp/git/step-down-powersupply/hardware/V1.3/stack.sch

Copyright (©) 2016, B.Nordmeyer <bastian@tinkerforge.com>
Licensed under CERN OHL v.1.1

Tinkerforge GmbH

Sheet: /
File: working.kicad_sch

Title: Step Down Powersupply

Size: A4 Date: 2016-12-28

KiCad E.D.A. eeschema 7.0.6

Rev: 1.3

Id: 1/2

1		2		3		4		5		6	
A											
B											
C											
D											
Sheet: /stack/ File: stack.sch											
Title:											
Size: A4						Date:			Rev:		
KiCad E.D.A. eeschema 7.0.6									Id: 2/2		